

Submit 3 Copies To Appropriate District Office
 District I
 1625 N. French Dr., Hobbs, NM 88240
 District II
 1301 W. Grand Ave., Artesia, NM 88210
 District III
 1000 Rio Brazos Rd., Aztec, NM 87410
 District IV
 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
 Energy, Minerals and Natural Resources

Form C-103
 June 19, 2008

OIL CONSERVATION DIVISION
 1220 South St. Francis Dr.
 Santa Fe, NM 87505

WELL API NO. 30-025-02541
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name State B
8. Well Number #12
9. OGRID Number 9809
10. Pool name or Wildcat Wilson Yates 7R Assoc.

SUNDRY NOTICES AND REPORTS ON WELLS
 (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well Gas Well Other

2. Name of Operator
State of NM formerly Hal J. Rasmussen Oper Inc

3. Address of Operator
1625 North French Drive, Hobbs, NM 88240

4. Well Location
 Unit Letter I : 1650 feet from the South line and 990 feet from the East line
 Section 13 Township 21-S Range 34-E NMPM Lea County

11. Elevation (Show whether DR, RKB, RT, GR, etc.)

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	P AND A <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPL <input type="checkbox"/>	CASING/CEMENT JOB <input type="checkbox"/>	
DOWNHOLE COMMINGLE <input type="checkbox"/>			
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

**SEE ATTACHED PLUG AND ABANDON
 PROCEDURE**

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Mark Whittem TITLE Compliance Officer DATE 11/25/2014

Type or print name _____ E-mail address: _____ PHONE: _____

For State Use Only
 APPROVED BY: Mark Brown TITLE DIST. SUPERVISOR DATE 11/25/2014
 Conditions of Approval (if any): _____

DEC 01 2014

State of New Mexico formerly HAL J RASMUSSEN OPER INC.

LEASE NAME STATE B #12 API 30-0 25 - 02541

U.L. I Section 13 -T 21 S-R 34 E FROM 1650 # SL, 990 (E) # L.

SPECIAL NOTE—Mud Laden Fluid will consist of 9.5# brine with 12.5# Salt Gel per BBL (25 sacks of gel/ per 100 BBLs Brine). All cement plugs will be 25 sacks of cement or 100', whichever is greater. **Unless otherwise specified in the approved procedure**, cement plugs shall consist of class "C" for depths to 7500'. Class "H" will be used for plugs deeper than 7500'.

1. MIRU plugging unit. Lay down production equipment.
2. Set CIBP @ 3479 '. Circulate MLF. Spot 25 sxs cmt on CIBP.
3. Pressure test casing. If casing **does not hold**, identify casing leak depth. (Leak will be squeezed at depth encountered during procedure).
4. Perf/ Sqz or ~~Spot~~ @ 1700 ' w/ 35 sxs cmt . WOC and TAG.
5. Perf/Sqz or ~~Spot~~ @ 200 '. Sqz or Spot w/ sufficient volume to circ cmt to surface inside/outside of csg strings.
6. Cutoff wellhead and anchors. Verify cement to surface all casing strings. Install marker.


-----**SPECIAL NOTES**-----

HAL J. RASMUSSEN OPER


STATE B # 12

30-025-02541

CURRENT

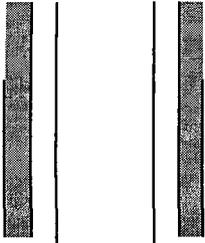

16" @ 95' w/ 140 sx.

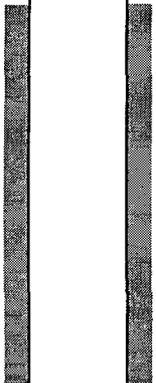

Perfs 3529'-3592'

7" @ 3720' w 280 sx

PBTD 3789'

TD 3894'