

Submit 3 Copies To Appropriate District Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Ave., Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised June 10, 2003

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-36464
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator Tom Brown, Inc.		6. State Oil & Gas Lease No.
3. Address of Operator P O Box 2608, Midland, TX 79702		7. Lease Name or Unit Agreement Name Shelley 36 State
4. Well Location Unit Letter <u>N</u> : <u>660</u> feet from the <u>South</u> line and <u>1980</u> feet from the <u>West</u> line Section <u>36</u> Township <u>19S</u> Range <u>37E</u> NMPM Lea County		8. Well Number 006
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3600		9. OGRID Number 023230
		10. Pool name or Wildcat Skaggs; Drinkard (57000)

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.


11/11/03 Reached TD @ 7225. Ran logs

11/12/03 Contacted Gary Wink w/ OCD about plugging well & where to set plugs.
Set Plug @ 7219 to 7119 w/ 31 sx Class H neat

11/13/03 Set Plug 5424-5324 w/ 46 sx Class H
Set Plug @ 2800 to 2700 w/ 45 sx Class C neat
Re-set plug @ 1565 to 1465 w/ 50 sx Class C
Set Plug @ 400 to 300 w/ 31 sx Class C neat
Set Plug @ 65 to surface w/ 19 sx Class C

11/14/03 Install Dry Hole Marker. Clean Pit. Release Rig @ 2:00 am 11/14/2003

Approved as to plugging of the Well Bore.
Liability under bonds retained until
surface restoration is completed. OCD

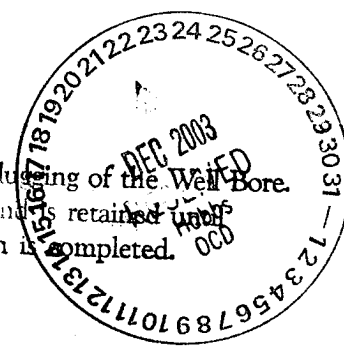

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

TITLE

Operations Asst/Tech

DATE 12/19/03

Type or print name Diane Kuykendall

E-mail address: dkuykendall@tombrown.com Telephone No. 432-688-9773

(This space for State use)

APPROVED BY

TITLE

OCD FIELD REPRESENTATIVE II/STAFF MANAGER

Conditions of approval, if any:

DEC 23 2003