

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-21338
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. VA-0333
7. Lease Name or Unit Agreement Name Shell State
8. Well No. 1
9. Pool name or Wildcat Wildcat Cuerno Largo Pool
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4297' GL

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐
2. Name of Operator Manzano Oil Corporation 505/623-1996
3. Address of Operator P.O. Box 2107/Roswell, NM 88202-2107
4. Well Location Unit Letter B : 330 Feet From The North Line and 2310 Feet From The East Line Section 26 Township 10 South Range 32 East NMPM Lea County

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☐
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Set 100' plug 5200' back up to 5100'. Tag.
2. Set 100' plug base of 8-5/8" shoe from 4550' back up to 4450'. Tag.
3. Set 100' plug above San Andres perms from 4200' back up to 4100'. Tag.
4. Set 100' plug @ 8-5/8" csg stub @ 2250' (from 2300' back up to 2200'). Tag.
5. Pull 8-5/8" csg stuck @ 1415' & put 100' plug @ 11-3/4" shoe from 490' back to 390'.
6. Set 10 sx surface plug. Install dry hole marker.

THIS WORK MUST BE NOTIFIED 24
HOURS BEFORE THE BEGINNING OF
THE WORK FOR THE SURVEY

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Allison Hernandez
TYPE OR PRINT NAME Allison Hernandez

Technician DATE 12/8/95
TELEPHONE NO. 623-1996

(This space for State Use)
ORIGINAL DEPOSITED BY JERRY SEXTON
DEC 12 1995

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

DEC 12 1995
DATE

Any plug
to be moved
sold for
this work??
100' for 11-3/4" shoe

20

Manzano Shell Site #1
330' FNL 2310' FEL

Sec 26
T10S-R32E
Loa Co.

8 5/8" 24# Csg
10 3/4" x 6' sh sec
Stuck @ 1415'

1415'

San Andres Pkts
4209-42
And
4330-35'


438' - 11 3/4" Csg - 42# J55
Cemented w/ 400 sks - Cnd

458 5/8" Csg Stub @ 2250'

4502' - 8 5/8" - 32# J55
Cemented w/ 600 sks

12-14-95

Lost In hole
Rit, Crossover,
8-4 3/8" Drill Collar
12 Jts - 2 7/8" Tbg

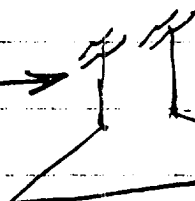

5147' - Top of Sink

5792' - 7 7/8" bit

Remark! Attempt
to Recover Fish.
Tools Going Down
Beside Fish.
Max Depth w/ Fishing
tools - 5200'

7 7/8" hole, TD in 6-9-65
10,000'