

N. M. OIL CONS. COMMISSION

Form 3160-5  
November 1983)  
Formerly 9-331)

UNITED STATES DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT  
NEW MEXICO 88240

Budget Bureau No. 1004-0135  
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		5. LEASE DESIGNATION AND SERIAL NO. NM-40624	
2. NAME OF OPERATOR IREX Operating Company		6. IF INDIAN, ALLOTTEE OR TRIBE NAME	
3. ADDRESS OF OPERATOR 1331 17th Street, Suite 800, Denver, Colorado 80202		7. UNIT AGREEMENT NAME	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1980' FSL & 660' FWL		8. FARM OR LEASE NAME Seguaro '35' Federal	
14. PERMIT NO.		9. WELL NO. 1	
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 4156' GR		10. FIELD AND POOL, OR WILDCAT Allison Bagley-Penn	
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 35, T8S, R35E	
		12. COUNTY OR PARISH Roosevelt	13. STATE N.M.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:


TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>	WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>	FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input type="checkbox"/>	SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	(Other) <input type="checkbox"/>	
(Other) Plug Back		(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)	

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

Propose to set a C.I.B.P. @ 9712' and cap C.I.B.P. with 35' of cement.

Prepare to plug back to the San Andres formation. Load 5 1/2" casing with 2% KCL water. Pressure test casing and C.I.B.P. Perforate 5 1/2" casing @ 4910' (4 shots) and prepare to run cement squeeze. Run cement retainer on tubing and set retainer at 4870'. Squeeze with 100 sx of cement to cover San Andres pay section. W.O.C. Drill out cement retainer and run a Cement Bond Log to make sure pay section and above is covered with cement. If cement job is sufficient prepare to perforate.

Perforate from 4885-4894' (4SPF) and acidize perms with 1000 gallons of MCA acid. Flow and swab back load if necessary. Evaluate well.

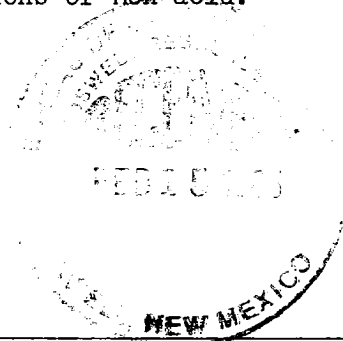


18. I hereby certify that the foregoing is true and correct

SIGNED Larry W. Franklin TITLE Agent DATE 2/15/85

(This space for Federal or State office use)

APPROVED BY PETER W. CHESTER TITLE \_\_\_\_\_ DATE \_\_\_\_\_

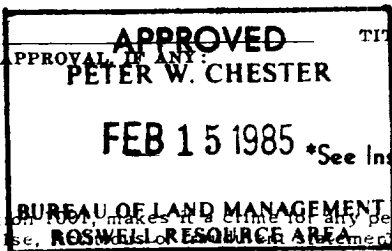

RECEIVED

FEB 20 1985

O.C.D.  
HOBBES OFFICE