

State of New Mexico
Energy, Minerals and Natural Resources

District I – (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II – (575) 748-1283
811 S. First St., Artesia, NM 88210
District III – (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV – (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM
87505

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-031-05201
5. Indicate Type of Lease STATE ☐ FEE ☒
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Hospah Sand Unit
8. Well Number 50
9. OGRID Number
10. Pool name or Wildcat Upper Hospah
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 6973

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator
Dominion Production Company, LLC

3. Address of Operator
1414 W Swann Av, Suite 100, Tampa, FL 33606

4. Well Location
Unit Letter P 330 feet from the S line and 660 feet from the E line
Section 36 Township 18N Range 9W NMPM County McKinley

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐
CLOSED-LOOP SYSTEM ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐
OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Dominion Proposes to plug this well in accordance with the attached procedure and any agreed modifications thereto.

ESTIMATED START DATE 1/1/22

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE pp. K Menard TITLE Authorized Contractor DATE 11/16/21

Type or print name Drake McCulloch E-mail address: drake@dwsrigs.com PHONE: 505 320 1180

For State Use Only

APPROVED BY: _____ TITLE _____ DATE _____

Conditions of Approval (if any):

Plug and Abandonment Plan
Dominion Production Co, LLC.
Hospah Sand Unit 50
API# 3003105201
330' FSL & 660' FEL
Sec. 36 T18N R9W
McKinley County, New Mexico

1. Comply with all OCD, DPC and contractor safety rules and regulations. Hold safety meetings each morning.
2. MIRU, Check Braden head for pressure. Bleed pressure off of well if necessary.
3. **Plug # 1- (Gallup Perforations and Formation Top 1614'-1420')** RIH with 2 7/8" 4.7#, WS with mule shoe sub. Wash wellbore to depth of 1614'. Mix and Pump 39 Sks, Type III Cement @ 14.6 ppg to cover Gallup with 50' cap and 50' excess.
4. **Plug #2-(Mancos Plug/ Surface Plug, 750'-Surface)** MIRU Wireline Truck, RIH with CBL Tool, from approx 1420' to Surface. Shoot 3-3/8" Squeeze holes (120 Degree Phasing) at approx. 750', actual to be determined from Bond Log. MIRU Pump Truck, Pump Approx. 20 bbls Fresh Water to establish circulation through Squeeze Holes. At Successful Circulation, Mix and Bullhead 130 Sks, Type III Cement @ 14.6 ppg, for outside annulus, Mancos Surface Plug, followed with 102 Sks of Type III Cement @ 14.6 ppg from 750' to Surface. Allow well to stabilize overnight. Top Casing off with Cement if necessary.
5. Cut off well 3' below ground and install P&A marker per OCD specifications. RD, cleanup MOL.
6. Restore location to OCD specifications.
7. All cement volumes are subject to change once surface and production casing sizes are confirmed in the field when operations begin. All current volumes and depths are assumptions based on previous wellbores.

Hospah Sand Unit 50
API #: 3003105201
McKinley County, New Mexico

No casing records. Casing to be cemented once operation commences.

GR - 6973 feet

No casing records. Casing to be cemented once operation commences.

1592 feet - 1605 feet

Wellbore Diagram

Hospah Sand Unit 50
API #: 3003105201
McKinley County, New Mexico

Plug 2

750 feet - Surface
750 feet plug
232 sacks of Type III Cement

Plug 1

1614 feet - 1420 feet
194 feet plug
39 sacks of Type III Cement

Surface Casing

No casing records. Casing to be
cemented once operation
commences.


GR - 6973 feet

Production Casing

No casing records. Casing to be
cemented once operation
commences.

Perforations

1592 feet - 1605 feet

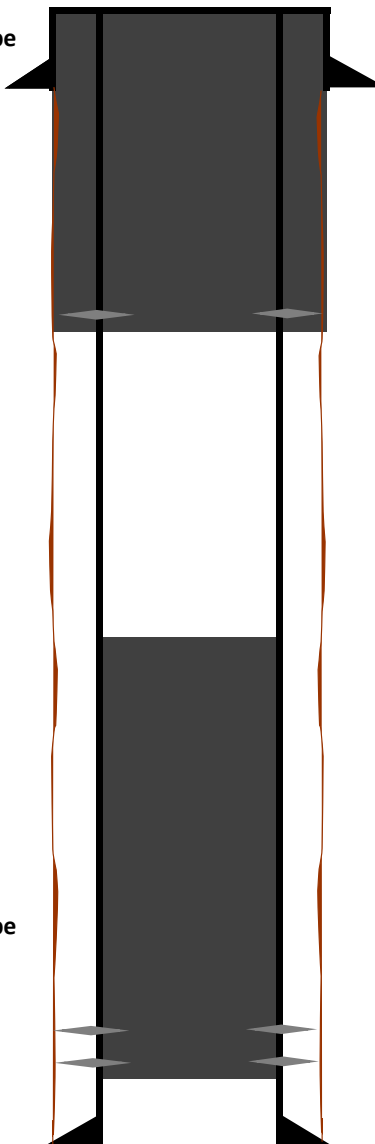

District I

1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720

District II

811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170

District IV

1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 62577

CONDITIONS

Operator: DOMINION PRODUCTION COMPANY, LLC 1414 W Swann Avenue Tampa, FL 33606	OGRID: 291567
	Action Number: 62577
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
kpickford	Notify NMOCD 24 Hours Prior to beginning operations	11/23/2021
kpickford	CBL required	11/23/2021