

Submit 1 Copy To Appropriate District Office  
 District I – (575) 393-6161  
 1625 N. French Dr., Hobbs, NM 88240  
 District II – (575) 748-1283  
 811 S. First St., Artesia, NM 88210  
 District III – (505) 334-6178  
 1000 Rio Brazos Rd., Aztec, NM 87410  
 District IV – (505) 476-3460  
 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
 Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION  
 1220 South St. Francis Dr.  
 Santa Fe, NM 87505

Form C-103  
 Revised July 18, 2013

<b>SUNDRY NOTICES AND REPORTS ON WELLS</b> (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.) 1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		WELL API NO. 30-015-37122
2. Name of Operator Mewbourne Oil Company		5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
3. Address of Operator PO Box 5270, Hobbs NM 88241		6. State Oil & Gas Lease No.
4. Well Location Unit Letter <u>K</u> : 1650 feet from the <u>South</u> line and <u>2310</u> feet from the <u>West</u> line Section <u>9</u> Township <u>20S</u> Range <u>25E</u> NMPM <u>Eddy</u> County		7. Lease Name or Unit Agreement Name Gunsmoke 9 K
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3464' GL		8. Well Number <u>1</u>
9. OGRID Number <u>14744</u>		10. Pool name or Wildcat Undesignated Yeso

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	P AND A <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPL <input type="checkbox"/>	CASING/CEMENT JOB <input type="checkbox"/>	
DOWNHOLE COMMINGLE <input type="checkbox"/>			
CLOSED-LOOP SYSTEM <input type="checkbox"/>			
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

See attached Plugging report.

Call Jake Nave if you have any questions.

Spud Date:

Rig Release Date:

Approved for plugging of well bore only. Liability under bond is retained pending Location cleanup & receipt of C-103Q (Subsequent Report of Well Plugging) which may be found at OCD Web Page, OCD Permitting @ [www.emnrd.state.nm.us](http://www.emnrd.state.nm.us)

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Jackie Lathan TITLE Regulatory DATE 08/08/22

Type or print name Jackie Lathan E-mail address: jlathan@mewbourne.com PHONE: 575-393-5905

**For State Use Only**

APPROVED BY: [Signature] TITLE Staff Manager DATE 8/12/2022

Conditions of Approval (if any):

**Gunsmoke 9 K #1**

MIRU P&A rig & equip. ND WH & NU BOP. Strip OOH & LD rods & tbg. PU 3 5/8" tri-cone bit & RIH w/tbg to 2471' w/no tag. POOH & PU 4 1/2" CIBP. RIH w/CIBP to 2435'. Unable to set CIBP (tbg plugged). POOH & found scale in setting tool. RIH w/CIBP & tagged @ 1653'. Unable to work tbg up, worked tbg down until free. Continue RIH to 2435'. Unable to set CIBP (tbg plugged). Pumped 40 BBW down csg & pressured tbg to 3k# but did not clear blockage. RU WL & RIH w/1.5" jet cutter & tagged CIBP @ 2442' WL. Cut tbg @ 2428' WL. Fish LIH: 4 1/2" CIBP & 1/2 jt of tbg (total length 16.3'). POOH & RD WL. RIH to 2435'. Spotted 25 sks Class C cmt w/2% CaCl. POOH w/tbg. WOC. RIH & tagged TOC @ 2376'. Pumped 40 BBW down csg (well on vacuum). Spotted 25 sks Class C cmt w/2% CaCl. POOH & WOC. RIH & tagged TOC @ 1950'. Pumped 40 BBW down csg (well on vacuum). LD tbg to 910'. POOH w/tbg & PU 4 1/2" pkr. RIH & set pkr @ 910'. Tested 4 1/2" csg above pkr to 500#, held OK. Released pkr & LD tbg to 390'. POOH w/tbg & RU WL. RIH & perf @ 864' WL. POOH & RD WL. RIH & set pkr @ 390'. Squeezed 40 sks Class C cmt w/2% CaCl. WOC. RIH & tagged TOC @ 822'. Tested csg to 500#, held OK. Pumped 20 BBW down 4 1/2" x 8 5/8" annulus but did not load. POOH w/tbg & RU WL. RIH & perf @ 815' WL. POOH & RD WL. RIH & set pkr @ 390'. Squeezed 40 sks Class C cmt. WOC. RIH & tagged TOC @ 697'. Tested csg to 500#, held OK. Loaded & tested 4 1/2" x 8 5/8" annulus to 500#, did not hold (bled off to 0# in 30 sec.). POOH w/tbg & RU WL. RIH & perf @ 685' WL. POOH & RD WL. RIH & set pkr @ 390'. Squeezed 25 sks Class C cmt w/2% CaCl. WOC. RIH & tagged TOC @ 472'. Tested 4 1/2" csg & 4 1/2" x 8 5/8" annulus to 500#, both held OK. LD tbg & RU WL. RIH & perf @ 200'. POOH & RD WL. ND BOP & NU cap flange. Broke circ around 4 1/2" x 8 5/8" annulus. Circ 75 sks Class C cmt to surface. WOC. Dug out cellar & cut off WH 4' below surface (verified cmt @ surface). Installed below ground dry hole marker. Backfilled cellar. Dug out anchors & back filled holes. RDMO rig & equip. **Well P&A'd effective 7/27/22.**


Gunsmoke 9 K #1 After

Last Updated: 7/27/2022  
API#: 30-015-37122

Installed below ground dry hole marker

Surface

11" x 8 5/8" 24# csg  
Set @ 814'  
Circ. 40 sks to pit

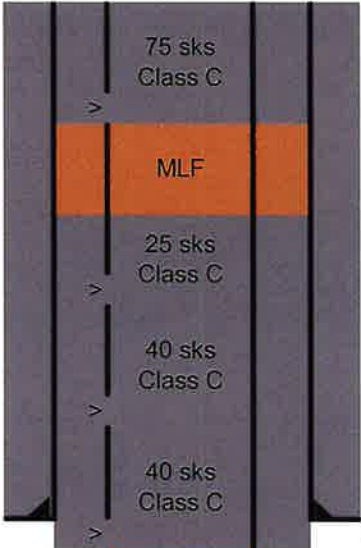

Verified cmt @ surface  
Perf & circ 75 sks Class C cmt to surface  
Tagged TOC @ 472', tested 4 1/2" x 8 5/8" annulus to 500#, OK  
Perf & squeezed 25 sks Class C cmt @ 685'  
Tagged TOC @ 697'  
Perf & squeezed 40 sks Class C cmt @ 815'  
Tagged TOC @ 822'  
Perf & squeezed 40 sks Class C cmt @ 864'

Production

7 7/8" x 4 1/2" 11.6# csg  
Set @ 3253'  
TOC @ 1040' via CBL



Tagged TOC @ 1950'  
Spotted 25 sks Class C cmt @ 2376'  
Tagged TOC @ 2376'  
Spotted 25 sks Class C cmt @ 2435'

Yeso Perfs

2457' - 2798'

**District I**  
1625 N. French Dr., Hobbs, NM 88240  
Phone:(575) 393-6161 Fax:(575) 393-0720  
**District II**  
811 S. First St., Artesia, NM 88210  
Phone:(575) 748-1283 Fax:(575) 748-9720  
**District III**  
1000 Rio Brazos Rd., Aztec, NM 87410  
Phone:(505) 334-6178 Fax:(505) 334-6170  
**District IV**  
1220 S. St Francis Dr., Santa Fe, NM 87505  
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico  
Energy, Minerals and Natural Resources  
Oil Conservation Division  
1220 S. St Francis Dr.  
Santa Fe, NM 87505

CONDITIONS

Action 132168

CONDITIONS

Operator: MEWBOURNE OIL CO P.O. Box 5270 Hobbs, NM 88241	OGRID: 14744
	Action Number: 132168
	Action Type: [C-103] Sub. Plugging (C-103P)

CONDITIONS

Created By	Condition	Condition Date
gcordero	None	8/12/2022