

Office
 District I – (575) 393-6161
 1625 N. French Dr., Hobbs, NM 88240
 District II – (575) 748-1283
 811 S. First St., Artesia, NM 88210
 District III – (505) 334-6178
 1000 Rio Brazos Rd., Aztec, NM 87410
 District IV – (505) 476-3460
 1220 S. St. Francis Dr., Santa Fe, NM
 87505

State of New Mexico
 Energy, Minerals and Natural Resources

Form C-103
 Revised July 18, 2013

OIL CONSERVATION DIVISION
 1220 South St. Francis Dr.
 Santa Fe, NM 87505

WELL API NO. 30-015-33226
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. V-2678
7. Lease Name or Unit Agreement Name BIG WALT 2 STATE
8. Well Number #009
9. OGRID Number 192463
10. Pool name or Wildcat INDIAN BASIN UP. PENN (ASSOC)

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input checked="" type="checkbox"/> Other <input type="checkbox"/>	
2. Name of Operator OXY USA WTP, LP	
3. Address of Operator P.O. BOX 4294, HOUSTON, TX 77210	
4. Well Location Unit Letter O : 1240 feet from the SOUTH line and 2085 feet from the EAST line Section 2 Township 22S Range 24E NMPM County EDDY	
11. Elevation (Show whether DR, RKB, RT, GR, etc.) GL 3940'	

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	P AND A <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPL <input type="checkbox"/>	CASING/CEMENT JOB <input type="checkbox"/>	
DOWNHOLE COMMINGLE <input type="checkbox"/>			
CLOSED-LOOP SYSTEM <input type="checkbox"/>			
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

This well is plugged. Job Start:2/4/23. Job Complete:3/23/23. See the attached daily job details and plugged wellbore diagram for reference.

APPROVED

Reclamation Due
3/23/24

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Leslie T. Reeves TITLE REGULATORY MANAGER DATE 04/07/2023

Type or print name LESLIE REEVES E-mail address: LESLIE_REEVES@OXY.COM PHONE: 713-497-2492
For State Use Only

APPROVED BY: [Signature] TITLE Petroleum Specialist DATE 04/14/2023
 Conditions of Approval (if any):

BIG WALT 2 STATE #9

30-015-33226 – PA_SR – JOB SUMMARY

2/27/23 MIRU.

2/28/23 ATTEMPTED TO MANAGE PSI AND KILL WELL.

3/1/23 CONFIRMED WITH OCD PLAN FORWARD TO PUMP CEMENT DOWN TUBING TO MAINTAIN WELL CONTROL.

3/2/23 EST INJ RATE. PUMPED 75SX CL H CMT THROUGH TUBING. WOC.

3/3/23 MONITOR PSI, STILL INCREASED. EST INJ RATE. PUMPED AN ADDITIONAL 100SX CL H CMT THROUGH TUBING. WOC.

3/6/23 STILL SEEING PSI. EST INJ RATE. PUMPED ANOTHER 100SX CL C CMT THROUGH TUBING. WOC.

3/7/23 PUMPED 100SX CL H CMT. WOC. PUMPED 100SX CL H CMT. MONITOR PSI.

3/8/23 EST INJ RATE. PUMPED 50SX CL H CMT. WOC. MONITOR WELL PSI AT ZERO PSI NOW. ND WH, NU AND FUNCTION TEST BOP.

3/9/23 RIH WITH FREE POINT TOOL. TIGHT SPOTS 6500-6750'. CONFIRM WITH OCD PATH FORWARD. CUT TUBING @ 6750'.

3/10/23 FISHED SOME TUBING AND ESP CABLE PARTS.

3/11/23 CONT'D FISHING AND RETRIEVING.

3/13/23 PSI TEST TO 500 PSI, GOOD TEST. TUBING STUCK, CONTINUED FISHING.

3/14-16/23 FISHING. MIRU COIL TBG.

3/17/23 RIH WITH COIL TUBING TO 5820'. EST INJ RATE. PUMPED 50SX CL C CMT. WOC. RIH AND TAGGED TOC @ 5510'. EOT @ 3740'. EST INJ RATE. PUMPED 50SX CL C CMT. WOC. RIH AND TAGGED TOC @ 3442'. POOH WITH COIL.

3/18/23 PSI TEST WELL TO 500 PSI F/ 30 MINUTES, GOOD TEST. EOT @ 2000'. PUMPED 65SX CL C CMT. WOC. RIH AND TAGGED TOC @ 1600'. PERF'D @ 1560'. EST RATE. SQZD 75SX CL C CMT. WOC.

3/19/23 RIH AND TAGGED TOC @ 1065'. CUT TUBING @ 1020'. RIH AND PERF'D @ 500'. NO RATE.

3/20/23 RIH AND TAGGED @ 67. FISHED CABLE AND CT LINE. – RIG ISSUES NEXT DAY, NO WORK.

3/22/23 CONT'D FISHING AND CLEANING OUT WELL.

3/23/23 CLEANED OUT TO 500'. RIH AND PERF'D @ 500'. EST RATE. SQZD 225SX CL C CMT TO SURFACE. VERIFIED. RDMO.

PLUGGED WELLBORE DIAGRAM

OXY USA WTP LP
Big Walt 2 State #9
API No. 30-015-33226

PERF'D @ 500'. SQZD 225SX CL C CMT
TO SURFACE. VERIFIED.

PERF'D @ 1560'. SQZD 75SX CL C CMT.
WOC. TAGGED TOC # 1065'. CUT
TUBING @ 1020'.


EOT @ 2000'. PUMPED 65SX CL C CMT.

EOT @ 3740'. PUMPED 50SX CL C
CMT. WOC. TAGGED TOC @ 3442'.

EOT @ 5820'. PUMPED 50SX CL C
CMT. WOC. TAGGED TOC @ 5510'.

CUT TUBING @ 6750' COVERED
WITH 525SX CL H CMT. PSI TESTED,
GOOD TEST.

UNABLE TO SET CIBP. FISH LEFT IN

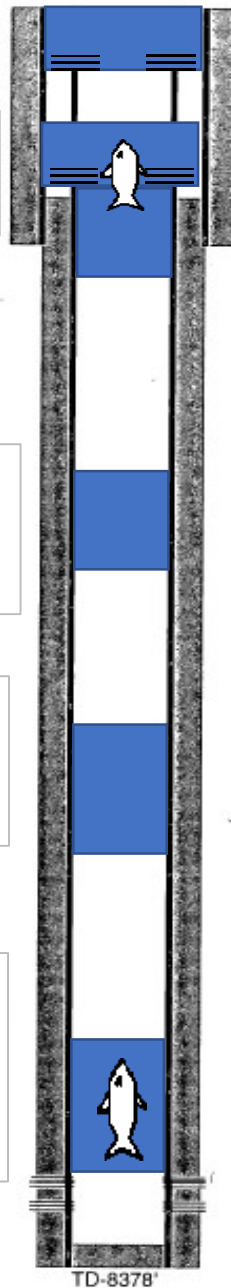

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720

District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720

District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170

District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 205073

CONDITIONS

Operator: OXY USA WTP LIMITED PARTNERSHIP P.O. Box 4294 Houston, TX 772104294	OGRID: 192463
	Action Number: 205073
	Action Type: [C-103] Sub. Plugging (C-103P)

CONDITIONS

Created By	Condition	Condition Date
john.harrison	None	4/14/2023