

Submit 1 Copy To Appropriate District
Office
District I – (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II – (575) 748-1283
811 S. First St., Artesia, NM 88210
District III – (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV – (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised July 18, 2013

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-005-20337
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/> Injection Well		5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
2. Name of Operator State of New Mexico formerly Canyon E&P Company		6. State Oil & Gas Lease No.
3. Address of Operator 1625 N. French Drive, Hobbs, N 88240		7. Lease Name or Unit Agreement Name Double L Queen Unit
4. Well Location Unit Letter <u>G</u> : <u>1660</u> feet from the <u>N</u> line and <u>2310</u> feet from the <u>E</u> line Section <u>6</u> Township <u>15S</u> Range <u>30E</u> NMPM Chaves County		8. Well Number. 002P
11. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. OGRID Number 269864
		10. Pool name or Wildcat Double L Queen

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	P AND A <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPL <input type="checkbox"/>	CASING/CEMENT JOB <input type="checkbox"/>	
DOWNHOLE COMMINGLE <input type="checkbox"/>			
CLOSED-LOOP SYSTEM <input type="checkbox"/>			
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

This well was plugged and abandoned by A-Plus P&A LLC on 10/18/23 per the following as plugged report.

9/8/23: MOL. Held JSA. Prepare road to location, make 1 mile of road. Prep location and spot equipment. Rig up plugging equipment and rig. Unhang pump jack, change tools to rod equipment. Check well pressures, no pressure on well. PU on rods, stuck, WOO. Change to 2-3/8" tbg equipment. Try to remove well head, did not come loose. Secure well and SDFD.

9/11/23: Held JSA. ND wellhead, cut off w/ torch. Dig out well cellar and replace plumbing for casing valves. NU and test BOP. PU on tbg, stuck, WOO. TOH and LD 60 jnts 2-3/8" tbg. RU WL and RIH w/ 3.45" GR to 1900', POOH. RIH w/ 4-1/2" CIBP, RIH and set @ 1878', POOH and RD WL. Load hole w/ 26 bbls. RU JSI WL, RIH and run CBL from 1878 to surface, RD JSI WL. TIH w/ 58 jnts tbg. Secure well and SDFD.

9/12/23: Held JSA. RU pump and circ casing clean.

Plug #1. Spot 25 sxs Class C cmt from 1878' 1.32 yield. TOO, LD 15 jnts, and stand back the rest. WOC for 3 hrs. TIH and tag Plug #1 @ 1650'. PUH to 1241'.

Plug #2. Spot 25 sxs Class C cmt from 1241' to appx 963' 1.32 yield, 25 sxs inside. TOO, stand back all tbg. Secure well and SDFD.

9/13/23: Held JSA. Spot A Plus WL, RU, standby for lightning. RIH and perf @ 950', RD WL. TIH w/ 4-1/2" packer, RU pump and establish circ.

Plug #3. Spot 24 sxs Class C cmt from 950' to 850' 1.32 yield, 17 sxs outside and 7 sxs inside. TOO, w/ 2-3/8" work string, LD 10 jnts, stand back the rest and LD packer. WOC. Secure well and SDFD.

9/14/23: Held JSA. TIH and tag Plug #3 @ 650'. TOO, RU A Plus WL, RIH and perf @ 421', RD WL. TIH w/ 4-1/2" packer, RU pump and est circ to BH.

Plug #4. Spot 24 sxs Class C cmt from 421' to 321' 1.32 yield, 17 sxs outside and 7 sxs inside. TOO, and WOC for 3 hrs. TIH and tag Plug #4 @ 260'. RU A Plus WL, RIH and perf @ 50', RD WL. RU pump and establish circ.

Plug #5. Spot 17 sxs Class C cmt from 50' to surface 1.32 yield, 13 sxs outside and 4 sxs inside. ND BOP. Secure well and SDFD.

10/19/23: Travel to location. Dig out WH. Cut off and remove WH. Found TOC @ surface. Weld on P&A marker.
GPS 33°02'05.55" N / 103°58'27.1" W

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE *Neil Lundermeyer* TITLE *P&A Engineer Tech* DATE *10/24/23*

Type or print name *Neil Lundermeyer* E-mail address: *neilcaplus@nll.com* PHONE: *505-786-6958*

For State Use Only
APPROVED BY: John Garcia TITLE Supervisor DATE 10/24/23

Conditions of Approval (if any):


Double L Queen Unit 002P**As Plugged on 10/19/23**

Double L Queen Field

Unit G, 1660' FNL & 2310' FEL, Section 6, T15S, R30E

Chaves County, NM, API #30-005-20337

33°02'05.55" N / 103°58'27.1" W

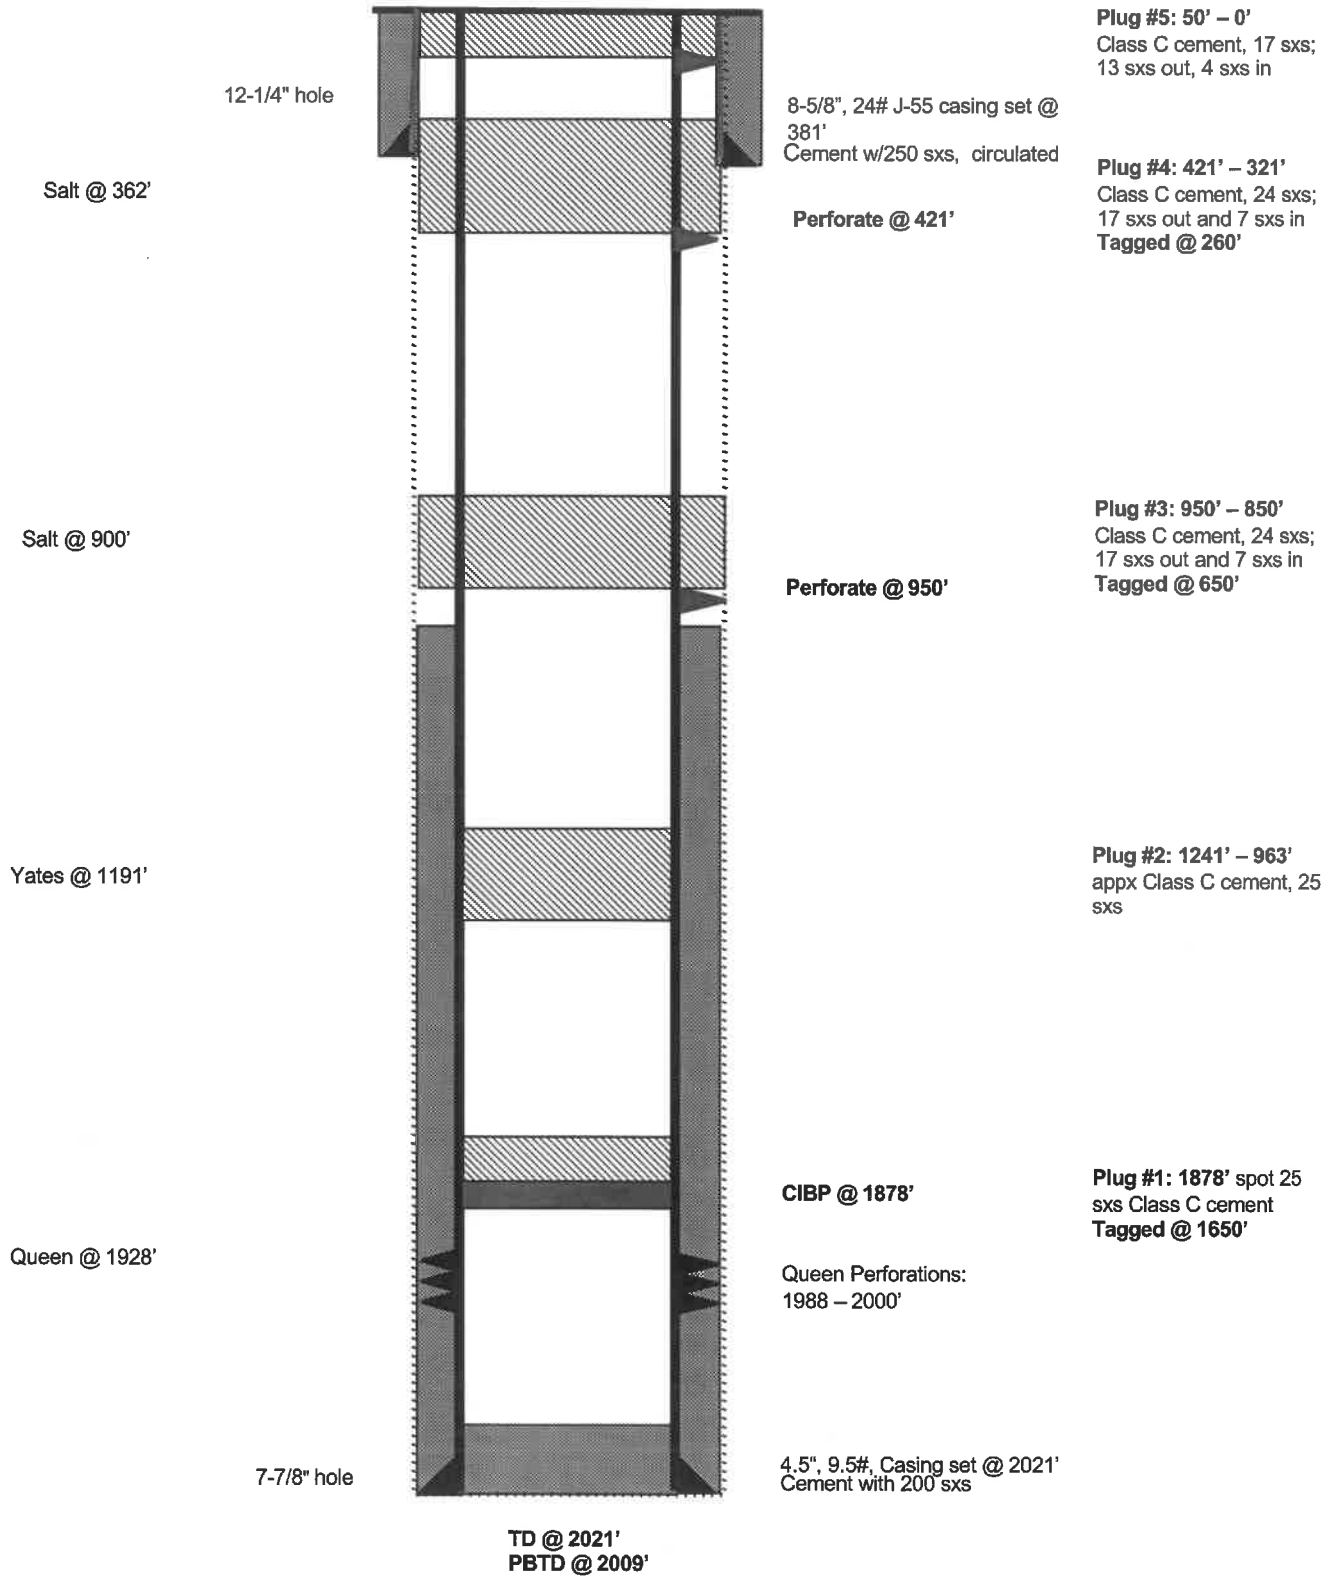



District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720
District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720
District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 278842

CONDITIONS

Operator: A-PLUS WELL SERVICE, INC. P.O. Box 1979 Farmington, NM 87499	OGRID: 370317
	Action Number: 278842
	Action Type: [C-103] Sub. Plugging (C-103P)

CONDITIONS

Created By	Condition	Condition Date
jagarcia	None	10/25/2023