Submit 1 Copy To Appropriate District	State of New Mexico	Form C-103
Office District I – (575) 393-6161	Energy, Minerals and Natural Resources	Revised July 18, 2013
1625 N. French Dr., Hobbs, NM 88240	Energy, withertais and reactiful Resources	WELL API NO.
District II – (575) 748-1283	OH COMPENSATION DAMAGES	30-005-20400
811 S. First St., Artesia, NM 88210	OIL CONSERVATION DIVISION	5. Indicate Type of Lease
<u>District III</u> – (505) 334-6178	1220 South St. Francis Dr.	STATE FEE
1000 Rio Brazos Rd., Aztec, NM 87410 <u>District IV</u> – (505) 476-3460	Santa Fe, NM 87505	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM	Saita 1 0, 1 (1) 1 0 / 5 0 5	
87505		305865
SUNDRY NOTI	CES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
	SALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A	
DIFFERENT RESERVOIR. USE "APPLIC	ATION FOR PERMIT" (FORM C-101) FOR SUCH	NMCV State
PROPOSALS.)	0 W II	8. Well Number 1
	Gas Well Other	1
2. Name of Operator	110	9. OGRID Number
Wespac Ewerg	y hh	260245
3. Address of Operator	1'	10. Pool name or Wildcat
\$620 N. New BI	autels Ave. Ste. 603 Son Anterio (c. Many Cates : Abo
4. Well Location	7821	
Unit Letter M :	19 80 feet from the N line and	660 feet from the W line
	, , , , , , , , , , , , , , , , , , ,	
Section 32	Township 95 Range 30E	NMPM County Chaves
	11. Elevation (Show whether DR, RKB, RT, GR,	etc.)
	6	
12. Check A	ppropriate Box to Indicate Nature of Notice	ee. Report or Other Data
NOTICE OF IN	TENTION TO: SI	JBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK	PLUG AND ABANDON REMEDIAL W	
TEMPORARILY ABANDON	SECURITION AND ADMINISTRATION OF THE SECURITION AND ADMINISTRATION ADMINISTRATION ADMINISTRATION ADMINISTRATION ADMINISTRATION AND ADMINISTRATION AND ADMINISTRA	DRILLING OPNS. □ P AND A □
PULL OR ALTER CASING	MULTIPLE COMPL CASING/CEM	
DOWNHOLE COMMINGLE		
CLOSED-LOOP SYSTEM I I		
CLOSED-LOOP SYSTEM OTHER:	□ OTHER:	П
OTHER:	eted operations (Clearly state all pertinent details	and give pertinent dates, including estimated data
OTHER: 13. Describe proposed or compl	eted operations. (Clearly state all pertinent details,	
OTHER: 13. Describe proposed or comple of starting any proposed wo	eted operations. (Clearly state all pertinent details, rk). SEE RULE 19.15.7.14 NMAC. For Multiple	
OTHER: 13. Describe proposed or comploof starting any proposed wo proposed completion or reco	eted operations. (Clearly state all pertinent details, rk). SEE RULE 19.15.7.14 NMAC. For Multiple ompletion.	Completions: Attach wellbore diagram of
OTHER: 13. Describe proposed or comploof starting any proposed wo proposed completion or reco	eted operations. (Clearly state all pertinent details, rk). SEE RULE 19.15.7.14 NMAC. For Multiple ompletion.	Completions: Attach wellbore diagram of
OTHER: 13. Describe proposed or complete of starting any proposed wo proposed completion or recomplete of the starting and proposed complete or recomplete	eted operations. (Clearly state all pertinent details, rk). SEE RULE 19.15.7.14 NMAC. For Multiple ompletion.	Completions: Attach wellbore diagram of
OTHER: 13. Describe proposed or comploof starting any proposed wo proposed completion or reco	eted operations. (Clearly state all pertinent details, rk). SEE RULE 19.15.7.14 NMAC. For Multiple ompletion.	Completions: Attach wellbore diagram of
OTHER: 13. Describe proposed or comploof starting any proposed wo proposed completion or reco	eted operations. (Clearly state all pertinent details, rk). SEE RULE 19.15.7.14 NMAC. For Multiple ompletion.	Completions: Attach wellbore diagram of
OTHER: 13. Describe proposed or comploof starting any proposed wo proposed completion or reco	eted operations. (Clearly state all pertinent details, rk). SEE RULE 19.15.7.14 NMAC. For Multiple ompletion.	Completions: Attach wellbore diagram of
OTHER: 13. Describe proposed or comploof starting any proposed wo proposed completion or reco	eted operations. (Clearly state all pertinent details, rk). SEE RULE 19.15.7.14 NMAC. For Multiple ompletion.	Completions: Attach wellbore diagram of
OTHER: 13. Describe proposed or comploof starting any proposed wo proposed completion or reco	eted operations. (Clearly state all pertinent details, rk). SEE RULE 19.15.7.14 NMAC. For Multiple ompletion.	Completions: Attach wellbore diagram of
OTHER: 13. Describe proposed or comploof starting any proposed wo proposed completion or reco	eted operations. (Clearly state all pertinent details, rk). SEE RULE 19.15.7.14 NMAC. For Multiple ompletion.	Completions: Attach wellbore diagram of
OTHER: 13. Describe proposed or comploof starting any proposed wo proposed completion or reco	eted operations. (Clearly state all pertinent details, rk). SEE RULE 19.15.7.14 NMAC. For Multiple ompletion.	Completions: Attach wellbore diagram of
OTHER: 13. Describe proposed or comploof starting any proposed wo proposed completion or reco	eted operations. (Clearly state all pertinent details, rk). SEE RULE 19.15.7.14 NMAC. For Multiple ompletion.	Completions: Attach wellbore diagram of

Spud Date: Rig Release Date: I hereby certify that the information above is true and complete to the best of my knowledge and belief. E-mail address: Ktorda Type or print name For State Use Only TITLE Compliance Officer A Conditions of Approval (if any

DATE 10/31/23

Plugging Report NM CR State #1 API 30-005-20400

8/8/2022 Moved in rigged up and laid down rods.


8/11/2022 Installed BOP, released the anchor, and POOH with tubing. Set CIBP at 7200'. Perforations were listed wrong on the approved plugging procedures. Verified perforations on the original C103 from 7266' to 7290'. Stated in the hole with tubing.

8/15/2022 Finished running tubing and tagged CIBP at 7200'. Circulated MLF and tested casing to 650#. Casing good. Spot 25 sx Class H cement on top of the CIBP. POOH to 6370' and spot 25 sx Class C cement. POOH to 5519' and spot 25 sx cement. POOH to 4014' and spot 25 sx cement. POOH and SION.

8/16/2022 Perforated casing at 2640'. Set packer and pressure up to 700# and held. POOH with packer and spot 25 sx cement across perforations from 2699'. WOC and tagged cement at 2410'. Perforated casing at 1526'. Set packer and pressured up on perforations to 750# and held. Pulled packer and spot 25 sx cement across perforations from 1600'. POOH and SION.

8/17/2022 Tagged cement at 1339'. Perforated casing at 250'. Gained circulation and pumped cement down 5" casing to perforations at 250' and up the annulus to surface. Took 85 sx to get good cement to the pit. Rigged down, dug out and removed the wellhead. Filled up both strings with 10 sx cement. Cement remained at the surface. Installed BGM.

Wespac Energy, LLC CR State #1 API 30-005-20400 WBD After PA

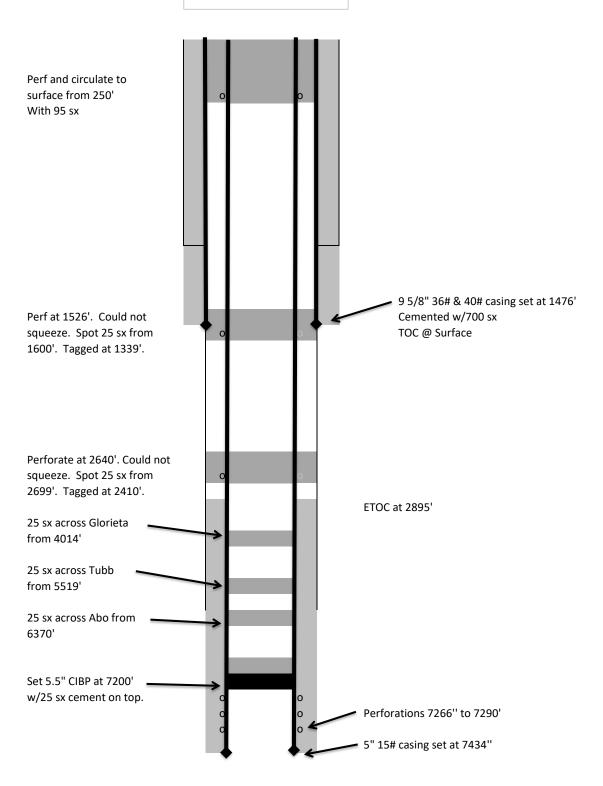

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

COMMENTS

Action 265872

COMMENTS

Operator:	OGRID:
WESPAC ENERGY, LLC	260245
8620 North New Braunfels Ave.	Action Number:
San Antonio, TX 78217	265872
	Action Type:
	[C-103] Sub. Plugging (C-103P)

COMMENTS

Created By	Comment	Comment Date
plmartinez	DATA ENTRY PM.	10/31/2023

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 265872

CONDITIONS

Operator:	OGRID:
WESPAC ENERGY, LLC	260245
8620 North New Braunfels Ave.	Action Number:
San Antonio, TX 78217	265872
	Action Type:
	[C-103] Sub. Plugging (C-103P)

CONDITIONS

Created By	Condition	Condition Date
kfortner	Need C103Q and marker photo to release	10/31/2023