

Santa Fe Main Office
Phone: (505) 476-3441
General Information
Phone: (505) 629-6116

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised July 18, 2013

Online Phone Directory Visit:
<https://www.emnrd.nm.gov/ocd/contact-us>

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-015-26366
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Resler Yates State
8. Well Number #382
9. OGRID Number 154329
10. Pool name or Wildcat (3230) Artesia; Queen-Grayburg-San Andres

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐	
2. Name of Operator Sandlott Energy (Jackie Brewer DBA)	
3. Address of Operator P.O. Box 711 Lovington, NM 88260	
4. Well Location Unit Letter <u>F</u> : <u>1650</u> feet from the <u>North</u> line and <u>1650</u> feet from the <u>West</u> line Section <u>32</u> Township <u>18S</u> Range <u>28E</u> NMPM Eddy County	
11. Elevation (Show whether DR, RKB, RT, GR, etc.)	

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	P AND A ☐
PULL OR ALTER CASING ☐	MULTIPLE COMPL ☐	CASING/CEMENT JOB ☐	
DOWNHOLE COMMINGLE ☐			
CLOSED-LOOP SYSTEM ☐			
OTHER: ☐		OTHER: ☐	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Please see attached procedure & wellbore schematics

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Brewer TITLE _____ DATE 11/2/2025

Type or print name _____ E-mail address: _____ PHONE: _____

For State Use Only

APPROVED BY: _____ TITLE _____ DATE _____

Conditions of Approval (if any):

Mewbourne Oil Company

Plug and Abandon

Submitted By:
Steven Cooley

Wellname: **RESLER YATES STATE #382**

Location: 1650' FNL & 1650' FEL, F-32-18S-28E- Eddy Co,
NM

Date: August 6th, 2025

API #: 30-015-26366

Surf Csg Set: 8 5/8" 24# J-55

Csg Size: 4 1/2" 9.5# J-55

Set @: 420

Set @: 1980'

Perfs: 1991-2004' (27 shots)

Well is to be plugged & abandoned.

Procedure:

1. MIRU plugging crew.
2. ND WH, NU BOP.
3. POOH w/ tbg (set at 1980').
4. MIRU WL, RIH WL & set CIBP @ 1980' (top perf @ 1991').
5. Test Casing to 500 psi.
6. MIRU WL.
7. Run cement bond log and verify top of cement.
8. RIH w/tbg & Circulate WB capacity MLF (35 bbl).
9. Tag CIBP & Spot 35 sks Class C neat cmt. ($\pm$ 490').
10. WOC 6 hrs & tag plug @ 1540' or higher (Top Grayburg @ 1989', top of Queen @ 1590').
11. POOH w/ tbg to 470' & spot 35 sks Class C neat cmt. ($\pm$ 470').
12. WOC 6 hrs & confirm that WB remains full.
13. Cut off WH & install dry hole marker. Cut off anchors & clean location.

RESLER YATES STATE #382 P&A Schematic

1650' FNL & 1650' FEL, F-32-18S-28E, Eddy Co, NM

API 30-015-26366

Qmt to surface

12 1/4" hole w/8 5/8"
24# J-55
set @ 420'


Queen @ 1590'

1st Grayburg @ 1989'

Grayburg perms 1991-2004'

PSTD @ 2065'


7 7/8" hole w/4 1/2" 9.5#
J-55
set @ 2100'

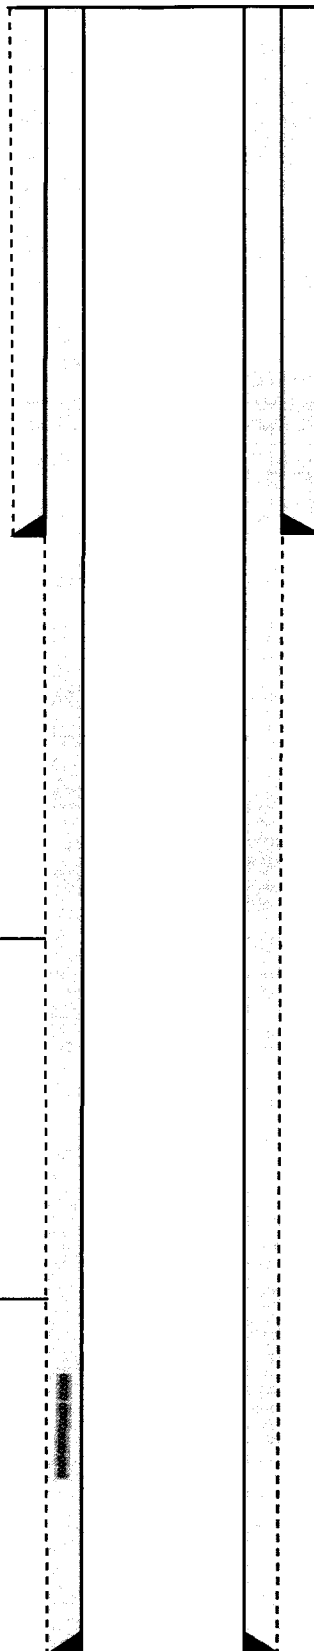

RESLER YATES STATE #382 P&A Schematic

1650' FNL & 1650' FEL, F-32-18S-28E, Eddy Co, NM

API 30-015-26366

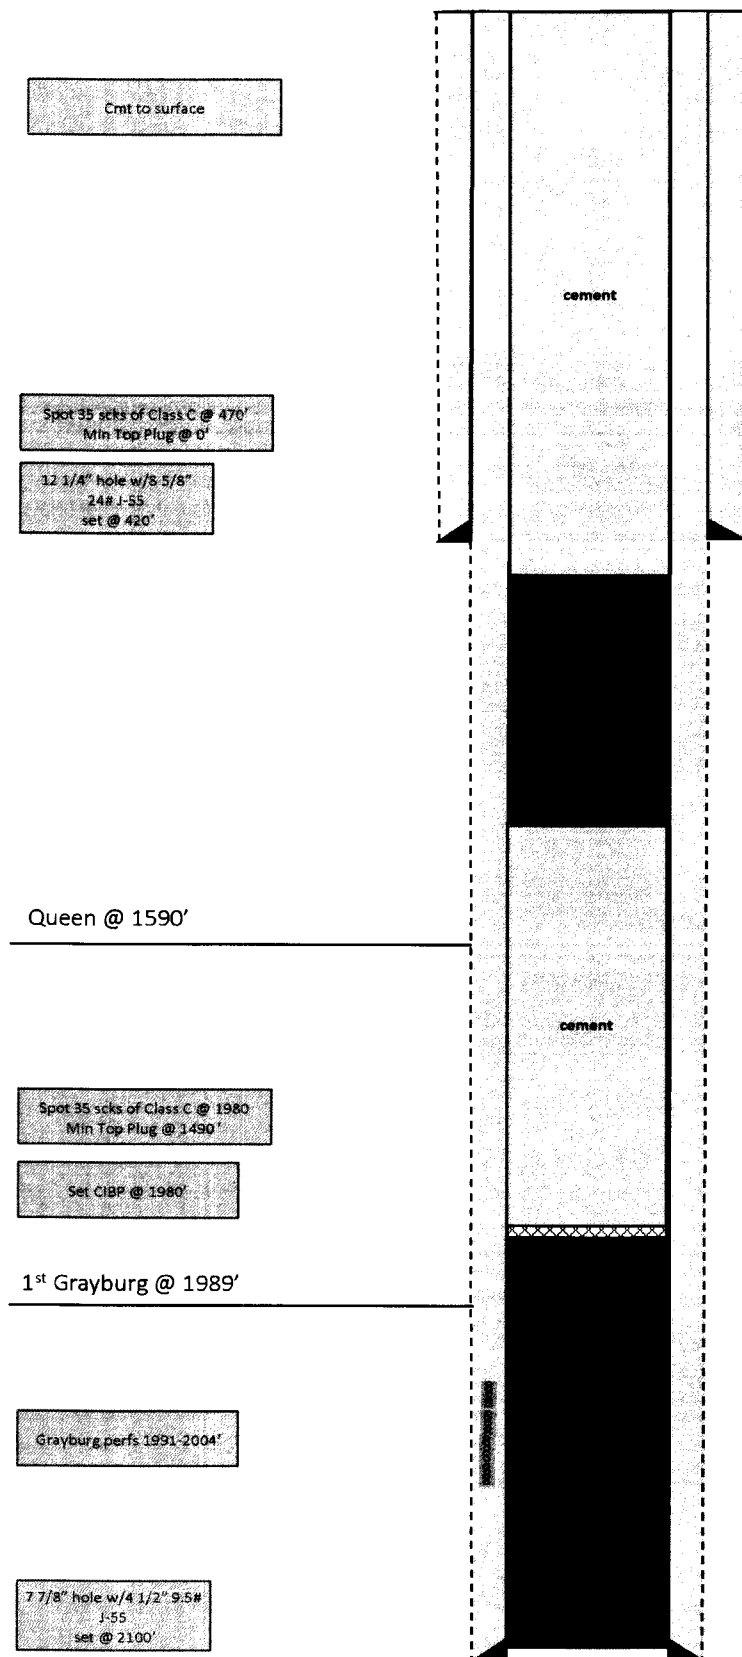

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 524503

CONDITIONS

Operator: MEWBOURNE OIL CO P.O. Box 5270 Hobbs, NM 88241	OGRID: 14744
	Action Number: 524503
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
loren.diede	Notify the OCD inspection supervisor via email 24 hours prior to beginning Plug & Abandon (P&A) operations.	11/14/2025
loren.diede	NMOCD does not consider this well to be within the LPCH restricted area and an above ground P&A marker is required. NMOCD requires that plug(s) be added to cover the 7 Rivers = (960') and Yates = (600') formation tops. Submit photo and GPS coordinates of the P&A marker with the final P&A reports. The API# on the marker is to be clearly legible. Run CBL from CIBP to surface. Submit the CBL tif file to NMOCD for uploading into the Well Log File.	11/14/2025