

District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM
87505

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-041-10142
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. E-1369
7. Lease Name or Unit Agreement Name Haley Chaveroo San Andres Unit
8. Well Number #009
9. OGRID Number 164557
10. Pool name or Wildcat Chavaroo San Andres

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well Gas Well Other

2. Name of Operator
Ridgeway Arizona Oil Corporation

3. Address of Operator
PO Box 1110, St. Johns, AZ 85936

4. Well Location
Unit Letter **G** : **1980** feet from the **N** line and **1980** feet from the **E** line
Section **34** Township **07S** Range **33E** NMPM County **Roosevelt**

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
4399 DF

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	P AND A <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPL <input type="checkbox"/>	CASING/CEMENT JOB <input type="checkbox"/>	
DOWNHOLE COMMINGLE <input type="checkbox"/>			
CLOSED-LOOP SYSTEM <input type="checkbox"/>			
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

JMR Services, LLC respectfully proposes the attached NOI to P&A this well on behalf of Ridgeway Arizona Oil Corporation for the State of New Mexico.

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE *[Signature]* TITLE *Regulatory* DATE *3/27/26*
Type or print name _____ E-mail address: _____ PHONE: _____
For State Use Only

APPROVED BY: _____ TITLE _____ DATE _____
Conditions of Approval (if any): _____

Proposed P&A Procedure
Ridgeway Arizona Oil Coporation/NMOCD
Haley Chaveroo SA Unit #009
30-041-10142

Note: All Cement is Class C mixed at 14.8 ppg, yield 1.32 cu ft / sx. If WOC is required then we will use 2% Calcium Chloride in order to reduce the wait time to 4 hrs, Cement volumes are based on inside capacities + 50' excess and outside 100% excess in open hole.

Prior to MOL 24 hrs Notification is Required to Regulatory Agency (NMOCD in this case)

1. Hold pre-job meeting. Comply with all NMOCD, BLM along with Corporate and environmental regulations.
2. MIRU P&A rig and equipment.
3. Check and record tubing, casing and bradenhead pressures.
4. Remove existing piping from casing valve. Lay out relief lines to tanks and blow well down. Kill well if necessary. Ensure well is dead or on vacuum.
5. If well has rods and pump (last sundry from 1990 says rods and pump) TOH and LD.
- 5a. TOH and LD tubing.
6. ND WH. NU BOP and function test BOP.
7. Round trip gauge ring to 4200' or as deep as possible. If unable to get to 4200' then discuss with Regulatory for procedure change. RIH and set 4.5" CIBP @ 4200'. POH.
8. Pressure test casing to 500#. If casing does not test, then discuss with Regulatory for procedure change. If casing tests and MIRU wireline truck. Run CBL from CIBP to surface. Send an electronic copy of CBL to NMOCD representative. Results of CBL may change procedure. Record TOC per CBL on DWR.
9. PU tubing workstring and RIH. Drop ball valve down tubing and pressure test to 1000#.
10. Plug #1: (CIBP) Spot 11 sxs class "C" cmt, yield of 1.32 cf. BOC @ 4200' to TOC 4050'. If casing did not test and WOC and tag. If casing tested then continue on to Plug #2. PUH.
11. Plug #2:(San Andres) Mix and spot 11 sxs Class C cement, yield 1.32, inside csg from BOC 3510' to TOC @ 3360'. TOH.
12. Plug #3 (Queen/Grayburg) Perf @ 3114'. Mix 92 sxs Class C cement, yield 1.32cf. Squeeze 76 sxs outside casing and leave 16 sxs inside casing from BOC 3114' to TOC 2890'. WOC and tag. If cement tags low then contact Regulatory for procedure change.
13. Plug #4 (7Rvrs/Yates/Bsalt) Perf @ 2528'. Mix 141 sxs Class C cement, yield 1.32cf. Squeeze 118 sxs outside casing and leave 23 sxs inside casing from BOC 2525' to TOC 2190'. WOC and tag. If cement tags low then contact Regulatory for procedure change.
14. Plug #5:(Tsalt/Rustler) Perf @ 2050'. Mix 88 sxs Class C cement, yield 1.32cf. Squeeze 73 sxs outside casing and leave 15 sxs inside casing from BOC 2050' to TOC 1840'. WOC and tag. If cement tags low then contact Regulatory for procedure change.
15. Plug #6: (casing shoe, Surface)Perf @ 420'. Mix and pump 130 sxs Class C cement, yield 1.32cf, squeeze 18 sxs into 4.5'x 7-7/8" OH, 83 sxs 4.5" x 8.625" annulus and leave 29 sxs inside casing from 366' to surface. Conduct bubble test.
16. Contact Regulatory Representative to witness setting P&A marker.ND cementing valves and cut off wellhead. Test and record if gas is present. Top off annuli with cement if necessary. Record GPS coordinate for P&A marker on DWR. Photograph P&A marker in Place. RD and MOL.


Description	O.D.	Grade	Weight	Depth	Hole	Cmt Sx	TOC
Surface Csg	8.625		24	370	11	250	Circ
Prod Csg	4.5		10.5	4,474	7 7/8	350	TS3371
Tubing w/ packer	2 3/8			4,156			
rods w/pump				4337??			

Author: Neil @ JMIR
 Well Name: Haley Chaveroo SA Unit #009
 Field/Pool: Chaveroo San Andres
 County: Roosevelt
 State: New Mexico
 Spud Date: 10/9/65

API: 30-041-10142
 Location: Unit G 1980 FNL; 1980 FEL
Sec. 34, T7S, R33E
4399

DF

Formation Tops	
Rustler	1940
T Salt	2000
B Salt	2286
Yates	2295
7 Rvrs	2478
Queen	2990
Grayburg	3064
San Andres	3460

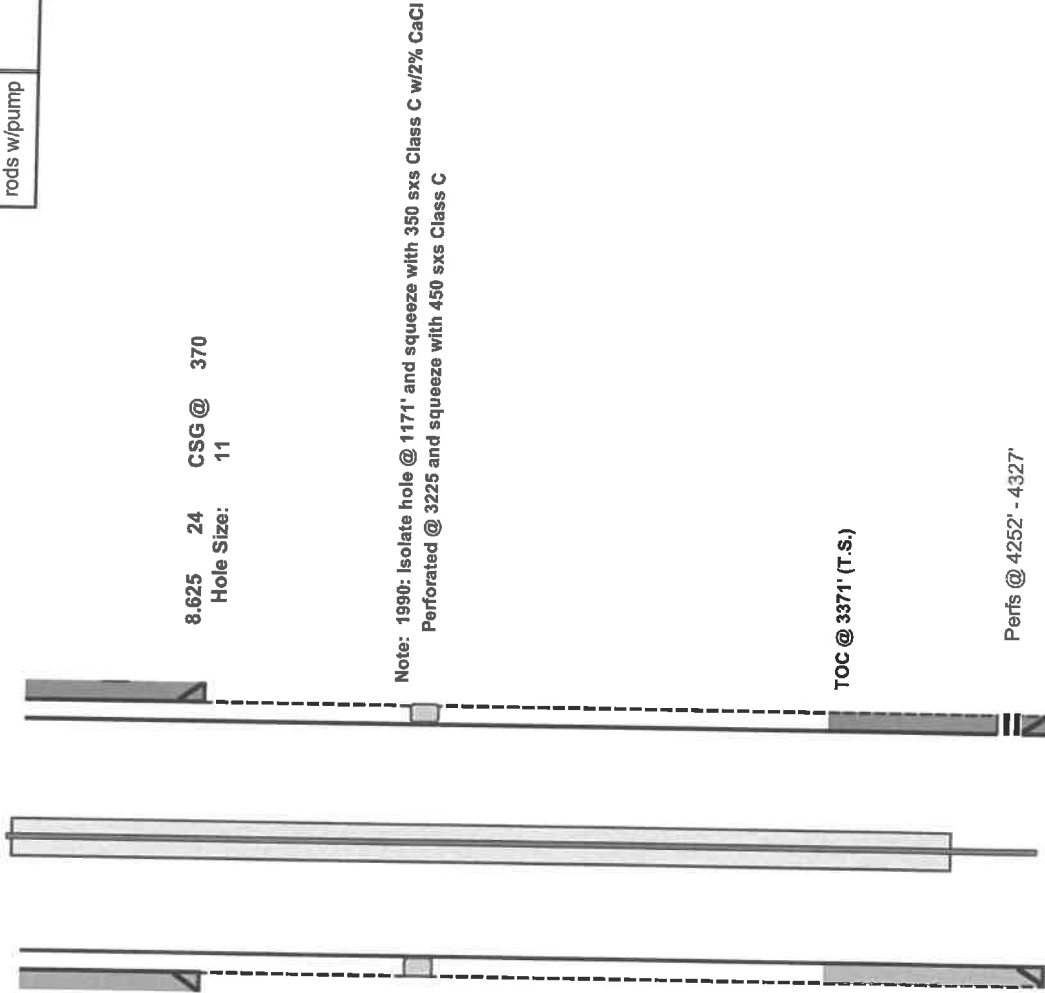

8.625 24 CSG @ 370
 Hole Size: 11

Note: 1990: Isolate hole @ 1171' and squeeze with 350 sxs Class C w/2% CaCl
 Perforated @ 3225 and squeeze with 450 sxs Class C

TOC @ 3371' (T.S.)

Perfs @ 4252' - 4327'

4.5 10.5 CSG @ 4,472
 Hole Size: 7 7/8

Author:	Neil @ JMR
Well Name:	Haley Chaveroo SA Unit #009
Field/Pool:	Chaveroo San Andres
County:	Roosevelt
State:	New Mexico
Spud Date:	10/9/65
API:	30-041-10142
Location:	Unit G 1980 FNL; 1980 FEL
DF:	Sec. 34, T7S, R33E 4399

Description	O.D.	Grade	Weight	Depth	Hole	Cmt Sx	TOC
Surface Csg	8.625		24	370	11	250	Circ
Prod Csg	4.5		10.5	4,474	7 7/8	350	TS3371
Tubing w/ packer	2 3/8			4,156			
rods w/pump				4337??			

Formation Tops	
Rustler	1940
T Salt	2000
B Salt	2286
Yates	2295
7 Rvrs	2478
Queen	2990
Grayburg	3064
San Andr	3460

Plug #6: (Csg shoe and surface). Mix 130 sxs, spot 29 sxs from 420' to surface, 18 sxs 4.5" x 7-7/8" open hole and 83 sxs inside 4.5" x 8.625" annulus (yield 1.32cf) Perforate @ 420'

Note: 1990: isolate hole @ 1171' and squeeze with 350 sxs Class C w/2% CaCl


Plug #5: (Tsalt/Rustler). Mix 88 Class "C" cmt yield 1.32 cf, spot 15 sxs from BOC 2050' to TOC 1840'. (50' excess). Squeeze 73 sxs (100% excess) from 2050' in annulus. WOC and Tag. Perforate @ 2050'

Plug #4: (7Rvrs/Yates/Beal). Mix 141 Class "C" cmt yield 1.32 cf, spot 23 sxs from BOC 2528 to TOC 2188'. (50' excess). Squeeze 118 sxs (100% excess) from 2528' in annulus. WOC and Tag. Perforate @ 2528'

Plug #3: (Grayburg/Queen) Mix 92 sxs Class "C" cmt yield 1.32cf, spot 16 sxs inside csg BOC @ 3114' to TOC @ 2890' (50' excess). Squeeze 76 sxs (100% excess) from 3114' in annulus. WOC and Tag. Perforate @ 3114'

TOC @ 3371' (T.S.)
Plug #2: (San Andres) Spot 11 sxs Class "C" cmt yield 1.32cf, inside csg BOC @ 3510' to TOC @ 3360' (50' excess).

Plug #1: (CIBP) Spot 11 sxs class "C" cmt, yield 1.32 cf BOC @ 4200' to TOC 4050'.
Set CIBP @ 4200'
Perfs @ 4252' - 4327'

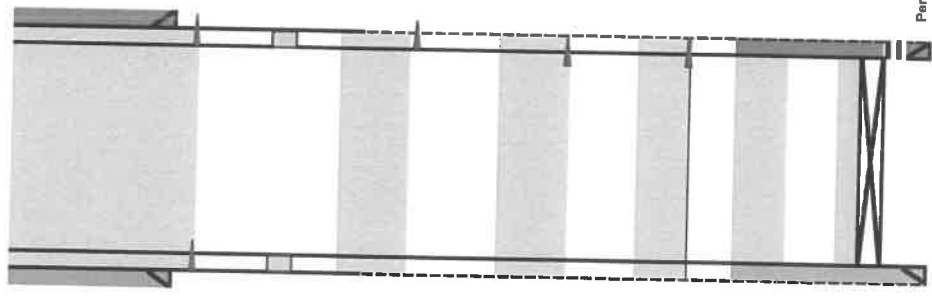

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

DEFINITIONS

Action 571521

DEFINITIONS

Operator: JMR SERVICES, LLC (OPG Vendor) 4706 Green Tree Blvd. Midland, TX 79707	OGRID: 333576
	Action Number: 571521
	Action Type: [UF-OMA] NOI Plug & Abandon Well (UF-OMA-C-103F)

DEFINITIONS

The OCD Mitigation Activity (OMA) forms are a subset of the OCD's forms exclusively designed for activities related to State of New Mexico's contracted evaluation, plugging, decommissioning, remediation, salvage and reclamation activities. Specifically, these forms are typically used where the OCD has acquired a hearing order allowing the OCD to perform mitigation activities on wells and associated facilities that no longer have an authorized or viable operator to perform the necessary work. These forms are not to be utilized for any other purpose.

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS

Action 571521

QUESTIONS

Operator: JMR SERVICES, LLC (OPG Vendor) 4706 Green Tree Blvd. Midland, TX 79707	OGRID: 333576
	Action Number: 571521
	Action Type: [UF-OMA] NOI Plug & Abandon Well (UF-OMA-C-103F)

QUESTIONS

Prerequisites	
[OGRID] Well Operator	[164557] RIDGEWAY ARIZONA OIL CORP.
[API] Well Name and Number	[30-041-10142] HALEY CHAVEROO SA UNIT #009
Well Status	Active

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 571521

CONDITIONS

Operator: JMR SERVICES, LLC (OPG Vendor) 4706 Green Tree Blvd. Midland, TX 79707	OGRID: 333576
	Action Number: 571521
	Action Type: [UF-OMA] NOI Plug & Abandon Well (UF-OMA-C-103F)

CONDITIONS

Created By	Condition	Condition Date
loren.diede	Notify NMOCD 24 hours prior to beginning P&A operations.	4/6/2026
loren.diede	NMOCD has determined that this well is within the LPCH restricted area and that a BELOW GROUND P&A marker is required.	4/6/2026