

Submit 3 Copies To Appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised March 25, 1999

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-037-20054
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name: JOHN DAVID
8. Well No. 2
9. Pool name or <u>Wildcat</u>

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
Oil Well ☐ Gas Well ☒ Other

2. Name of Operator
CKG ENERGY

3. Address of Operator
PO BOX 1065, TUCUMCARI, NM

4. Well Location
Unit Letter : **1780'** feet from the **EAST** line and **1650'** feet from the **SOUTH** line
Section **19** Township **10N** Range **27E** NMPM **QUAY** County
10. Elevation (Show whether DR, RKB, RT, GR, etc.)
4399' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☒
OTHER: **RUN CBL, PERFORATE, ACID** ☒

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

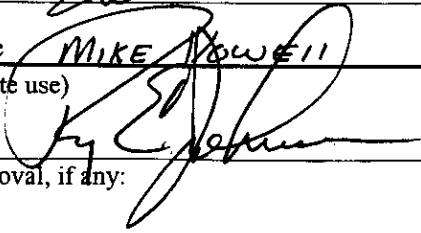
02-20-03 - DRILLED 7 7/8" HOLE TO 6992' - LOGGED WELL - RAN 166 JS 5 1/2" x 17" CSG
SET 3 CMNT @ 6992' IN TWO STAGES (DU COLLAR @ 6014') 1ST STAGE CMNT 200 SX
54/50 POZ "H", 5# GIL, 2% CACL, 5% C-15 - 2ND STAGE, 525 SX 50/50 POZ W/SAME
ADDITIVES - PLUG DN @ 11:30 PM 02-19-03 -

03-30-03 - DRILL OUT DU TOOL & TEST TO 2000' - OK - RAN BOND LOG - TO CMNT @ 4450'
04-01-03 PERFORATE W/4" HSC GUNS FROM 5117'-25' & 5131' TO 44' - 32 SHOTS
SWAB DRY IN 5 RUNS W/SLIGHT SHOW GAS - ACIDIZE W/1500 GALS 7 1/2% HCL
W/5% MA-844W & 9,000 SCF N₂ - AUG TREAT PSI 3400 @ 5 BPM, SI / HR
FLOW WELL BACK 1 HR - MADE ONE RUN WELL DRY - NO SHOWS.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE  TITLE AGENT DATE 04-02-03

Type or print name MIKE POWELL Telephone No. 365-7682
(This space for State use)

APPROVED BY  TITLE DISTRICT SUPERVISOR DATE 4/4/03

Conditions of approval, if any: