

06-11-2003 10:21AM FROM

TO

14323660743 P.02

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

OPERATOR'S COPY

FORM APPROVED
OMB No. 1004-0135
Expires: January 31, 2004

SUNDRY NOTICES AND REPORTS ON WELLS
Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

5. Lease Serial No.	LC 060325
6. If Indian, Allottee or Tribe Name	
7. If Unit or C/A Agreement, Name and/or No.	West Square Lake Unit #73884U4270
8. Well Name and No.	Tract 9 Well 13
9. API Well No.	30015-04081
10. Field and Pool, or Exploratory Area	Grayburg San Andreas
11. County or Parish, State	Eddy, NM

Type of Well
☒ Oil Well ☐ Gas Well ☐ Other

Name of Operator
Cleo Thompson

Address
O. Box 237, Loco Hills, NM 88255
3b. Phone No. (include area code)
(505) 677-2396

Location of Well (Footage, Sec., T. R., M., or Survey Description)

Unit Letter J of Sec. 4, T. 7S, R. 30E NMP 1980' FSL, 1980' FEL

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

TYPE OF ACTION

- ☐ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice


- | | | |
|---|---|---|
| ☐ Acidize | ☐ Deepen | ☒ Production (Start/Resume) |
| ☐ Alter Casing | ☐ Fracture Treat | ☐ Reclamation |
| ☒ Casing Repair | ☐ New Construction | ☐ Recomplete |
| ☐ Change Plans | ☐ Plug and Abandon | ☐ Temporarily Abandon |
| ☐ Convert to Injection | ☐ Plug Back | ☐ Water Disposal |

- ☐ Water Shut-Off
☐ Well Integrity
☐ Other

Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompletes horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-3 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

Rig up on 1/14/02.
Change out well head.
Pick up 6 1/8 inch 8 - 1 1/2 drill collars. G.I.H. tag up @ 2765' C.O. to T.D. (3150') Circulate hole clean. C.O.H.
Pick up 4 1/2 x 7" formation PKR. G.I.H. w/65 lbs. 4 1/2 csg. PKR set @ 2743'.
Rig up Halliburton O. W.S. C.O. pump 325 sx cmt. Circulate to surface 80 sx to the pit.
Drill out formation PKR C.O. to T.D. Circulate hole clean. C.O.H.

1600 Run Production Equipment and Put on Production

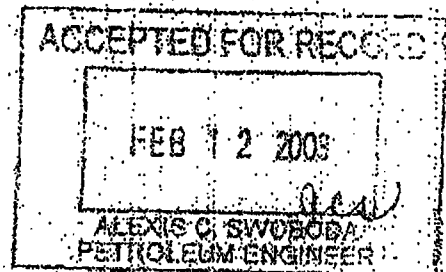

I hereby certify that the foregoing is true and correct
Name (Printed/Typed)

Amador Pando Jr.

Signature

Title Production Foreman

Date 2/08/02

proved by (Signature)

Name
(Printed/Typed)
Office

Title

Date

ditions of approval, if any, are attached. Approval of this notice does not warrant or
ify that the applicant holds legal or equitable title to those rights in the subject lease
it would enable the applicant to conduct operations thereon.