


OIL CONSERVATION COMMISSION

Santa Fe, New Mexico

MISCELLANEOUS REPORTS ON WELLS

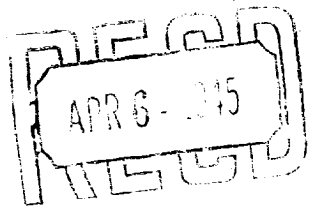

Submit this report in triplicate to the Oil Conservation Commission or its proper agent within ten days after the work specified is completed. It should be signed and sworn to before a notary public for reports on beginning drilling operations, results of shooting well, results of test of casing shut-off, result of plugging of well, and other important operations, even though the work was witnessed by an agent of the Commission. Reports on minor operations need not be signed and sworn to before a notary public. See additional instructions in the Rules and Regulations of the Commission.

Indicate nature of report by checking below:

REPORT ON BEGINNING DRILLING OPERATIONS		REPORT ON REPAIRING WELL	
REPORT ON RESULT OF SHOOTING OR CHEMICAL TREATMENT OF WELL		REPORT ON PULLING OR OTHERWISE ALTERING CASING	X
REPORT ON RESULT OF TEST OF CASING SHUT-OFF		REPORT ON DEEPENING WELL	
REPORT ON RESULT OF PLUGGING OF WELL	X		

Pampa, Texas,

April 2, 1945.

Place

Date

OIL CONSERVATION COMMISSION,
SANTA FE, NEW MEXICO.
Gentlemen:

Following is a report on the work done and the results obtained under the heading noted above at the _____
W. A. KATES & E. C. SIDWELL F. E. Sauble Well No. 1-A in the _____

Company or Operator _____ Lease _____
of Sec. 35, T. 27N, R. 24E, N. M. P. M.,
Wildcat Field, Colfax County.

The dates of this work were as follows: started plugging March 24th and completed March 29th.

Notice of intention to do the work was (was not) submitted on Form C-102 on March 29, 1945.
and approval of the proposed plan was (was not) obtained. (Cross out incorrect words.)

DETAILED ACCOUNT OF WORK DONE AND RESULTS OBTAINED
Matted back and bridged hole at 1880' and dumped 10 sacks mixed cement. Ripped 8-5/8" casing 61' above 1440' casing point, and pulled 8-5/8" casing leaving 61' in hole; then placed heavy mud to approximately 830' and run 10 sacks mixed cement; ripped 10-3/4" casing above the casing point 30' and pulled 10-3/4" leaving 30' in the hole; placed heavy mud back to 425' and run 10 sacks mixed cement and pulled 12 1/2" Casing; we then placed heavy mud to top and run 5 sacks cement on top of hole and placed 4" x 4' marker at mouth of well.

Witnessed by J. W. Phillips Oil Well Servicing Co. Toolpusher.
Name Company Title

Subscribed and sworn before me this

I hereby swear or affirm that the information given above is true and correct.

4 day of April, 1945.

Name _____

Position _____

Representing W. A. Kates and E. C. Sidwell.

Company or Operator _____

Address Box 308, Pampa, Texas.

My commission expires June 1, 1945.

Remarks:

Roy Yarbrough
Oil & Gas Inspector
Title

1. *Journal of the American Medical Association*, 1990; 263: 1025-1028.

10. *Journal of the American Statistical Association*, 1997, 92, 1023-1032.