

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.

30-059-20033

5. Indicate Type of LeaseSTATE ☐FEE ☐**6. State Oil & Gas Lease No.****7. Lease Name or Unit Agreement Name**

BRAVO DOME CO2 GAS UNIT

8. Well No.

2333-361J

9. Pool name or Wildcat

BRAVO DOME CO2 GAS UNIT

SUNDRY NOTICES AND REPORTS ON WELLS(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)**1. Type of Well**OIL
WELL ☐GAS
WELL ☐

OTHER CO2

2. Name of Operator

AMOCO PRODUCTION COMPANY

3. Address of Operator

P.O. Box 303, AMISTAD, NEW MEXICO 88410

4. Well LocationUnit Letter J : 1980 Feet From The South Line and 1980 Feet From The East Line
Section 36 Township 23N Range 33E NMPM Union County10. Elevation (Show whether DF, RKB, RT, GR, etc.)
4913 GR**11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data****NOTICE OF INTENTION TO:**PERFORM REMEDIAL WORK ☐PLUG AND ABANDON ☐TEMPORARILY ABANDON ☐CHANGE PLANS ☐PULL OR ALTER CASING ☐OTHER: ☐**SUBSEQUENT REPORT OF:**REMEDIAL WORK ☐ALTERING CASING ☐COMMENCE DRILLING OPNS. ☐PLUG AND ABANDONMENT ☒CASING TEST AND CEMENT JOB ☐OTHER: ☐**12. Describe Proposed or Completed Operations**

SEE RULE 1103.

(Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work)

10-7-99
MIRUSU

2/8/00 OK Ref

10-8-99


Shut down due to heavy rains

10-9-99

MIRUSU, kill well with fresh water, NUBOP, release packer and pull and lay down 2 3/8" production tubing and packer. Run CIBP on wireline and set at 2,102 feet. Run 2 3/8" workstring to 2102'. Displace casing with fresh water with corrosion inhibited fluid, pressure test casing to 500 psi, ok. Spot 5 sacks of Class C cement from 2102' - 2025', pull workstring to 1,746 feet, spot 12 sacks of cement from 1746' - 1592', pull workstring to 30 feet, fill casing with cement, NDBOP, cut off wellhead, install PXA marker, RDMOSU, cut off well anchors and clean location.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE



TITLE

Field Foreman

DATE

10-13-99

TYPE OR PRINT NAME


Danny J. Holcomb

TELEPHONE NO

(505) 374-3010

(This space for State Use)

APPROVED BY

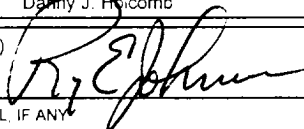

TITLE

DISTRICT 8012, 1980

DATE

2/10/00

CONDITIONS OF APPROVAL, IF ANY