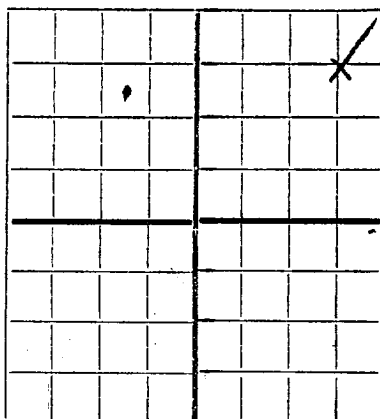


N

RECEIVED
APR 26 1948
RECEIVED
HOBBS OFFICE

NEW MEXICO OIL CONSERVATION COMMISSION

Santa Fe, New Mexico

AREA 640 ACRES
LOCATE WELL CORRECTLY

WELL RECORD

Mail to Oil Conservation Commission, Santa Fe, New Mexico, or its proper agent not more than twenty days after completion of well. Follow instructions in the Rules and Regulations of the Commission. Indicate questionable data by following it with (?). SUBMIT IN TRIPLICATE. FORM C-110 WILL NOT BE APPROVED UNTIL FORM C-105 IS PROPERLY FILLED OUT.

..... Cecil S. Ringle 3433 Purdue Place
 Company or Operator Address
 Ringle Well No. 1-A in N.W. 1/4 of Sec. 34, T. 6 N.
 R. 4 E., N. M. P. M., Ringle Field, Valencia County.
 Well is 990 feet south of the North line and 990 feet west of the East line of N. W. 1/4.
 If State land the oil and gas lease is No. Assignment No.
 If patented land the owner is Tome Grant, Address Tome N. M.
 If Government land the permittee is, Address
 The Lessee is Ringle Development Corp, Address Albuquerque N. M.
 Drilling commenced April 1946 Drilling was completed June 29 1947
 Name of drilling contractor, Address
 Elevation above sea level at top of casing 5600 feet.
 The information given is to be kept confidential until 19.....

OIL SANDS OR ZONES

No. 1, from 620 to 641 No. 4, from to
 No. 2, from 815 to 823 No. 5, from to
 No. 3, from to No. 6, from to

IMPORTANT WATER SANDS

Include data on rate of water inflow and elevation to which water rose in hole.

No. 1, from No important amount of water only little more than enough to
 No. 2, from drill with until 800 then both oil and water was unable to tell
 if they were together or not.
 No. 3, from to feet.
 No. 4, from to feet.

CASING RECORD

SIZE	WEIGHT PER FOOT	THREADS PER INCH	MAKE	AMOUNT	KIND OF SHOE	CUT & FILLED FROM	PERFORATED		PURPOSE
							FROM	TO	
7"	24	10 1/2		340'					cavy
5 3/16	20"	10		534'					cavy shab
4 "	5"			795'					