

DISTRICT I

P.O. Box 1980, Hobbs NM 88240

DISTRICT II

P.O. Drawer DD, Artesia NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec NM 87410

State of New Mexico  
Energy, Minerals and Natural Resources Department

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO. 30-005-61328  
5. Indicate Type of Lease  
State ☐ FEE ☒  
6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG A WELL TO A  
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT  
(FORM C-101) FOR SUCH PROPOSALS.)

Lease Name or Unit Agreement Name

BRONSON SH COM

1. Type of Well:

OIL ☐ GAS ☐  
WELL ☐ WELL ☒ OTHER ☐

2. Name of Operator

Yates Petroleum Corporation

8. Well No

1

3. Address of Operator

105 South 4th., Artesia, NM 88210

9. Pool Name or Wildcat

PECOS SLOPE ABO

4. Well Location

Unit Letter H : 1980 Feet From The NORTH Line and 660 Feet From The EAST Line

Section 9 Township T5S Rang R24E NMPM CHAVES COUNTY

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date or starting any proposed work) SEE RULE 1103.

YATES PETROLEUM CORPORATION respectfully requests permission to plug & abandon this well as follows:

1. Notify NMOCD 24 hours prior to starting plugging operations. MIRU WSU & all safety equipment. Load tubing & clean casing w/ 2% KCL water, ND wellhead & NU BOP; POH w/ tubing.

2. RU wireline truck & RIH w/ 4-1/2" gauge ring to 3530' to make sure casing is clear; RIH w/ 4-1/2" CIBP and set plug @ 3500'. MU dump bailer & RIH w/ bailer & dump 35' cement on top of CIBP; RD wireline.

3. RIH w/ tubing yo 3495' & circ hole w/ 10.0 ppg brine plugging mud w/ 25 lbs gel/bbl in mud; POH w/ tubing.

4. Pull tubing to 990' & spot 20 sk cement plug to cover base of 8-5/8" casing. Wait 3 hrs & tag plug @ 890' +/- before moving up to set next plug. Pull tubing up to 600' & set 1000' plug @ 500'. 0' - 125'

5. ND BOP & remove wellhead; install dry hole marker & clean location.

25 sk plug @ 3478'

25 sk plug @ 1418'

Notify OCD 24 hrs. prior to any work done

I hereby certify that the information above is a true and complete statement to the best of my knowledge and belief.

SIGNATURE

*Donna Clack*

TITLE

Regulatory Technician

DATE

3/12/03

TYPE OR PRINT NAME

DONNA CLACK

TELEPHONE NO.

505-748-1471

(This space for State Use)

APPROVED BY

TITLE

DATE


CONDITIONS OF APPROVAL, IF ANY

MAR 20 2003

**WELL NAME:** Bronson SH #1    **FIELD:** Pecos Slope Abo  
**LOCATION:** 1980' FNL & 660' FEL Sec 9-5S-24E    Chaves County  
**GL:** 3990'    **ZERO:**    **KB:** 3999'  
**SPUD DATE:** 12-26-82    **COMPLETION DATE:** 2-18-83  
**COMMENTS:**

**CASING PROGRAM**

|                  |       |
|------------------|-------|
| 8 5/8" 24# J-55  | 940'  |
| 4 1/2" 9.5# J-55 | 4196' |
|                  |       |

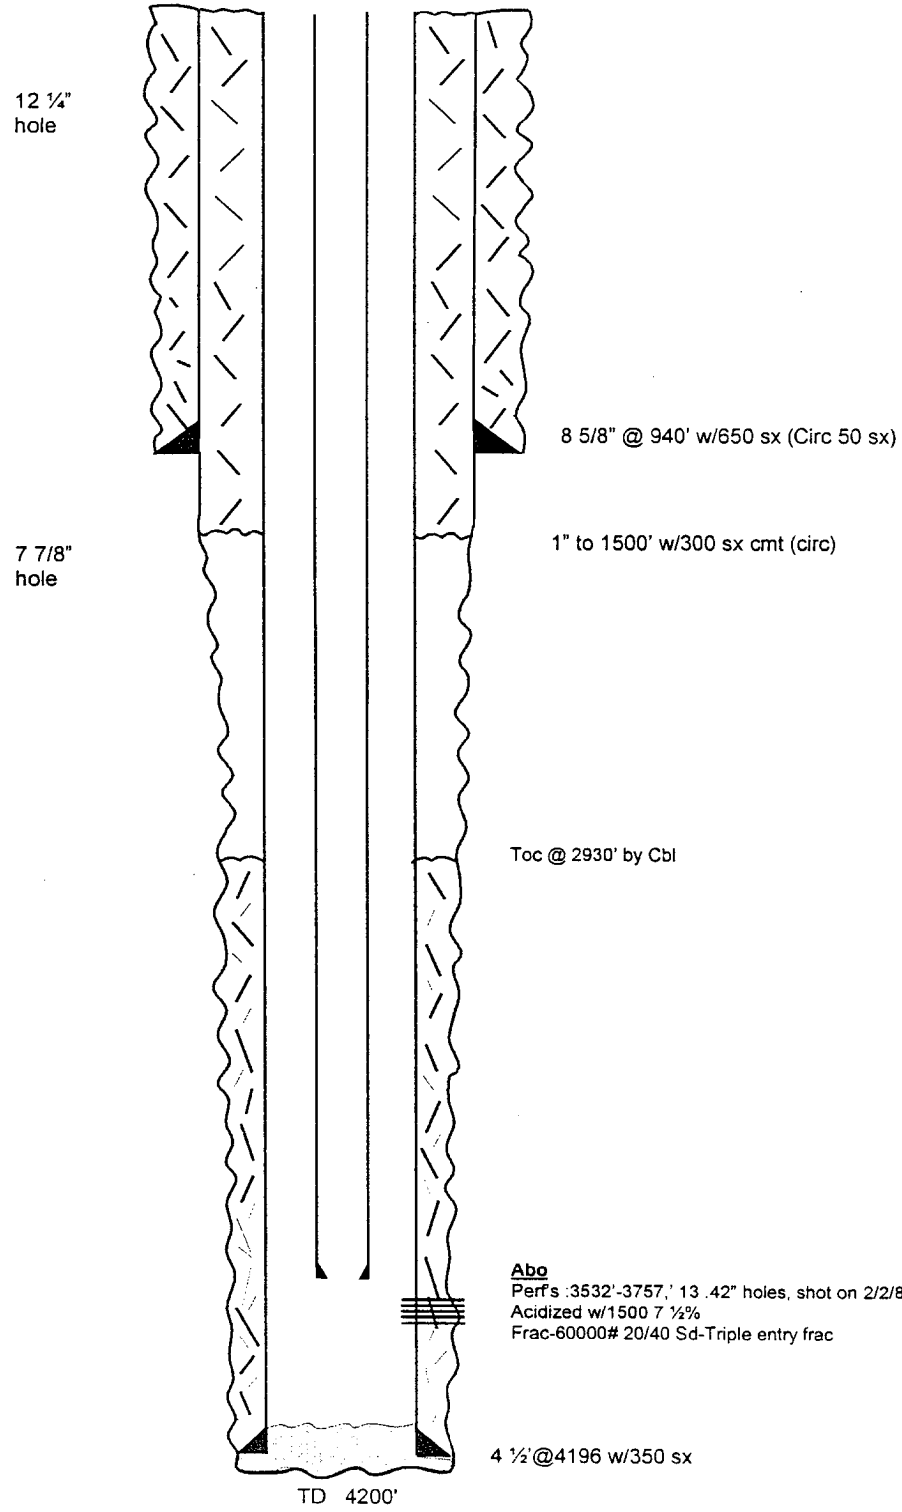

**Tops**

|            |       |
|------------|-------|
| San Andres | 504'  |
| Glorieta   | 1418' |
| Abo        | 3480' |

**BEFORE**


*Handwritten:* H-1111-10  
Hobbs  
DCO

Not to Scale  
 03/05/03  
 Cam

**WELL NAME:** Bronson SH #1    **FIELD:** Pecos Slope Abo  
**LOCATION:** 1980' FNL & 660' FEL Sec 9-5S-24E    Chaves County  
**GL:** 3990'    **ZERO:**    **KB:** 3999'  
**SPUD DATE:** 12-26-82    **COMPLETION DATE:** 2-18-83  
**COMMENTS:**


# **CASING PROGRAM**

|                  |       |
|------------------|-------|
| 8 5/8" 24# J-55  | 940'  |
| 4 1/2" 9.5# J-55 | 4196' |
|                  |       |

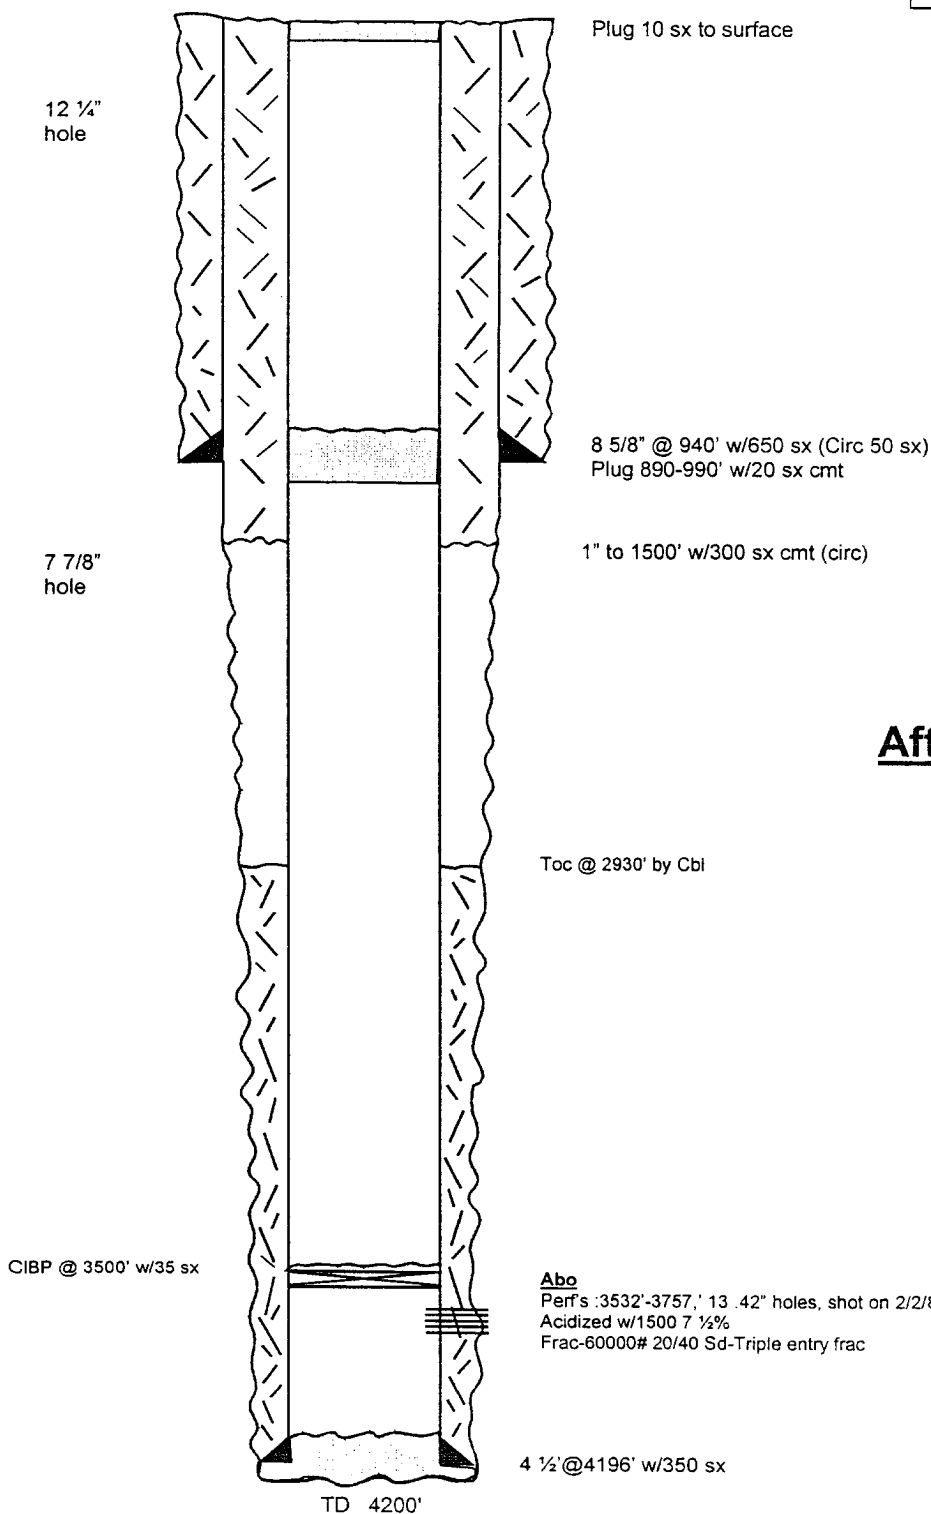

Not to Scale  
 03/05/03  
 Cam

|                                            |                         |                           |                                       |
|--------------------------------------------|-------------------------|---------------------------|---------------------------------------|
| <b>OPERATOR:</b> Yates Petroleum Corp.Inc. |                         | <b>API#</b> 30-015-61328  |                                       |
| <b>WELL:</b> Bronson SH #1                 |                         | <b>LOCATION:</b> H-9-5-24 |                                       |
| <b>SURFACE CSG-HOLE SIZE</b> 12 1/4"       | <b>CSG. SIZE</b> 8 5/8" | <b>SET @</b> 940'         | <b>SX. CMT.</b> 650 <b>TOC.</b> Circ  |
| <b>LONG STRING- HOLE SIZE</b> 7 7/8"       | <b>CSG. SIZE</b> 4.5"   | <b>SET @</b> 4196'        | <b>SX. CMT.</b> 350 <b>TOC.</b> 2930' |
| <b>OTHER-</b>                              |                         |                           |                                       |

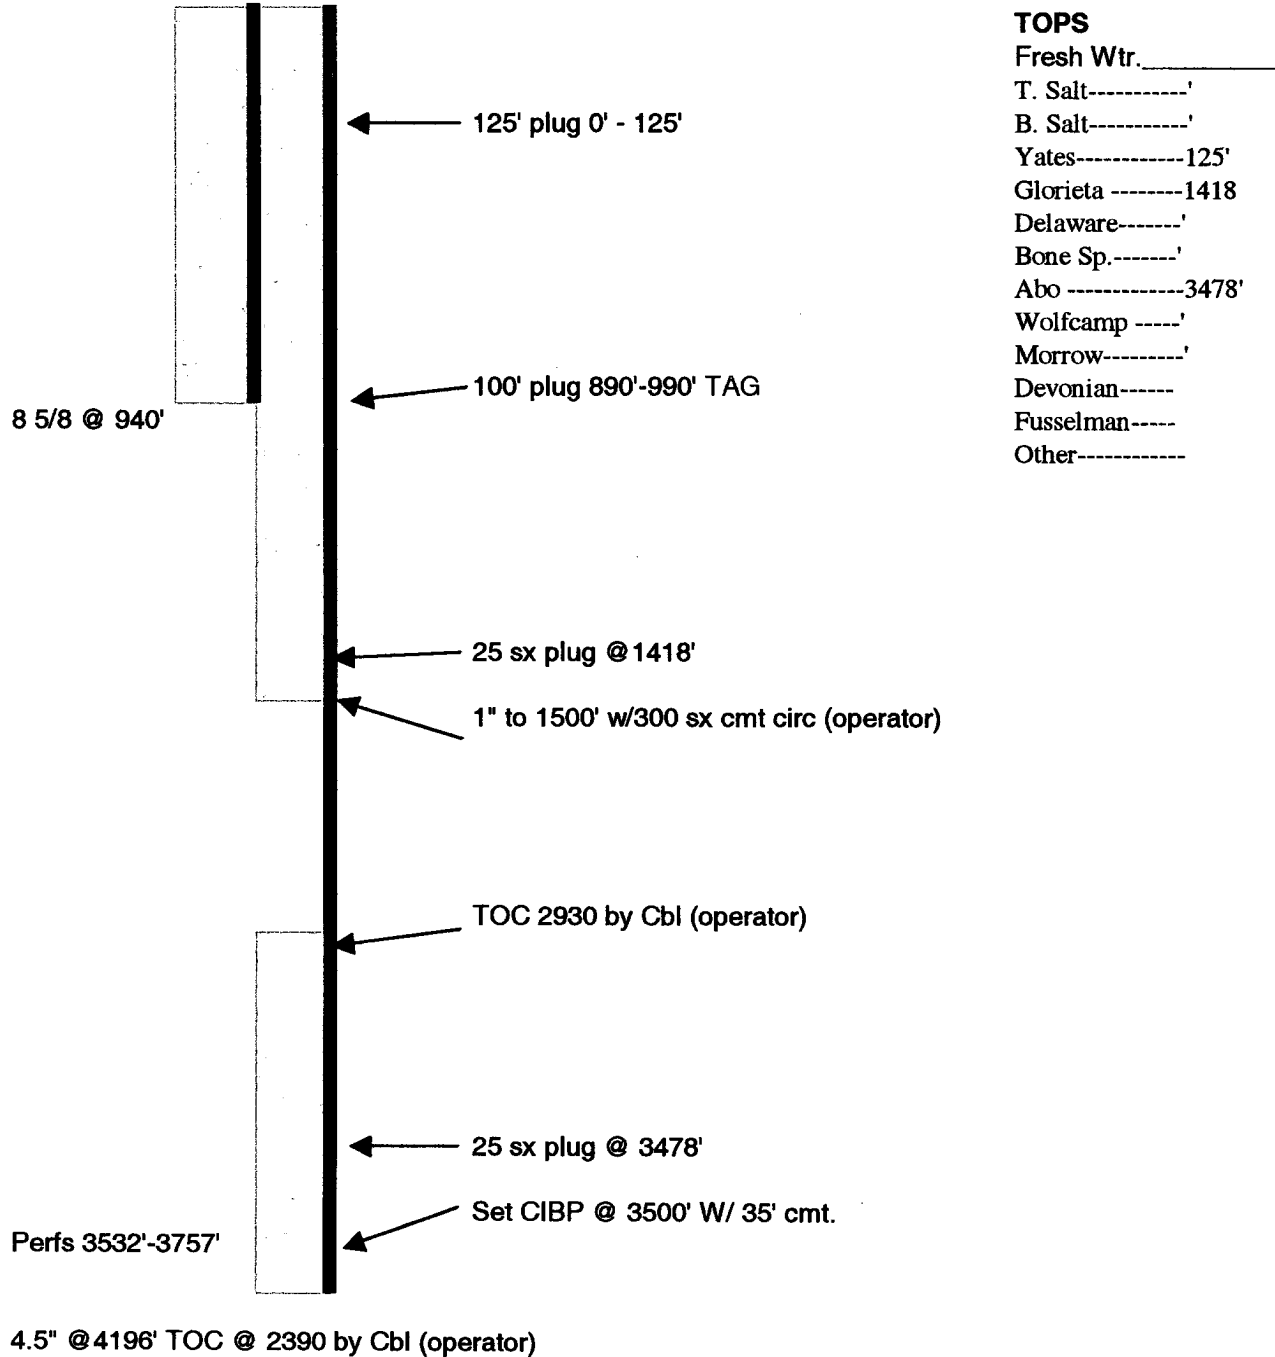

|                                            |                         |                           |                                       |
|--------------------------------------------|-------------------------|---------------------------|---------------------------------------|
| <b>OPERATOR:</b> Yates Petroleum Corp.Inc. |                         | <b>API#</b> 30-015-61328  |                                       |
| <b>WELL:</b> Bronson SH #1                 |                         | <b>LOCATION:</b> H-9-5-24 |                                       |
| <b>SURFACE CSG-HOLE SIZE</b> 12 1/4"       | <b>CSG. SIZE</b> 8 5/8" | <b>SET @</b> 940'         | <b>SX. CMT.</b> 650 <b>TOC.</b> Circ  |
| <b>LONG STRING- HOLE SIZE</b> 7 7/8"       | <b>CSG. SIZE</b> 4.5"   | <b>SET @</b> 4196'        | <b>SX. CMT.</b> 350 <b>TOC.</b> 2930' |
| <b>OTHER-</b>                              |                         |                           |                                       |

