

Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Ave., Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103

Revised June 10, 2003

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG OR FOR SUCH DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-005-61443
1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/> Plug & Abandon <input type="checkbox"/>		5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
2. Name of Operator Pecos River Operating		6. State Oil & Gas Lease No.
3. Address of Operator 400 W. Illinois - Suite 1070 - Midland, TX 79701		7. Lease Name or Unit Agreement Name Mitchell
4. Well Location Unit Letter D; 660 feet from the North line and 990 feet from the West line		8. Well Number 1
Section 9 Township 6S Range 26E NMPM Chaves County		9. OGRID Number 017081
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3644' GR		10. Pool name or Wildcat Pecos Slope Abo

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK <input type="checkbox"/> PLUG AND ABANDON <input type="checkbox"/> TEMPORARILY ABANDON <input type="checkbox"/> CHANGE PLANS <input type="checkbox"/> PULL OR ALTER CASING <input type="checkbox"/> MULTIPLE COMPLETION <input type="checkbox"/> OTHER: <input type="checkbox"/>		SUBSEQUENT REPORT OF: REMEDIAL WORK <input type="checkbox"/> ALTERING CASING <input type="checkbox"/> COMMENCE DRILLING OPNS. <input type="checkbox"/> PLUG AND ABANDONMENT <input checked="" type="checkbox"/> CASING TEST AND CEMENT JOB <input type="checkbox"/> OTHER: <input type="checkbox"/>
-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--	------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

8-20-2003 - Moved in and rigged up pulling unit and plugging equipment. Soaking wellhead bolts. Shut down for night.
 8-21-2003 - Nippled down wellhead. Tried to release packer. Broke U-joint on hydraulic pump. Shut down for night.
 8-22-2003 - Repaired hydraulic pump. Nippled up BOP. Rigged up floor and tubing equipment. Jarred on packer. POOH with 88 joints tubing, packer and 39 joints. RIH with 127 joints of tubing. Shut well in for night.
 8-23-25-2003 - Dug pit. Circulated hole with plugging mud. Spotted 30 sacks Class C Neat cement at 4060'. POOH with 50 joints. Shut well in for night. WOC.
 8-26-2003 - RIH with tubing - did not tag plug. Spotted 30 sacks Class C Neat cement at 4060'. POOH with tubing. Shut well in for night. WOC.
 8-27-2003 - RIIH with tubing and tagged plug at 3765'. Circulated hole with plugging mud. POOH with tubing. Rigged up wireline. RIH and perforated 4-1/2" casing at 1622'. POOH and rigged down wireline. Shut well in for night.
 8-28-2003 - RIH with packer and tubing. Squeezed with 40 sacks Class C Neat cement. WOC 4 hours. POOH with packer and

CONTINUED ON NEXT PAGE:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Rusty Klein TITLE Agent for BCM & Associates DATE Sept. 10, 2003

Type or print name Rusty Klein

E-mail address: koyote@plateautel.net

Telephone No. 505-748-2159

(This space for State use)

APPROVED BY [Signature] TITLE

DATE OCT 4 2005

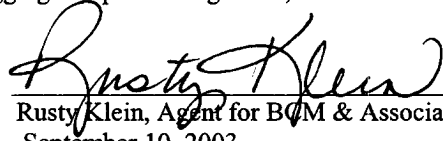
Conditions of approval, if any:

PECOS RIVER OPERATING
Mitchell #1
Section 9-T6S-R26E
Chaves County, New Mexico

SUNDRY NOTICE CONTINUED:

RIH open ended and tagged plug at 1508'. Pulled up hole to 900'. Spotted 25 sacks Class C Neat cement. POOH with tubing. Shut well in for night. WOC.

8-29-2003 – RIH with tubing and tagged plug at 765'. POOH with tubing. Rigged up wireline. RIH and perforated 4-1/2" casing at 100'. POOH and rigged down wireline. Rigged down tubing equipment and floor. Nipped down BOP and casinghead. Installed 4-1/2" X 2" swedge with valve. Circulated 60 sacks Class C Neat cement down 4-1/2" casing and up to surface of 8-5/8" casing. WOC 4 hours. Cement at 2'. Rigged down pulling unit and plugging equipment. Cut off wellhead. Installed regulation abandonment marker. PLUGGED AND ABANDONED – FINAL REPORT. Plugging completed August 28, 2003.

A handwritten signature in cursive script, reading "Rusty Klein", is written over a horizontal line.

Rusty Klein, Agent for BCM & Associates
September 10, 2003