

Submit 1 Copy To Appropriate District Office
 District I - (575) 393-6161
 1625 N. French Dr., Hobbs, NM 88240
 District II - (575) 748-1283
 811 S. First St., Artesia, NM 88210
 District III - (505) 334-6178
 1000 Rio Brazos Rd., Aztec, NM 87410
 District IV - (505) 476-3460
 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
 Energy, Minerals and Natural Resources

Form C-103
 Revised July 18, 2013

OIL CONSERVATION DIVISION
 1220 South St. Francis Dr.
 Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.) 1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input checked="" type="checkbox"/> Other		WELL API NO. 30-005-61146
2. Name of Operator Yates Petroleum Corporation		5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
3. Address of Operator 105 South Fourth Street, Artesia, NM 88210		6. State Oil & Gas Lease No.
4. Well Location Unit Letter <u>N</u> : <u>660</u> feet from the <u>South</u> line and <u>1730</u> feet from the <u>West</u> line Section <u>30</u> Township <u>8S</u> Range <u>26E</u> NMPM Chaves County		7. Lease Name or Unit Agreement Name Acme Com
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3676' GR		8. Well Number 4
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data		9. OGRID Number 025575
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK <input type="checkbox"/> PLUG AND ABANDON <input checked="" type="checkbox"/> TEMPORARILY ABANDON <input type="checkbox"/> CHANGE PLANS <input type="checkbox"/> PULL OR ALTER CASING <input type="checkbox"/> MULTIPLE COMPL <input type="checkbox"/> DOWNHOLE COMMINGLE <input type="checkbox"/> CLOSED-LOOP SYSTEM <input type="checkbox"/> OTHER: <input type="checkbox"/>		SUBSEQUENT REPORT OF: REMEDIAL WORK <input type="checkbox"/> ALTERING CASING <input type="checkbox"/> COMMENCE DRILLING OPNS. <input type="checkbox"/> P AND A <input type="checkbox"/> CASING/CEMENT JOB <input type="checkbox"/> OTHER: <input type="checkbox"/>
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.		

Yates Petroleum Corporation plans to plug and abandon this well as follows:

- MIRU WSU. Rig up safety equipment as needed. No casing recovery will be attempted. TOH with 2-7/8" tubing.
- TIH and set a CIBP at 4,452' and cap with 35' cement. This puts a plug over the open Abo perforations.
- Spot a 25 sx Class "C" cement plug from 4,076'-4,176'. This puts a 100' plug across the top of the Abo.
- Spot a 25 sx Class "C" cement plug from 2,304'-2,404'. POOH. This puts a 100' plug across the Intermediate Casing shoe. WOC and tag plug.
- Spot a 25 sx Class "C" cement plug from 1,371'-1,471'. This puts a 100' plug across the top of the Glorietta.
- Spot a 25 sx Class "C" cement plug from 787'-887'. This puts a 100' plug across the Surface Casing shoe. WOC and tag plug.
- Perforate and spot a 20 sx Class "C" cement plug from 60' up to the surface outside and inside casing.
- Remove all surface equipment, weld dry hole marker and clean location as per regulations.

Schematics attached

CONDITIONS OF APPROVAL ATTACHED

Spud Date: Approved for plugging of well bore only. Liability under bond is retained pending receipt of C-103 (Subsequent Report of Well Plugging) which may be found at OCD Web Page under Forms. www.emnrd.state.nm.us/ocd.

Approval Granted providing work is Completed by Oct 9, 2014

RECEIVED

OCT 04 2013

NMOCD ARTESIA

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Laura Watts TITLE Regulatory Reporting Technician DATE October 3, 2013

Type or print name Laura Watts E-mail address: laura@yatespetroleum.com PHONE: 575-748-4272

For State Use Only

APPROVED BY: [Signature] TITLE Dr. R. S. [Signature] DATE Oct 9, 2013
 Conditions of Approval (if any):

* See Attached COA's

WELL NAME: ACME Com #4 FIELD: Pecos Slope Abo

LOCATION: 660' FSL & 1730' FWL Sec 30-8S-26E Chaves County

GL: 3,676' ZERO: _____ KB: _____

SPUD DATE: 10/10/81 COMPLETION DATE: _____

COMMENTS: API No. 30-005-61146

CASING PROGRAM

13-3/8" 48# H-40 ST&C	837'
8-5/8" 24# J-55 ST&C	2,354'
4 1/2" 10.5# K-55 ST&C	4,796'

Top of bond log is at 3850'.
Good bond all they way. No
TOC on CBL.
Calc TOC @ 418' w/ a yield of
1.32 and a safety factor of 75%
in open hole

Current

13-3/8" @ 837'
w/ 1400 sx
1" w 1050 sx from TOC @ 480' to surface.

Formation tops:

San Andres:	770'
Glorieta:	1,421'
Tubb:	3,396'
Abo:	4,126'

8-5/8" @ 2,354'
w/ 1300 sx (circ)


Abo perms:
4,502', 03', 04', 05', 06',
07', 09.5' (2 jspl)

4 1/2" @ 4,796'
w/1100 sx

17-1/2" Hole

11" Hole

7 7/8" Hole

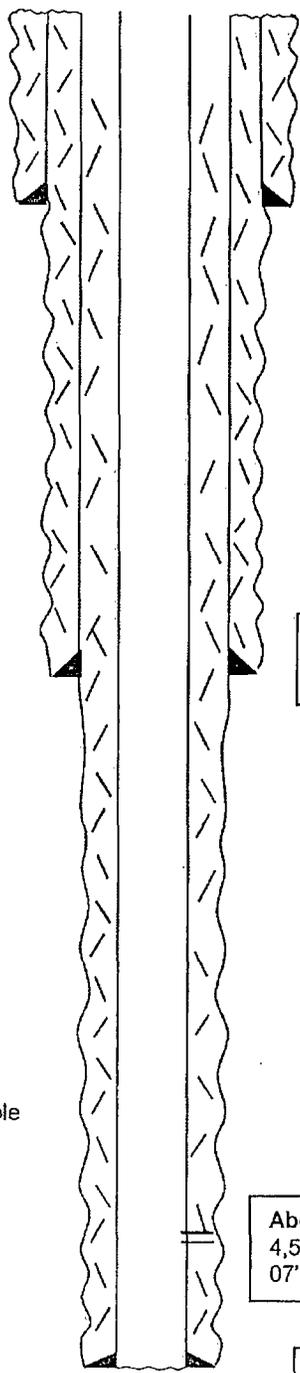

TD 4,800'
FC 4,756'

Not to Scale
08/20/13
MMFH

WELL NAME: ACME Com #4 FIELD: Pecos Slope Abo

LOCATION: 660' FSL & 1730' FWL Sec 30-8S-26E Chaves County


GL: 3,676' ZERO: KB:

SPUD DATE: 10/10/81 COMPLETION DATE:

COMMENTS: API No. 30-005-61146

CASING PROGRAM

13-3/8" 48# H-40 ST&C	837'
8-5/8" 24# J-55 ST&C	2,354'
4 1/2" 10.5# K-55 ST&C	4,796'

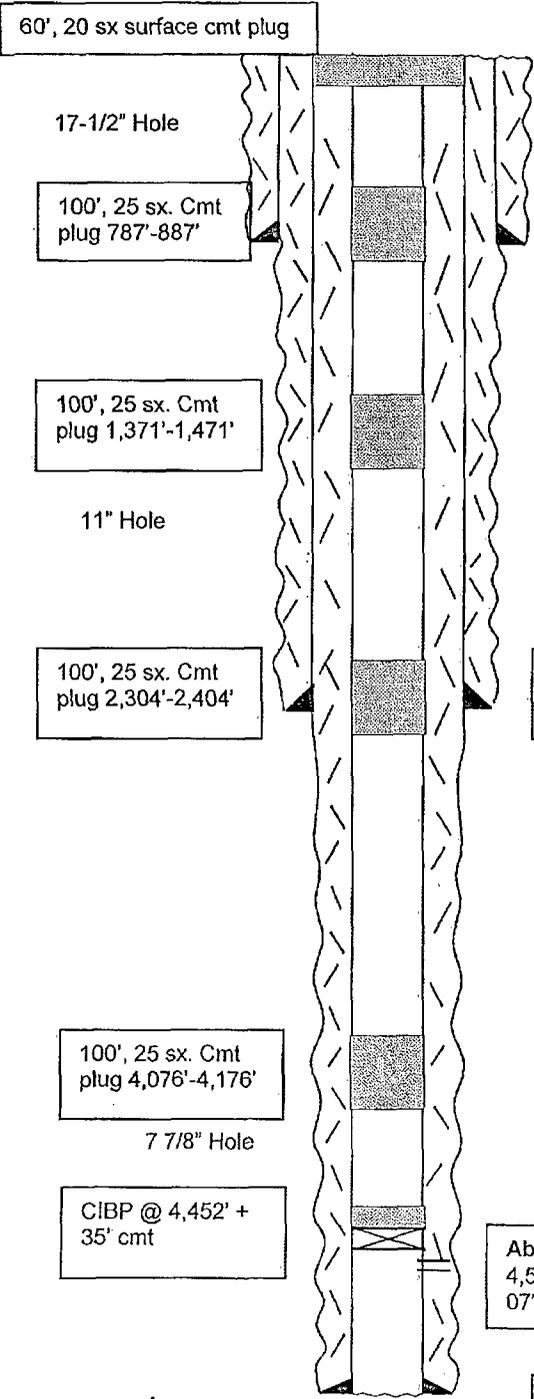

Top of bond log is at 3850'.
 Good bond all they way. No TOC on CBL.
 Calc TOC @ 418' w/ a yield of 1.32 and a safety factor of 75% in open hole

13-3/8" @ 837'
 w/ 1400 sx
 1" w 1050 sx from TOC @ 480' to surface.

8-5/8" @ 2,354'
 w/ 1300 sx (circ)

Abo perms:
 4,502', 03', 04', 05', 06',
 07', 09.5' (2 jspf)

4 1/2" @ 4,796'
 w/1100 sx

TD 4,800'
 FC 4,756'

AFTER

Formation tops:

San Andres:	770'
Glorieta:	1,421'
Tubb:	3,396'
Abo:	4,126'

Not to Scale
 08/20/13
 MMFH

NEW MEXICO OIL CONSERVATION DIVISION
DISTRICT 2 OFFICE
811 S. FIRST STREET
ARTESIA, NM 88210
(575)748-1283

CONDITIONS OF APPROVAL FOR PLUGGING & ABANDONMENT

Operator: Yates Petroleum

Well Name & Number: Acme Com #4

API #: 30-005-61146

1. Produced water **will not** be used during any part of the plugging & abandonment operation.
2. Notify NMOCD Dist. 2 office at least 24 hrs before beginning work.
3. Closed Loop System is to be used for entire plugging operation. Upon completion, contents of steel pit are to be hauled to a permitted disposal location.
4. Trucking companies being used to haul oilfield waste fluids to a disposal – commercial or private – shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator, as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall produce a copy upon request of NMOCD Field Inspectors.
5. A subsequent C-103 will serve as notification that the well bore has been plugged **ONLY**. A C-103 FINAL shall be filed before any bonding can be released on the well. Upon receipt of the Final, an inspection will be performed to verify that the location has been satisfactorily cleaned to NMOCD standards.
6. If work has not begun within 90 days of the approval of this procedure, an extension request must be filed, stating reason that well has not been plugged.
7. Every attempt must be made to clean the well bore out to below the perms, before any plugs can be set, by whatever means possible.
8. **Cement Retainers may not be used.**

9. Squeeze pressures are not to exceed 500 PSI, unless approval is given by NMOCD.
10. Plugs may be combined after consulting with and getting approval from NMOCD.
11. Minimum WOC time for tag plugs will be 4 Hrs.

DATE: Oct 9, 2013

APPROVED BY: *RD*

GUIDELINES FOR PLUGGING AND ABANDONMENT

DISTRICT II / ARTESIA

- All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater.
- Mud laden fluids must be placed between all cement plugs.
- Mud laden fluids must be mixed at 25 sacks of gel per 100 bbls of water.
- A cement plug is required to be set 50' below and 50' above all casing shoes and casing stub plugs. These plugs must be tagged.
- A CIBP with 35' of cement on top may be set in lieu of 100' cement plug.
- A plug as indicated above must be placed within 100' of top perforation. This plug must be tagged.
- Plugs set below and above salt zones must be tagged.
- No more than 2000' is to be allowed between cement plugs in open hole and no more than 3000' in cased hole.
- DV tools are required to have a 100' cement plug set 50' above and below the tool and must be tagged.

- Formations to be isolated with plugs placed at the top of each formation are:
 - Fusselman
 - Devonian
 - Morrow
 - Wolfcamp
 - Bone Spring
 - Delaware
 - Any Salt Section (Plug at top and bottom)
 - Abo
 - Glorieta
 - Yates (this plus is usually at base of salt section)

- If cement does not exist behind casing strings at recommended formation depths, the casing must be cut and pulled with plugs set at these depths or casing must be perforated and cement squeezed behind casing at the formation depths.
- In the R-111-P area (Potash Mine area) a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts common to the section penetrated and in suitable proportions, but not more than a 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible (50' below and 50' above).