

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

N.M. OIL CONSERVATION DIVISION

811 S. FIRST STREET
ARTESIA, NM 88210FORM APPROVED
OMB No. 1004-0137
Expires: October 31, 2014**SUNDRY NOTICES AND REPORTS ON WELLS**
Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

5. Lease Serial No.	NM-12557
6. If Indian, Allottee or Tribe Name	N/A
7. If Unit of CA/Agreement, Name and/or No.	N/A
8. Well Name and No.	DUNCAN FEDERAL #2
9. API Well No.	30-005-62235
10. Field and Pool or Exploratory Area	Wolf Lake San Andres, South
11. County or Parish, State	CHAVES COUNTY, NEW MEXICO

SUBMIT IN TRIPLICATE - Other instructions on page 2.

1. Type of Well <input checked="" type="checkbox"/> Oil Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other	2. Name of Operator JALAPENO CORPORATION
3a. Address P.O. BOX 1608 ALBUQUERQUE, NEW MEXICO 87103	3b. Phone No. (include area code) 505-242-2050
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 330' FSL & 990' FWL SEC. 7, T-9S, R-28E	

12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input checked="" type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input type="checkbox"/> Other
	<input type="checkbox"/> Change Plans	<input checked="" type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleate horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleation in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.)

PBSD of the well is 2346, We propose to:

1. Set a Cement Plug from PBSD to 50ft above top perforations (appr. 2191'-2346').

2. Wait for cement to dry and tag at or above 2191'. WITNESS

3. Fill hole with mud 50 feet below Surface Shoe.

4. Perforate 50 feet below Surface Shoe and circulate cement hole to surface from 469'. WITNESS

5. Wait for cement to dry.

6. Set dry hole marker.

RD 5/12/14
Accepted for record
NMOCSUBJECT TO
LIKE APPROVAL
BY NMOCSEE ATTACHED FOR
CONDITIONS OF APPROVALAPPROVED FOR 3 MONTH PERIOD
ENDING AUG 6 2014

14. I hereby certify that the foregoing is true and correct. Name (Printed/Typed)

H. Emmons Yates III

Title Vice President

Signature

Date 04/22/2014

RECEIVED

MAY 12 2014

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

NMOC ARTESIA

Approved by

Assistant Field Manager,

Date

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Title Lands and Minerals
Office

ADSWELL FIELD OFFICE

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

SCHEMATIC PRIOR TO PLUG AND ABANDON
JALAPENO CORPORATION
DUNCAN FEDERAL NO. 2
CHAVES COUNTY, NEW MEXICO
API NO. 30-005-62235

TOG Surface

FORMATION TOPS	
B/ALLUVIUM	330'
T/YATES	446'
QUEEN	1110'
SAN ANDRES	1625'
P1	2218'

7 5/8 " 15# @ 419' in 12 1/2" hole
 CMT to surface

4 1/2 " 11.5# @ 2317' in 6 1/2" hole

Top of cement 1315'

PBTD 2346'

TD 2350'

7/15/1988

Perforations:

2241-2249,
 2252-2256,
 & 2262-2265
 (18 shots)

11/11/2002

Re-Perforations:

2265-2267,
 2293-2295,
 2299, 2300 & 2320
 (11 shots)

NOT TO SCALE

SCHEMATIC AFTER PLUG AND ABANDON
JALAPENO CORPORATION
DUNCAN FEDERAL NO. 2
CHAVES COUNTY, NEW MEXICO
API NO. 30-005-62235

TOG Surface

FORMATION TOPS	
B/ALLUVIUM	330'
T/YATES	446'
QUEEN	1110'
SAN ANDRES	1625'
P1	2218'

7 5/8 " 15# @ 419' in 12 1/2" hole
 CMT to surface

Plug 469'-surface

6' of Perforations

4 1/2 " 11.5# @ 2317' in 6 1/2" hole

Top of cement 1315'

7/15/1988

Perforations:
 2241-2249,
 2252-2256,
 & 2262-2265
 (18 shots)

11/11/2002

Re-Perforations:
 2265-2267,
 2293-2295,
 2299, 2300 & 2320
 (11 shots)


2191' is 50' above perforation

Cement Plug 2191'-2346'

PBTD 2346'

TD 2350'

NOT TO SCALE

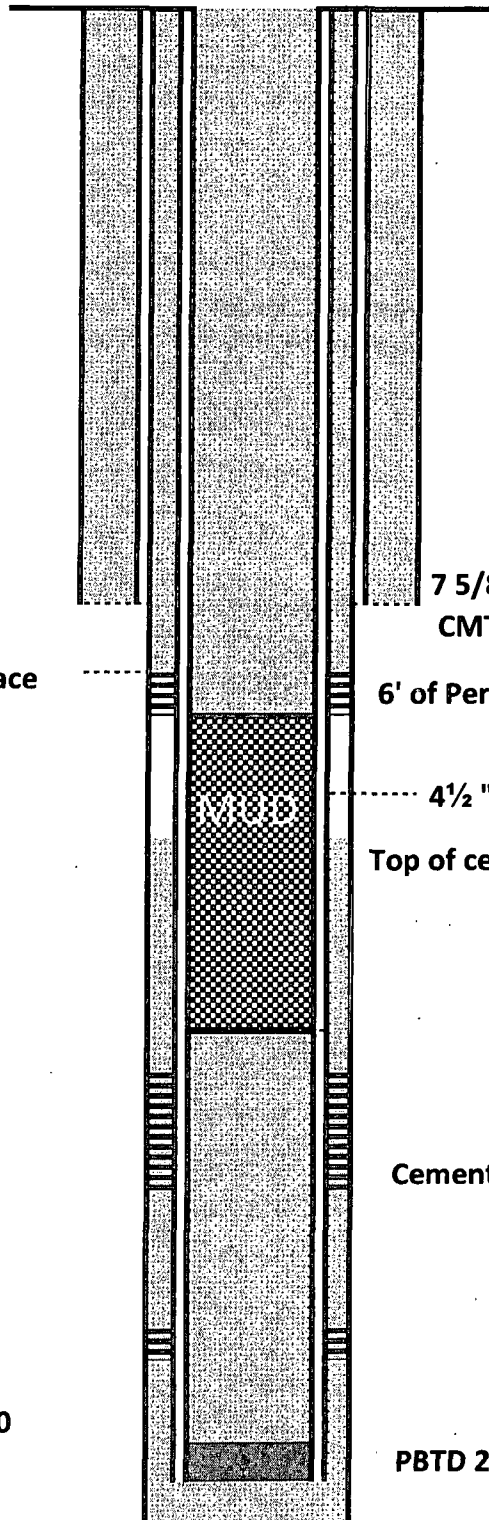

BUREAU OF LAND MANAGEMENT

**Roswell Field Office
2909 West Second Street
Roswell, New Mexico 88201
(575) 627-0272**

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within **ninety (90) days** from the approval date of this Notice of Intent to Abandon. **If you are unable to plug the well by the 90th day provide the BLM Roswell Field Office, prior to the 90th day, with the reason for not meeting the deadline and a date when the BLM Roswell Field Office can expect the well to be plugged. Failure to do so will result in enforcement action.**

2. Notification: Contact the BLM Roswell Field Office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, during office hours call (575) 627-0205 or after office hours call (575) 420-2832. Engineer on call during office hours phone (575) 627-0275 or phone (after hours) call (575) 626-5749.

3. Blowout Preventers: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9090 feet; a 3M system for a well not deeper than 13636 feet; and a 5M system for a well not deeper than 22727 feet.

4. Mud Requirement: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at a rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.

5. Cement Requirement: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 50 feet of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either class "C" for up to 7500 feet of depth, mixed at 14.8 lbs./gal with 6.3 gallons of fresh water per sack or class "H" for deeper than 7500 feet plugs, mixed at 16.4 lbs./gal with 4.3 gallons of fresh water per sack.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be capped with a 4-inch pipe, 10 feet in length, 4 feet above the ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker: Well name and number, the name of the operator, the lease serial number, the surveyed location (the quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer; such as metes and bounds).

7. Subsequent Plugging Reporting: Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to the BLM Roswell Field Office. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

Following the submittal and approval of the Subsequent Report of Abandonment, a Notice of Intent for Final Abandonment with the proposed surface restoration procedure must be submitted for approval.