

Submit 1 Copy To Appropriate District Office	State of New Mexico			Form C-103
District – (575) 393-6161 Energy, Minerals and Natural Resources			WELL API NO.	Revised July 18, 2013
1625 N. French Dr., Hobbs, NM 88240 District II – (575) 748-1283			30-015-26303	
811 S. First St., Artesia, NM 88210 OIL CONSERVATION DIVISION			5. Indicate Type of Lea	ise
District III – (505) 334-6178 1220 South St. Francis Dr. 1000 Rio Brazos Rd., Aztec, NM 87410			STATE 🖂	FEE
<u>District IV</u> – (505) 476-3460 Santa Fe, NM 8/505			6. State Oil & Gas Lea	se No.
1220 S. St. Francis Dr., Santa Fe, NM 87505			E-2781	
SUNDRY NOTICES AND REPORTS ON WELLS			7. Lease Name or Unit	Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH			Huisache AHI State	
PROPOSALS)			8. Well Number	
1. Type of Well: Oil Well Gas Well Other			1	
2. Name of Operator			9. OGRID Number	
Yates Petroleum Corporation			025575	
3. Address of Operator			10. Pool name or Wild	
105 South Fourth Street, Artesia, NM 88210			N. Seven Rivers; Glorie	eta-Yeso
4. Well Location				
Unit Letter H : 1980 feet from the North line and 660 feet from the East line				
Section 2 Township 20S Range 24E NMPM Eddy County				
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3624'GR				1950
	3024	GK ,		
12 Charle	Appropriate Day to Indicate N	otumo of Notice	Domant on Other Date	
12. Check	Appropriate Box to Indicate N	ature of Notice,	Report or Other Data	
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:				
PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒ REMEDIAL WOR				ERING CASING
TEMPORARILY ABANDON 🔲 CHANGE PLANS 🔲 COMMENCE DRI			ILLING OPNS. P AN	ID A
PULL OR ALTER CASING MULTIPLE COMPL CASING/CEMENT			T JOB 🔲	
DOWNHOLE COMMINGLE	· · · · · · · · · · · · · · · · · · ·			
CLOSED-LOOP SYSTEM OTHER:		OTUED.		
	nleted operations (Clearly state all a	OTHER:	d give pertinent dates, inc	luding estimated date
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14.NMAC. For Multiple Completions: Attach wellbore diagram of				
proposed completion or recompletion.				
Yates Petroleum Corporation plans to plug and abandon this well as follows:				
1. MIRU all safety equipment as needed. NU BOP. No casing recovery will be attempted as production casing is cemented to surface.				
2. Set a 7" CIBP at 2160'. Spot a 35 sx Class "C" cement plug from 1954'-2160' over Yeso perfs and across Glorieta top.				
3. Spot a 35 sx Class "C" cement plug from 1012'-1162' across the surface casing shoe. WOC and tag, reset if necessary.				
4. Spot a 25 sx Class "C" cement plug from 0-150' for the surface plug. WOC and tag, reset if necessary.				
5. Remove all surface equipment a	nd weld dry hole marker as per regul	ations.	9 4 ₈	,
Wellbore schematics attached		Approved for plugg	aring our course course	I OIL CONSERVATION
CONDITIONS OF APPROVAL ATTA	CHED	Liability under bon	d is retained pending receipt	ARTESIA DISTRICT
CONDITIONS OF AFFROVAL ATTA	CHED	which may be found	ent Report of Well Plugging) d at OCD Web Page under	MAR 3 0 2015
Approval Granted providing wo	ork is	Forms, www.cmnrd	.state.nm.us/ocd.	
Completed by	лк is 			RECEIVED
3/31/2016	nia nata na	, .		RECEIVED
<u> </u>	Rig Release Da	ite:		
				,
I hereby certify that the information	a shove is true and complete to the he	et of my knowledg	e and haliaf	
I hereby certify that the information above is true and complete to the best of my knowledge and belief.				
SIGNATURE (TITLE Regulatory Reporting Supervisor DATE March 24, 2015				
Type or print name E-mail address: tinah@yatespetroleum.com PHONE: 575-748-4168 For State Use Only				
POLICIA DE COMY				
APPROVED BY: NOW TITLE DIST DOWNS() DATE 3/31/2015				
Conditions of Approval (if any):				
>> Dec Attacked (C)As				
,	· · · · · · · · · · · · · · · · · · ·	· ·		

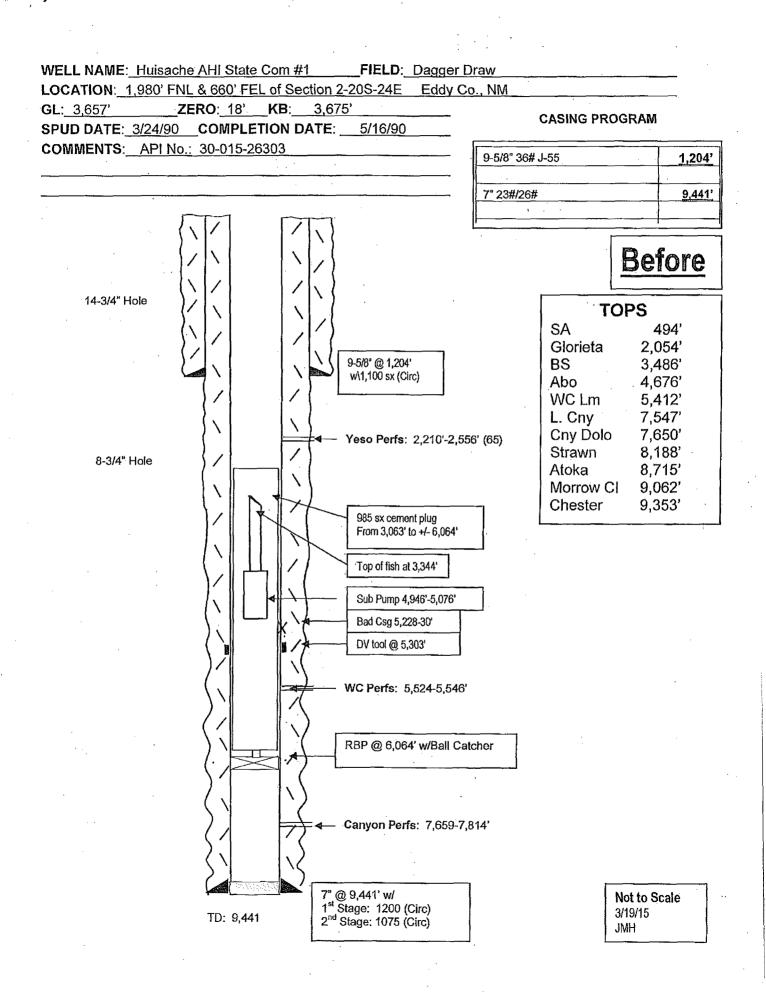

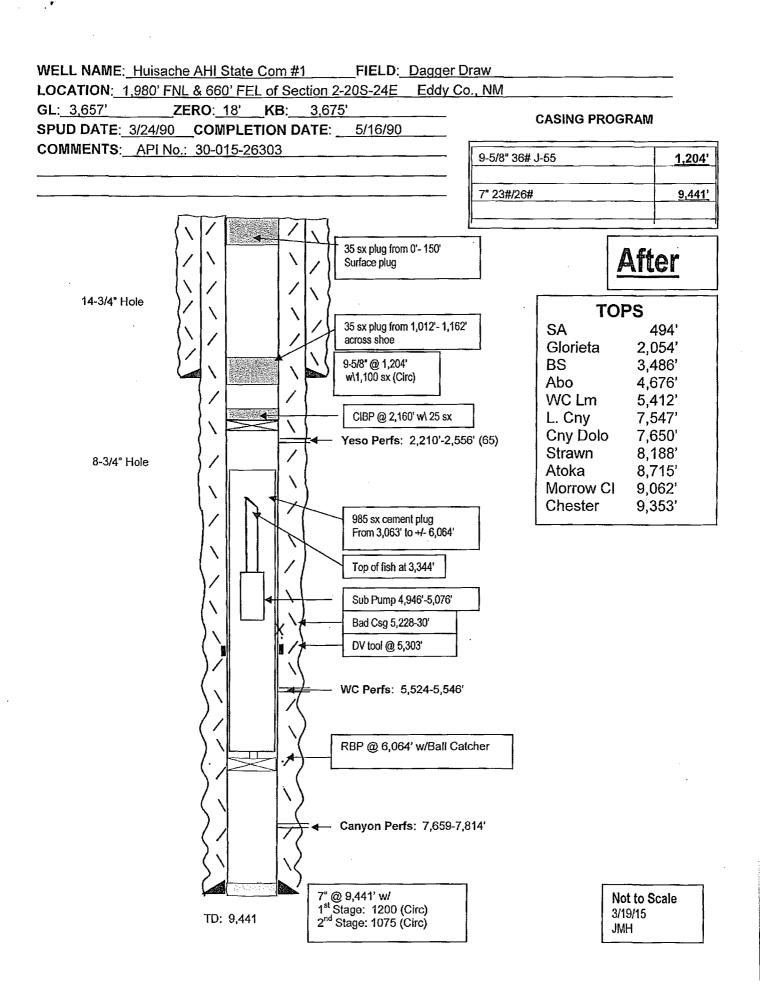

NEW MEXICO OIL CONSERVATION DIVISION DISTRICT 2 OFFICE 811 S. FIRST STREET ARTESIA, NM 88210 (575)748-1283

CONDITIONS OF APPROVAL FOR PLUGGING & ABANDONMENT

Operator: Yates Pet.

Well Name & Number: Husache AHI State #1

API #: 30-015-24303

- 1. Produced water <u>will not</u> be used during any part of the plugging & abandonment operation.
- 2. Notify NMOCD Dist. 2 office at least 24 hrs before beginning work.
- 3. Closed Loop System is to be used for entire plugging operation. Upon completion, contents of steel pit are to be hauled to a permitted disposal location.
- 4. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator, as well as the contractor, to verify that this permit is place prior to performing work. Drivers shall produce a copy upon request of NMOCD Field Inspectors.
- 5. A subsequent C-103 will serve as notification that the well bore has been plugged ONLY. A C-103 FINAL shall be filed before any bonding can be released on the well. Upon receipt of the Final, an inspection will be performed to verify that the location has been satisfactorily cleaned to NMOCD standards.
- 6. If work has not begun within 90 days of the approval of this procedure, an extension request must be filed, stating reason that well has not been plugged.
- 7. Every attempt must be made to clean the well bore out to below the perfs, before any plugs can be set, by whatever means possible.
- 8. Cement Retainers may not be used.
- 9. Squeeze pressures are not to exceed 500 PSI, unless approval is given by NMOCD.
- 10. Plugs may be combined after consulting with and getting approval from NMOCD.
- 11. Minimum WOC time for tag plugs will be 4 Hrs.

DATE: 3 31 2015

APPROVED BY: FROM

GUIDELINES FOR PLUGGING AND ABANDONMENT

DISTRICT II / ARTESIA

- All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater.
- Mud laden fluids must be placed between all cement plugs.
- Mud laden fluids must be mixed at 25 sacks of gel per 100 bbls of water.
- A cement plug is required to be set 50' below and 50' above all casing shoes and casing stub
 plugs. These plugs must be tagged.
- A CIBP with 35' of cement on top may be set in lieu of 100' cement plug.
- A plug as indicated above must be placed within 100' of top perforation. This plug must be tagged.
- Plugs set below and above salt zones must be tagged.
- No more than 2000' is to be allowed between cement plugs in open hole and no more than 3000' in cased hole.
- DV tools are required to have a 100' cement plug set 50' above and below the tool and must be tagged.
- Formations to be isolated with plugs placed at the top of each formation are:
 - o Fusselman
 - o Devonian
 - o Morrow
 - o Wolfcamp
 - o Bone Spring
 - o Delaware
 - Any Salt Section (Plug at top and bottom)
 - o Abo
 - o Glorieta
 - Yates (this plus is usually at base of salt section)
- If cement does not exist behind casing strings at recommended formation depths, the casing must be cut and pulled with plugs set at these depths or casing must be perforated and cement squeezed behind casing at the formation depths.
- In the R-111-P area (Potash Mine area) a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts common to the section penetrated and in suitable proportions, but not more than a 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible (50' below and 50' above).