
Submit 3 Copies To Appropriate District State O	f New Mexico	Form C-103
Office District I Energy, Mineral	s and Natural Resources	Revised June 10, 2003
1625 N. French Dr., Hobbs, NM 88240 District II		WELL API NO.
1301 W. Grand Ave., Artesia, NM 88210 OIL CONSER	VATION DIVISION	30-015-23691 5. Indicate Type of Lease
1000 Pio Brazos Rd. Asten. NM 97410		
District IV Santa I	Fe, NM 87505	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM 87505		·
SUNDRY NOTICES AND REPORTS ON WELLS		7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH		Dale H Parke B Tr B
PROPOSALS.)		8. Well Number
1. Type of Well: Oil Well Gas Well X Other water injection		2
2. Name of Operator		9. OGRID Number
PREMIER OIL & GAS. INC.	afcer a 1000	017985
3. Address of Operator P.O. Box 1246, Artesia, NM 88211-1246	PECETA 1006	10. Pool name or Wildcat Grayburg-Jackson SR, Q,GB,SA
4. Well Location		
Unit Letter K: 1650 feet from the South line and 2310 feet from the West line		
Unit Letter R : 1650 feet from the	South line and 23	10 feet from the West line
Section 15 Township	17S Range 30E	NMPM Eddy County
	hether DR, RKB, RT, GR, etc.)	
12. Check Appropriate Box to I		
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING		
TEMPORARILY ABANDON	COMMENCE DRI	-
PULL OR ALTER CASING MULTIPLE CASING TEST AND		ABANDONMENT
COMPLETION	CEMENT JOB Repair	casing as per failed
OTHER:		ical Integrity Test (7)
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date		
of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion		
or recompletion. 1. TOH with coated tbg & packer		
2. Set RBP @ 2463'.		
3. Repair hole in surface csg @ 10'.		
4. Isolate hole in 5-1/2 csg between 555-586'.		
5. Shot 2 holes @ 562'. 6. Set RBP @ 664' + sand. TIH with packer @ 444'.		
7. Squeezed 300 SXS 2% Premium Plus. Squeezed off. SI pressure 950#.		
8. Tagged cmt @ 472* DO cmt'd to 576'.		
9. Retrieve plugs. TIH with 79 jts of 2-3/8" tubing @ 2463 + Model 81 packer.		
10. Run chart.		
	•	
I hereby certify that the information above is true and complete to the best of my knowledge and belief.		
SIGNATURE Arsalie Jones	TITLE President	DATE 02/24/06
Type or print name Rosalie Jones	E-mail address:	Telephone No.505-748-209
(This space for State use)		FEB 2 7 2006
APPPROVED BY / Jun Juny	Gerry Guye	
Conditions of approval, if any: The puty Field Inspector DATE DATE		
<i>'</i>	District II - Artes	ia

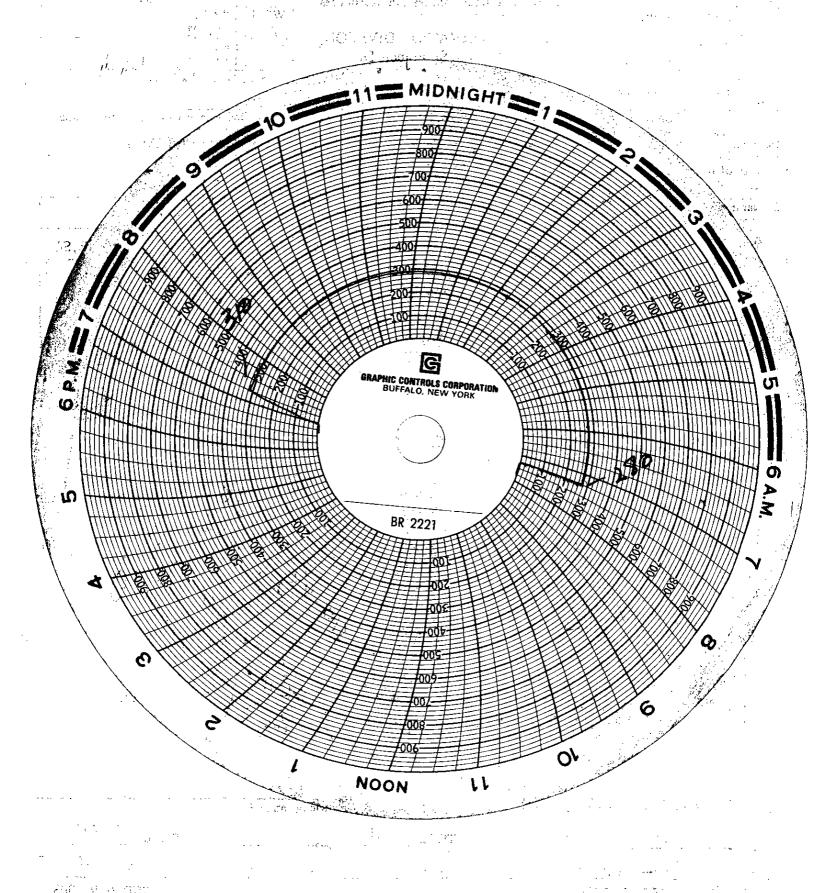

Gerry Gubli Deputy Field Inspector District II - Artesia

Same Land House moundable leaded agreeth weekly is sente Prenty Off Fay Purple BTBT 2-2-06 -015-23691 APIK 30-015

> Gerry Guy Deputy Field Inspector District II - Artesia