Form 3160-5 (August 2007)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

Artesia

FORM APPROVED OMB NO. 1004-0135 Expires: July 31, 2010

5. Lease Serial No.

Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.				MINIMINIOSZTO			
				6. If Indian, Allottee or Tribe Name			
SUBMIT IN TRIPLICATE - Other instructions on reverse side.				7. If Unit or CA/Ag	reement, Name and/or No.		
I. Type of Well ☐ Gas Well ☒ Other: INJECTION					8. Well Name and No. RIGHTHAND CANYON 35 FEDERAL 7		
Name of Operator Contact: DAVID STEWART OXY USA WTP LIMITED PTNRSHIP E-Mail: david_stewart@oxy.com				9. API Well No. 30-015-34529-00-S1			
Ph: 432-68				;)	10. Field and Pool, or Exploratory DEVONIAN		
HOUSTON, TX 77210 Fx: 432-685-5742 4. Location of Well (Footage, Sec., T., R., M., or Survey Description)					11. County or Parish, and State		
Sec 35 T21S R24E NESW 1975FSL 2405FWL					EDDY COUNTY, NM		
12. CHECK APPI	ROPRIATE BOX(ES) T	O INDICATE	NATURE OF	NOTICE, RE	EPORT, OR OTH	ER DATA	
TYPE OF SUBMISSION	F SUBMISSION TYPE OF ACTION						
2 Nation of Intent	☐ Acidize	☐ Dee	pen	☐ Producti	ion (Start/Resume)	■ Water Shut-Off	
Notice of Intent ■ Notice of Intent Not	☐ Alter Casing	☐ Frac	ture Treat	□ Reclama	ation	■ Well Integrity	
☐ Subsequent Report	Casing Repair	☐ Nev	Construction	□ Recomp	lete	Other	
☐ Final Abandonment Notice	☐ Change Plans	🐪 🔀 Pluş	and Abandon	☐ Tempora	arily Abandon		
	. Convert to Injection	Plug	g Back	■ Water D	Disposal	. •	
Attach the Bond under which the worfollowing completion of the involved testing has been completed. Final At determined that the site is ready for ff TD-12000' Openhole-11047' 13-3/8" 54.5# csg @ 1738' w/ 9-5/8" 47# csg @ 11047' w/ 2012 1. RiH & set CIBP @ 10997' 2. M&P 85sx cmt @ 9910-97' 3. M&P 85sx cmt @ 9525-93' 4. M&P 80sx cmt @ 8030-78' 5. M&P 75sx cmt @ 7045-68' 6. M&P 65sx cmt @ 5425-52' 7. M&P 60sx cmt @ 3820-36'	operations. If the operation reandonment Notices shall be final inspection.) 7-12000' 1300sx, DVT @ 590', 17520sx, DVT @ 6991', 12 M&P 45sx cmt 10' WOC-Tag 30' WOC-Tag 75' WOC-Tag 75' WOC-Tag 76' WOC-Tag 80' WOC-Tag	esults in a multip led only after all '-1/2" hole, TO -1/4" hole, TO	e completion or rec requirements, inclu DC-Surf-Circ C-Surf-Circ	completion in a r ding reclamation	ACHED FOR	160-4 shall be filed once d, and the operator has	
 I hereby certify that the foregoing is Con	Fire and correct. Electronic Submission # For OXY USA W Imitted to AFMSS for proc	TP LIMITED P1	NRSHIP, sent to	o the Carlsbac	1	RECEIVED	
Name (Printed/Typed) DAVID STEWART			Title SR. R	EGULATORY	ADVISOR		
Signature (Electronic Submission)			Date 07/19/2	2016			
	THIS SPACE F	OR FEDERA	L OR STATE	OFFICE US	SE		
Approved By () Lubbs			Title E	ng		Date 8/25/16	
Conditions of approval, if any, are attached certify that the applicant holds legal or equivalent to condu- which would entitle the applicant to condu-	itable title to those rights in th	s not warrant or e subject lease	Office CF	<u>-</u> Ø			


Additional data for EC transaction #344992 that would not fit on the form

32. Additional remarks, continued

8. M&P 55sx cmt @ 3035-2905' WOC-Tag 9. M&P 50sx cmt @ 1798-1678' WOC-Tag 10. M&P 50sx cmt @ 640-530' WOC-Tag 11. M&P 110sx cmt @ 250' to surface 10# MLF between plugs Above ground steel tanks will be utilized

Combine Pluss from 1798 - Surface

OXY USA WTP LP - Current Righthand Canyon 35 Federal #7 API No. 30-015-34529 SWD-1022 - SWD Devonian

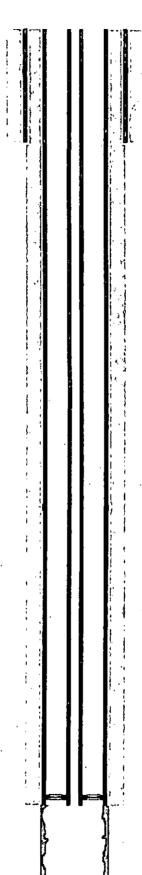

TD-12000'

17-1/2" hole @ 1738' 13-3/8" csg @ 1738' w/ 1300sx-TOC-Surf-Circ DVT @ 590'

12-1/4" hole @ 11047' 9-5/8" csg @ 11047' w/ 2520sx-TOC-Surf-Circ DVT @ 6991'

7" tbg/csg & pkr @ 10998'

8-1/2 OH @ 11047-12000'

OXY USA WTP LP - Proposed Righthand Canyon 35 Federal #7 API No. 30-015-34529 SWD-1022 - SWD Devonian	1 Morst	
110sx @ 250'-\$urface		17-1/2" hole @ 1738'
50sx @ 640-530' WOC-Tag	mbine Blugs	13-3/8" csg @ 1738' w/ 1300sx-TOC-Surf-Circ DVT @ 590'
50sx @ 1798-1678' WOC-Tag		
		•
55sx @ 3035-2905' WOC-Tag		
60sx @ 3820-3680' WOC-Tag		
65sx @ 5425-5270' WOC-Tag		
75sx @ 7045-6875' WOC-Tag		CO PULIA
805x @ 7490-7320'		wce 7440
80sx @ 8030-7850' WOC-Tag		
85sx @ 9525-9330' WOC-Tag		
85sx @ 9910-9710' WOC-Tag	Later Add	12-1/4" hole @ 11047' 9-5/8" csg @ 11047'
CIBP @ 10997' w/ 45sx		w/ 2520sx-TOC-Surf-Circ DVT @ 6991'
		8-1/2 OH @ 11047-12000'
٠.	TD-12000	

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.