			RECEIVED					
	UNITED STATES PARTMENT OF THE INTERIOR JREAU OF LAND MANAGEMENT SEPODATESIA			FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018				
	5. Lease Serial No. NMNM59035							
SUNDRY Do not use thi abandoned wel	6. If Indian, Allottee or Tribe Name							
SUBMIT IN 1	7. If Unit or CA/Agreement, Name and/or No.							
1. Type of Well			8. Well Name and No. RED LAKE FEDERAL 1					
2. Name of Operator Contact: KENNETH A PRESTON ROVER OPERATING LLC E-Mail: kpreston@roverpetro.com					9. API Well No. 30-015-26176-00-S1			
3a. Address 17304 PRESTON ROAD SUIT DALLAS, TX 75252	3b. Phone No. (include area code) Ph: 214-234-9115			10. Field and Pool or Exploratory Area RED LAKE UNKNOWN				
4. Location of Well (Footage, Sec., T)			11. County or Parish, State				
Sec 10 T17S R28E NESW 19 32.847181 N Lat, 104.167208				EDDY COUNTY, NM				
12. CHECK THE AP	PROPRIATE BOX(ES)	TO INDICA	TE NATURE O	F NOTICE,	REPORT, OR OTH	ER DATA		
TYPE OF SUBMISSION								
Notice of Intent	Notice of Intent		pen	Product	tion (Start/Resume)	□ Water Shut-Off		
Subsequent Report	☐ Alter Casing		Iraulic Fracturing	C Reclam		Well Integrity		
	Casing Repair	-	v Construction	Recomplete		Other		
Final Abandonment Notice	Change Plans Convert to Injection	— ·	🛛 Plug and Abandon 🗖 Plug Back		rarily Abandon Disposal			
Wellbore Details: 8-5/8" 24# casing set at 502', 4-1/2" 10.5# casing set at 211 Queen / Grayburg / San Andre Cast Iron Bridge Plug at 1230 Bowers perfs at 893' - 1169' Cast Iron Bridge Plug at 800' Seven Rivers perfs at 715' - 7 Procedure: R un in with bit & tag CIBP @- TI LI open-ended & spot 20 sx	cmt to surfac Dr.: CI Ba Se	:11 out CIBP@ 800'. RIH Tag BP@ 1230. Cap w/ 35'cmt, Dump						
14. I hereby certify that the foregoing is	true and correct					NTEREM		
14. I hereby certify that the foregoing is true and correct. Electronic Submission #422619 verified by the BLM Well Information System For ROVER OPERATING LLC, sent to the Carlsbad Committed to AFMSS for processing by PRISCILLA PEREZ on 06/05/2018 (18PP1889SE) Name (Printed/Typed) BRADY WILTON Title ENGINEER								
Simatura (Electronic	Date 06/05/2019							
Signature (Electronic Submission) Date 06/05/2018 THIS SPACE FOR FEDERAL OR STATE OFFICE USE								
/	00		1		11-5	8-18-78		
Approved By Conditions of approval, if any, are attached	Title Super. PE/ Date							
certify that the applicant holds legal or equivine which would entitle the applicant to conduct the transformation of the 42	ict operations thereon.		Office	share	A department or	agency of the United		
Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent	statements or representations a	s to any matter w	vithin its jurisdiction.	winnuny to m				
(Instructions on page 2) ** BLM REV	ISED ** BLM REVISE	D ** BLM R	EVISED ** BLN SFF	ATTA	d ** blm revise CHED FOR	D **		
					ONS OF APP	ROVAL		
				INDITIC				

.

•

Additional data for EC transaction #422619 that would not fit on the form

.

¢

32. Additional remarks, continued


.

•

•

Tag cmt at +/ 500' Spot cmt at 150' & fill wellbore to surface with cmt Cut off wellhead, remove surface unit, & install ground level dry hole marker

ROVER PETROLEUM, LLC WELLBORE DIAGRAM

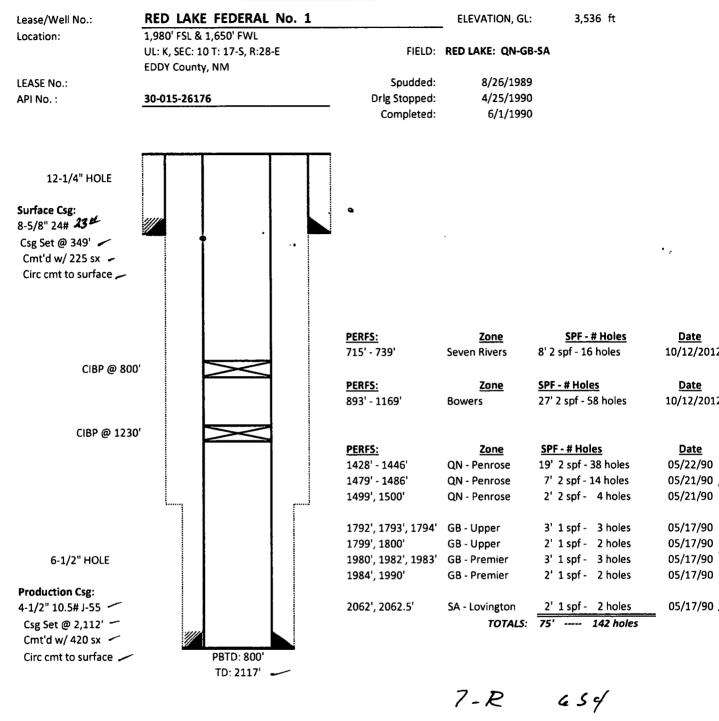

1420

1632

1994

Qu 1182

U pen

GB

SA

ROVER PETROLEUM, LLC WELLBORE DIAGRAM

Lease/Well No.:	RED LAKE FEDERAL No. 1		_		
Location:	1,980' FSL & 1,650' FWL		FIELD: RED LAKE: QN-GB-SA		
	UL: K, SEC: 10 T: 17-S, R:28-E EDDY County, NM		KED LAKE: QIN-0	3 D- 3A	
API No. :	30-015-26176	Spudded:	8/26/1989)	
		Drlg Stopped:	4/25/1990		
		Completed:	6/1/1990		
12-1/4" HOLE					
	PLUG 4				
Surface Csg:	,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,				
8-5/8" 24# Csg Set @ 349'					
Cmt'd w/ 225 sx	MUD				
Circ cmt to surface	WIGE				
	PLUG 3				
		<u>PERFS:</u>	<u>Zone</u>	SPF - # Holes	Date
		715' - 739'	Seven Rivers	8' 2 spf - 16 holes	10/12/2012
PLUG 2: CIBP @ 800					
		PERFS:	Zone	SPF - # Holes	Date
		893' - 1169'	Bowers	27' 2 spf - 58 holes	10/12/2012
PLUG 1: CIBP @ 1230		PERFS:	Zone	<u>SPF - # Holes</u>	Date
		1428' - 1446'	QN - Penrose	19' 2 spf - 38 holes	05/22/90
		1479' - 1486'	QN - Penrose	7' 2 spf - 14 holes	05/21/90
		1499', 1500'	QN - Penrose	2' 2 spf - 4 holes	05/21/90
		•			
		1792', 1793', 1794'	GB - Upper	3' 1 spf - 3 holes	05/17/90
		1799', 1800'	GB - Upper	2' 1 spf - 2 holes	05/17/90
6-1/2" HOLE		1980', 1982', 1983'		3' 1 spf - 3 holes	05/17/90
		1984', 1990'	GB - Premier	2' 1 spf - 2 holes	05/17/90
Production Csg: 4-1/2" 10.5# J-55		2062', 2062.5'	SA - Lovington	2'1 spf - 2 holes	05/17/90
4-1/2 10.5# J-55 Csg Set @ 2,112'		2002,2002.3	TOTALS:		03/17/50
Csg Set @ 2,112 Cmt'd w/ 420 sx			IUIALS:	, 3 142 11018\$	
Circ cmt to surface	PBTD: 800'				
Sinc child burlace	TD: 2117'				

•

•

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

. .

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement</u>: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.