
RECEIVED

Form 3160-5 (June 2015)	DE BI SUNDRY Do not use thi	fæsia . o.c.d.	FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018 5. Lease Serial No. NMNM81622 6. If Indian, Allottee or Tribe Name						
		II. Use form 3160-3 (AP	· · · · · ·				ment, Name and/or No.		
	🖸 Gas Well 📋 Oth	8. Well Name and No. GOLD RUSH 30 FEDERAL 4							
 Name of Opera DEVON EN 	Itor ERGY PRODUCT		9. API Well No. 30-015-28872-00-S1						
3a. Address 6488 SEVEI ARTESIA, N	N RIVERS HIGHW IM 88211	3b. Phone N Ph: 580-3	o. (include area code) 02-4593	;	10. Field and Pool or Exploratory Area NASH DRAW				
4. Location of We	ell (Footage, Sec., T.	C, R., M., or Survey Description		11. County or Parish, State					
Sec 30 T23	S R30E NESE 250	IOFSL 660FEL		EDDY COUNTY, NM					
12.	CHECK THE AP	PPROPRIATE BOX(ES)	TO INDICA	TE NATURE O	F NOTICE,	REPORT, OR OTH	IER DATA		
TYPE OF SUBMISSION TYPE OF ACTION									
Notice of I	ntent	Acidize	🖸 Dec	epen	Product	ion (Start/Resume)	UWater Shut-Off		
		Alter Casing	🗖 Hy	draulic Fracturing	🗖 Reclam	ation	Well Integrity		
Subsequen		Casing Repair	-	w Construction	🗖 Recomp		Other		
🗖 Final Abar	donment Notice	Change Plans	_	g and Abandon		Temporarily Abandon			
		Convert to Injection		g Back	ck Uwater Disposal estimated starting date of any proposed work and approximate duration				
If the proposal Attach the Bon following comp testing has been	is to deepen directiona d under which the wor pletion of the involved n completed. Final Ab	ally or recomplete horizontally, will be performed or provide operations. If the operation re bandonment Notices must be fil	give subsurface the Bond No. c sults in a multip led only after all	e locations and measure on file with BLM/BIA ole completion or reco requirements, include	red and true ve . Required su mpletion in a p ing reclamatio	ertical depths of all pertin bsequent reports must be new interval, a Form 316 n, have been completed a	ent markers and zones. filed within 30 days 0-4 must be filed once nd the operator has		
8. Perf at 14 9. Pump 85 10. Cut WH	0'. Soz c sx CI C in/out 140 off 3' BGL Set dr NTERE	18#8208; surface. bole marker. Accepted for m		~ 	EE ATI	T/salt) FACHED FO IONS OF AF	R		
14. I hereby certif	y that the foregoing is Commi	true and correct. Electronic Submission # For DEVON ENERG itted to AFMSS for process	Y PRODUCTIO	IN COMPAN, sent	to the Carls	sbad			
Name (Printed/	Typed) MAX LUBI	TZ	<u></u>						
Signature	(Electronic S	ubmission)		Date 08/20/2018					
		THIS SPACE FO		AL OR STATE (SE			
_Approved By	fame	C. Com	P	Title Suy	av. AE	7	8-26- /8 Date		
certify that the apple which would entitle	cant holds legal or equ the applicant to condu-		e subject lease	Office Car		I field D			
Title 18 U.S.C. Secti States any false, fig	on 1001 and Title 43 l ctitious or fraudulent s	U.S.C. Section 1212, make it a tatements or representations as	crime for any p to any matter w	erson knowingly and vithin its jurisdiction.	willfully to ma	ake to any department or	agency of the United		
(Instructions on page	** BLM REVI	SED ** BLM REVISE) ** BLM R	EVISED ** BLM	REVISED) ** BLM REVISE) **		

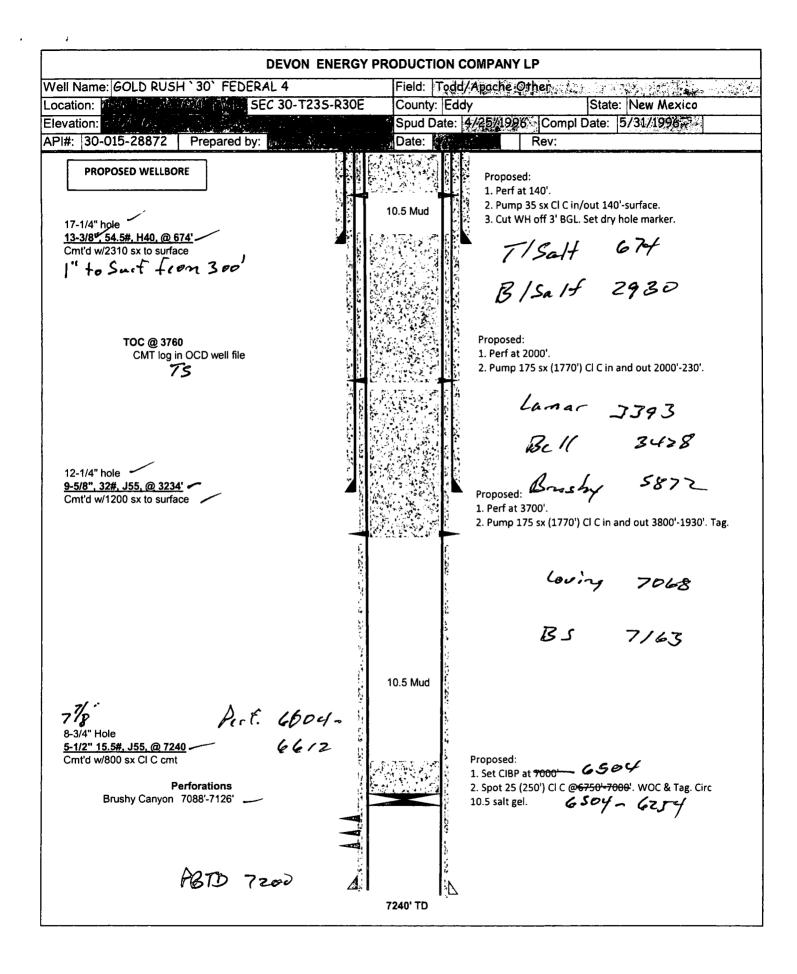

		DEV	ON ENERGY PI	RODUCI		IPANY LP			
Well Name: GOLD RUSH ` 30` FEDERAL 4					Todd/Ap	adhe Other .	ther.		
Location: 660, FML & 4650 FML SEC 30-T235-R30E				Count	y: Eddy	State: New Mexico			
Elevation: 61.04 61		and a second				21996* Compl Date: 5/31/1996			
API#:	30-015-28872	Prepared by:		Date:	72078	Rev:			
<u>13</u>	CURRENT WELLBOR -1/4" hole -3/8", 54.5#, H40, @ 6 nt'd w/2310 sx to surfac TOC @ 3760	<u>74'</u> 2e							
9-5	-1/4" hole 5 <mark>/8", 32#, J55, @ 3234</mark> 1t'd w/1200 sx to surfac								
			کوالیایا ۲۰۱۰ ماندگاروندا ^م اند ایکوالیا		and the state state state of the				
<u>5-1</u>	/4" Hole / <u>2" 15.5#, J55, @ 724</u> nt'd w/800 sx Cl C cmt Pe Brushy Canyon	rforations			ne and the second contract of the second	TAC @ 6832' SN @ 6923 BULL PLUG @ 7000' MIXED STRING OF 1", 7/8" 3/4" RODS TO 69	923'		

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>minety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged</u>.

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.