Form \$160-5 (June 2015) UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT OCD Artesia SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.						FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018 5. Lease Serial No. NMLC061705B 6. If Indian, Allottee or Tribe Name		
SUBMIT IN TRIPLICATE - Other instructions on page 2						<ol> <li>If Unit or CA/Agreement, Name and/or No. NMNM71016F</li> </ol>		
1. Type of Well Gas Well Other					8. Well Name and No. POKER LAKE UNIT 85			
2. Name of Operator BOPCO LP	2. Name of Operator Contact: TRACIE C						9. API Well No. 30-015-27911	
3a. Address 6401 HOLIDAY H MIDLAND, TX 7	3b. Phone No. (include area code). Ph: N432-221_737912011000000000000000000000000000000000			10. Field and Pool or Exploratory Area POKER LAKE;DELAWARE;SW				
	4. Location of Well (Footage, Sec., T., R., M., or Survey Description)				11. County or Parish, State			
Sec 25 T24S R30E Mer NMP SENE 1930FNL 710FEL			JAN 3 1 2019			EDDY COUNTY, NM		
12. CHI	ECK THE AF	PROPRIATE BOX(ES)	TO INDICA	<b>RECEIVED</b> TE NATURE O	F NOTICE,	REPORT, OR OTH	IER D	ΑΤΑ
TYPE OF SUBM	IISSION		TYPE OF ACTION					
□ Notice of Intent		Acidize	🖸 Dee	pen	Product	tion (Start/Resume)	٥v	Vater Shut-Off
_		Alter Casing	🗖 Hyd	raulic Fracturing	🗖 Reclam	ation 🖸 Well		Vell Integrity
🛛 Subsequent Rep	oort	Casing Repair	🗖 Nev	Construction	C Recom	plete	. <b>D</b> C	Other
Final Abandonment Notice		Change Plans	🛛 Plug	g and Abandon		Temporarily Abandon		
	Convert to Injection				U Water Disposal			
Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection. BOPCO, LP respectfully submits this sundry notice to report the plug and abandonment of the referenced well. 08/31/18 - 09/06/18 MIRU plugging equipment. POOH w/rods. ND wellhead, install BOP. FT/PT 1000/300 psi (good). TOH w/tubing, pump and remainder of rods. RIH w/tbg, tag PBTD @ 8070'. Spot 35 sx 'H' cmt on top, 8070'-7847'. 09/07/18								
Tag cmt @ 7819'. Set 5.5" CIBP @ 6240'. Tag to verify. PT to 500 psi (gr mud, spot 25 sx 'C' 6240-5993'. SDWE Accepted for record					dia RECL		AMATION <u>3-1/-19</u>	
14. I hereby certify that	t the foregoing is	Electronic Submission #	450370 verifie 3OPCO LP, se	d by the BLM We ent to the Carlsba	ll Informatio d	n System		
Name (Printed/Typed) TRACIE CHERRY								
Signature (Electronic Submission)				Date 01/14/2019				
Accepted to	Recor		DR FEDER	L OR STATE	OFFICE U	SE		
	fame	. a. amos		Title SP	ET.	<u></u>		1-18-19 Date
Conditions of approval in certify that the applicant h which would entitle the ap	Office CA	0						
		U.S.C. Section 1212, make it a statements or representations as			willfully to m	ake to any department or	agency	of the United
(Instructions on page 2)	** OPERAT	OR-SUBMITTED ** O	PERATOR	SUBMITTED *		TOR-SUBMITTED		· · · · · · · · · · · · · · · · · · ·

C	NTERE	D
	M 2-5-19	U
		_

## Additional data for EC transaction #450370 that would not fit on the form

## 32. Additional remarks, continued

09/10/18

Tag cmt @ 6000'. PUH spot 30 sx 'C' 5610'-5313'. WOC 4 hrs, tag @ 5295'. PUH, spot 35 sx 'C' 4200'-3850'.

09/11/18


Tag cmt @ 3845'. PUH to 3000', spot 25 sx 3000'-2850'. RIH w/pkr, set @ 509'. Perf sqz holes @ 950'. Sqz 60 sx 'C' 950'-550'.

09/11/18 Tag cmt @ 693'. ND BOP. Perf sgz holes @ 60'. Sgz 25 sx 'C' to surface. Verified cmt to surface.

11/02/18

Cut off wellhead. Install marker, Well P&A?d.

All tags verified by BLM

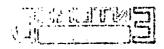



## **United States Department of the Interior**

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

## **Reclamation Objectives and Procedures**

**Reclamation Objective:** Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Appropriate time for submittal would be when filing the Vell Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you

have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech 575-234-5909, 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crystal Weaver Environmental Protection Specialist 575-234-5943

Trishia Bad Bear, Hobbs Field Station Natural Resource Specialist 575-393-3612