


UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS
Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

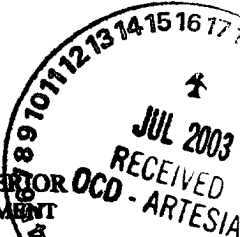

~~THE HFO~~
NMOC-D-HOBBS

FORM APPROVED
OMB No. 1004-0135
Expires January 31, 2004

5. Lease Serial No.
NM 32636

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No.

AMOCO "11" FEDERAL

8. Well Name and No.

4

9. API Well No.

30-015-26495

10. Field and Pool, or Exploratory Area

E. LOVING (BRUSHY CANYON)

11. County or Parish, State

EDDY CO., NM

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

PM ENERGY, INC.

3a. Address

5100 E. SPERRY DR., TULSA, OK 74155

3b. Phone No. (include area code)

(918) 663-2800

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

**1950' PSL & 1051' FEL
SEC. 11-235-28E**

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION		
☒ Notice of Intent	☒ Acidize	☐ Deepen	☐ Production (Start/Resume)
☐ Subsequent Report	☐ Alter Casing	☒ Fracture Treat	☐ Reclamation
☐ Final Abandonment Notice	☐ Casing Repair	☐ New Construction	☒ Recomplete
	☐ Change Plans	☐ Plug and Abandon	☐ Temporarily Abandon
	☐ Convert to Injection	☒ Plug Back	☐ Water Disposal
			☐ Water Shut-Off
			☐ Well Integrity
			☐ Other

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

START RECOMPLETION WEEK OF JULY 14, 2003

A.) MIRM WSL. NO WH & NM ROPE. PULL PDS & PUMP. RELEASE TAC & TCH W/TBG. RUN EWL TRUCK. RUN GR/JB TO 6100'. RUN & SET A CIPP AT 600'. TEST CSG TO 2400 PSIG. PERF U. BRUSHY CANYON FROM 4738' TO 4802' OVERALL W/4" CSG GUN, 100 HOLES.

B.) ACIDIZE PERFS W/2000 GAL 7 1/2% HCL ACID & 150 BS. SWAB LOAD BACK & TEST. FRAC TREAT W/4000 GAL X-L GEL & 113,000# 16/30 SD & 4400# 16/30 PD SD. PFR & TBG WERE RAN BEFORE ACIDIZING. SWAB & FLOW LOAD BACK. PFR APPROVED PRODUCTION.

14. I hereby certify that the foregoing is true and correct

Name (Printed/Typed)

MIKE KAISER

Title

OP ENGR

Signature

Mike Kaiser

Date

07/07/03

JUL - 7 2003

**GARY GOURLEY
PETROLEUM ENGINEER**

Approved by

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Title

Date

Office

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on reverse)