	(June 2015) UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.				FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018 5. Lease Serial No. NMNM7066 6. If Indian, Allottee or Tribe Name		
•							
	SUBMIT IN TRIPLICATE - Other instructions on page 2				 If Unit or CA/Agreement, Name and/or No SRM1280 		
]	1. Type of Well ☐ Other ☐ Other				8. Well Name and No. WILLIAMSON 1		
2	2. Name of Operator Contact: NATALIE L BEAVERS DEVON ENERGY PRODUCTION COME-Mail: NATALIE.BEAVERS@DVN.COM				9. API Well No. 30-015-22588-00-S1		
3	3a. Address 333 WEST SHERIDAN AVEN OKLAHOMA, OK 73102	3b. Phone No. (include area code) Ph: 405-552-3573		10. Field and Pool or Exploratory Area DIAMOND MOUND			
	4. Location of Well (Footage, Sec., T.)		11. County or Parish,	State		
	Sec 12 T16S R27E NENW 66			EDDY COUNTY	Υ, NM		
	12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA						
	TYPE OF SUBMISSION	· · · · · · · · · · · · · · · · · · ·	TYPE O	F ACTION	۸		
	□ Notice of Intent	🗖 Acidize	Deepen	Product	on (Start/Resume)	Uwater Shut-Of	
	_	Alter Casing	Hydraulic Fracturing	🗖 Reclama	ation	🗖 Well Integrity	
	Subsequent Report	Casing Repair	New Construction	🗖 Recomp	lete	🗖 Other	
	Final Abandonment Notice	Change Plans	🛛 Plug and Abandon	Tempor	arily Abandon		
		Convert to Injection	🗖 Plug Back	🗖 Water D	visposal		
	 06/07/19 Notify BLM of intent. 06/10/19 Notify BLM of not being able to release pkr. Ok'd to come off on/off tool. Top @ 8842'. Set 4 1/2" CIBP @ 8840'. 06/11/19 Verify 4 1/2" CIBP @ 8840' w/2 3/8" tbg. Circ 140 bbl MLE. Test well 500 psi. Good. Spot 25 sx class H cmt 8840'-8640' Spot 25 sx class H cmt @ 8200'-8020'. Spot 25 sx class C cmt @ 6406-6236'. Spot 25 sx class C cmt @ 5150'-5000. 06/12/19 Spot 25 sx class C cmt @ 3050'-2920'. Spot 25 sx class C cmt @ 1650'-1540' Tag TOC @ 1302'. Spot 25 sx class C cmt @ 400'-300. Tag TOC @ 285'. 06/13/19 Perf/press up @ 140' Notify BLM Spot/fill up 25 sx class C cmt @ 285' surf. Verify cmt @ surf. 06/014/19 RD P&A equipment, cut wellhead, anchors and cleaned location, installed dry hole plate. P&A completed. 					TACHED	
*	4. 06/12/19 Spot 25 sx_clas 1650'-1540', Tag_TOC_@ 13 5. 06/13/19 Perf/press_up_@ 285'-surf_Verify_cmt_@_surf.	302'_Spot_25_sx_class()_140'_Notify_BLM_Spot	ot/fill up 25 sx class C cmt	<u>t</u> @			
₩-	4. 06/12/19 Spot 25 sx clas 1650'-1540' Tag TOC @ 13 5 06/13/19) Perf/press up @ 285'-surf. Verify cmt @ surf. 6. 06/14/19 RD P&A equipm hole plate. P&A completed.	302'. Spo <u>t 25 sx class (</u> <u>140' Notify BLM</u> Spot hent, cut wellhead, and	ot/fill up 25 sx class C cmt	<u>t</u> @		12-13-19	
*	4. 06/12/19 Spot 25 sx clas 1650-1540; Tag_TOC @ 13 5. 06/13/19 Per/press up @ 2851-surf. Verify cmt @ surf. 6. 06/14/19 RD P&A equipm hole plate. P&A completed. 14. I hereby certify that the foregoing is Comm	302'. Spot 25 sx class () 140' Notify BLM Spot hent, cut wellhead, anci true and correct. Electronic Submission # For DEVON ENERG hitted to AFMSS for proces	ot/fill_up_25_sx_class_C_cmt hors and cleaned location, 470504 verified by the BLM We Y PRODUCTION COM LP, sent ssing by DEBORAH MCKINNEY	t @ installed dry Il Information t to the Carls on 06/25/201	System System 9 (19JA0928SE)	12- 13- 19 FOR RECO	
	 4. 06/12/19 Spot 25 sx class 1650'-1540' Tag. TOC @ 13 5. 06/13/19 Per/press up @ 285'-surf. Verify cmt @ surf. 6. 06/14/19 RD P&A equipm hole plate. P&A completed. 14. I hereby certify that the foregoing is 	302'. Spot 25 sx class () 140' Notify BLM Spot hent, cut wellhead, anci true and correct. Electronic Submission # For DEVON ENERG hitted to AFMSS for proces	ot/fill_up_25_sx_class_C_cmt hors and cleaned location, 470504 verified by the BLM We Y PRODUCTION COM LP, sent ssing by DEBORAH MCKINNEY	t @ installed dry Il Information t to the Carls on 06/25/201	ACCEPTED	12- 13- 19 FOR RECO	
*	4. 06/12/19 Spot 25 sx clas 1650-1540; Tag_TOC @ 13 5. 06/13/19 Per/press up @ 2851-surf. Verify cmt @ surf. 6. 06/14/19 RD P&A equipm hole plate. P&A completed. 14. I hereby certify that the foregoing is Comm	302'. Spot 25 sx class () 140' Notify BLM Spot hent, cut wellhead, and true and correct. Electronic Submission # For DEVON ENERG hitted to AFMSS for proces L BEAVERS	ot/fill_up_25_sx_class_C_cmt hors and cleaned location, 470504 verified by the BLM We Y PRODUCTION COM LP, sent ssing by DEBORAH MCKINNEY	t_@ installed dry Il Information t to the Carlsl Y on 06/25/201 JCTION TEC	ACCEPTED System 9 (19JA0928SE) CHNOLOBISTJUN	2 6 2019	
*	4. 06/12/19 Spot 25 sx clas 1650-1540, Tag_TOC @ 13 5. 06/13/19 Per/press up @ 2851-surf. Verify cmt @ surf. 6. 06/14/19 RD P&A equipm hole plate. P&A completed. 14. I hereby certify that the foregoing is Comm Name (Printed/Typed) NATALIE I	302'. Spot 25 sx class () 140' Notify BLM_ Spot hent, cut wellhead, and true and correct. Electronic Submission # For DEVON ENERG hitted to AFMSS for proces L BEAVERS ubmission)	ot/fill_up_25_sx_class_C_cmt hors and cleaned location, 470504 verified by the BLM We Y PRODUCTION COM LP, sent ssing by DEBORAH MCKINNEY Title PRODU	installed dry II Information t to the Carlsl On 06/25/201 JCTION TEC 2019	ACCEPTED System 9 (19JA0028SE) HNOLOGISTJUN BUREAU OF	2 6 2019	
	4. 06/12/19 Spot 25 sx clas 1650-1540, Tag_TOC @ 13 5. 06/13/19 Per/press up @ 2851-surf. Verify cmt @ surf. 6. 06/14/19 RD P&A equipm hole plate. P&A completed. 14. I hereby certify that the foregoing is Comm Name (Printed/Typed) NATALIE I	302'. Spot 25 sx class () 140' Notify BLM_ Spot hent, cut wellhead, and true and correct. Electronic Submission # For DEVON ENERG hitted to AFMSS for proces L BEAVERS ubmission)	470504 verified by the BLM We SY PRODUCTION COM LP, sent ssing by DEBORAH MCKINNEY Title PRODU Date 06/25/2	installed dry II Information t to the Carlsl On 06/25/201 JCTION TEC 2019	ACCEPTED System 9 (19JA0028SE) HNOLOGISTJUN BUREAU OF	2 6 2019	
	4. 06/12/19 Spot 25 sx clas <u>1650'-1540'</u> Tag_TOC_@_13 <u>5. 06/13/19</u> Per/ <u>press up @</u> <u>285'-surf. Verify cmt @ surf.</u> 6. 06/14/19 RD P&A equipm hole plate. P&A completed. 14. I hereby certify that the foregoing is Comm Name (<i>Printed/Typed</i>) NATALIE I Signature (Electronic S	302'. Spot 25 sx class (140' Notify BLM_Spot fent, cut wellhead, and true and correct. Electronic Submission # For DEVON ENERG aitted to AFMSS for process BEAVERS ubmission) THIS SPACE FO	470504 verified by the BLM We Y PRODUCTION COM LP, sent ssing by DEBORAH MCKINNEY Title PRODU Date 06/25/2 DR FEDERAL OR STATE	installed dry II Information t to the Carlsl On 06/25/201 JCTION TEC 2019	ACCEPTED System 9 (19JA0028SE) HNOLOGISTJUN BUREAU OF	12-13-19 FOR RECO 2 6 2019 AND MANAGEMEN D FIELD OFFICE	


RN 10-25-19



Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm

Take Pride

MERICA

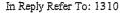

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- 1 The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you

have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech 575-234-5909, 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crystal Weaver Environmental Protection Specialist 575-234-5943

Melissa Horn Environmental Protection Specialist 575-234-5951

Kelsey Wade Evnironmental Protection Specialist 575-234-5996

Trishia Bad Bear, Hobbs Field Station Natural Resource Specialist 575-393-3612