Form 3160-5 (June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD Artesia

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018


OMB	NO. 1004-0137
Expires	: January 31, 201
5. Lease Serial No.	
NMNM19423	

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an

6 If Indian Allaman Taile Name

abandoned well. Use form 3160-3 (APD) for such proposals.					, , in mulan, Anottee of The Name			
SUBMIT IN TRIPLICATE - Other instructions on page 2				7. If Unit or CA/Agreement, Name and/or No. NMNM135010				
1. Type of Well					8. Well Name and No. PINTAIL 23 FEDERAL COM 5Y			
Ø Oil Well					9. API Well No.			
CIMAREX ENERGY COMPANY OF CO-Mail: DEYLER@MILAGRO-RES.COM			30-015-37097-00-S1					
3a. Address 600 N MARIENFELD STE 600 MIDLAND, TX 79701 3b. Phone No. (inc Ph: 432-687-3)					10. Field and Pool or Exploratory Area COTTONWOOD DRAW			
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)			11. County or Parish, State					
Sec 23 T25S R26E SWNW 1310FNL 740FWL					EDDY COUNTY, NM			
12. CHECK THE AF	PPROPRIATE BOX(ES)	TO INDICA	ΓE NATURE O	F NOTICE,	REPORT, OR OTH	ER DA	TA	
TYPE OF SUBMISSION	TYPE OF ACTION							
■ Notice of Intent	☐ Acidize	☐ Deep	oen	☐ Product	ion (Start/Resume)	□ Wa	er Shut-Off	
Alter Casing		☐ Hyd	raulic Fracturing	☐ Reclamation		■ Well Integrity		
☐ Subsequent Report	sequent Report		Construction	☐ Recomp	olete	Oth	er	
☐ Final Abandonment Notice	Change Plans	🛛 Plug	and Abandon	□ Tempor	arily Abandon			
	☐ Convert to Injection	Plug	Back	☐ Water I	Disposal			
Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection. 1) SET 5-1/2" CIBP @ 2,650'; PUMP 25 SXS.CMT. @ 2,650'-2,530'; CIRC. WELL W/ MLF. 2) PUMP 45 SXS.CMT. @ 1,944'-1,643'(T/DLWR., B/SALT); WOC X TAG CMT. PLUG. 3) PUMP 25 SXS.CMT. @ 1,092'-982'(T/SALT); WOC X TAG CMT. PLUG. 4) MIX X CIRC. TO SURF. 60 SXS.CMT. @ 491'-3'(8-5/8" CSG.SHOE). 5) DIG OUT X CUT OFF WELLHEAD 3' B.G.L.; WELD ON STEEL PLATE TO CSGS. X INSTALL DRY HOLE MARKER. DURING THIS PROCEDURE WE PLAN TO USE THE CLOSED-LOOP SYSTEM W/ A STEEL PLATE AND HAUL CONTENTS TO THE REQUIRED DISPOSAL, PER OCD RULE 19.15.17. SEE ATTACHED FOR CONDITIONS OF APPROVAL								
Accepted for regord Minutes				\mathcal{C}	CONDITIONS OF APPROVAL			
NOV/0 5 2019								
14. I hereby certify that the foregoing is Commi Name (Printed/Typed) DAVID A B	# Electronic Submission For CIMAREX ENE itted to AFMSS for proces	ERGY COMPA	IY OF CO, sent to	o the Carlsb	ad			
Signature (Electronic S	Submission)		Date 10/23/20	019				
THIS SPACE FOR FEDERAL OR STATE OFFICE USE								
Approved By fame	a.C. ano	? ·	Title SC	IET			11-1-19 ate	
Conditions of approval, if any, are attached certify that the applicant holds legal or equivalent would entitle the applicant to condu	uitable title to those rights in the		Office 24	0				
Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent				willfully to m	ake to any department or	agency of	the United	

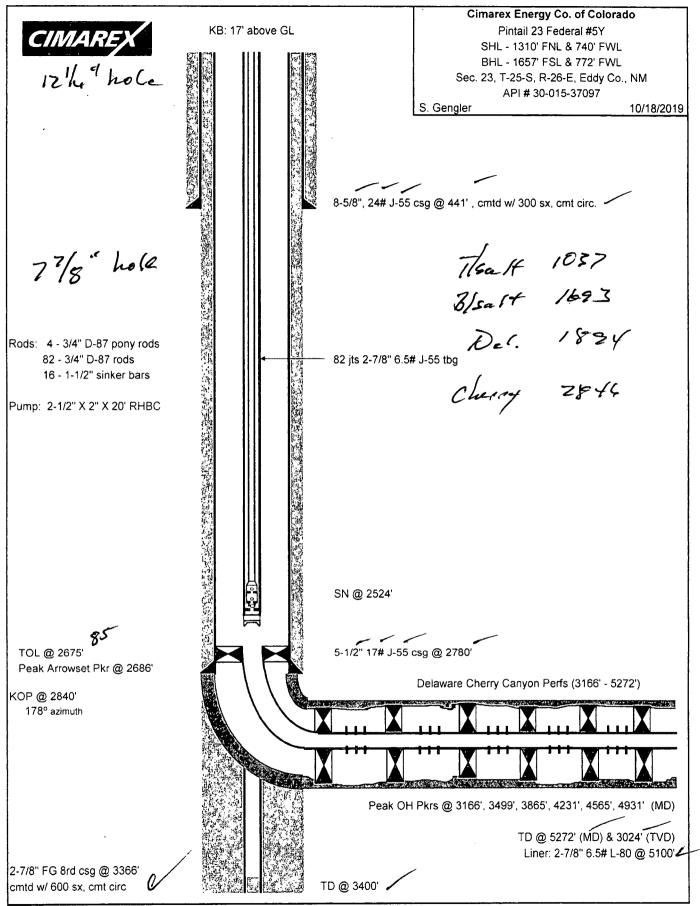



T/SAT- 1,037' B/SAIT-1,693' T/DLWP.-1,894' T/C.C.-2,846' KB: 17' above GL

Cimarex Energy Co. of Colorado

Pintail 23 Federal #5Y SHL - 1310' FNL & 740' FWL

BHL - 1657' FSL & 772' FWL

Sec. 23, T-25-S, R-26-E, Eddy Co., NM API # 30-015-37097

S. Gengler

10/18/2019

CIRC. 60 SXS. 0 491 - 3'

8-5/8", 24# J-55 csg @ 441', cmtd w/ 300 sx, cmt circ.

- Pemp 25 5x5.00/,092'-982'-MG

Pump 45 sx = 01,944'-1,643'-TAG.

Pump 25 SXS . 0 2,650'-2,530' - SET 5 1/2" CD3 PC 2, 650 '.
5-1/2" 17# J-55 csg @ 2780'

Delaware Cherry Canyon Perfs (3166' - 5272')

Peak OH Pkrs @ 3166', 3499', 3865', 4231', 4565', 4931' (MD)

TD @ 5272' (MD) & 3024' (TVD)

Liner: 2-7/8" 6.5# L-80 @ 5100'

TD @ 3400'

ARE 10/22/19

TOL @ 2675' Peak Arrowset Pkr @ 2686'

KOP @ 2840' 178° azimuth

2-7/8" FG 8rd csg @ 3366' cmtd w/ 600 sx, cmt circ

Printed 10/18/2019

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.