


MAY 30 2006

MACK ENERGY CORPORATION  
Westall B State #6  
Sec 36 T17S R29E

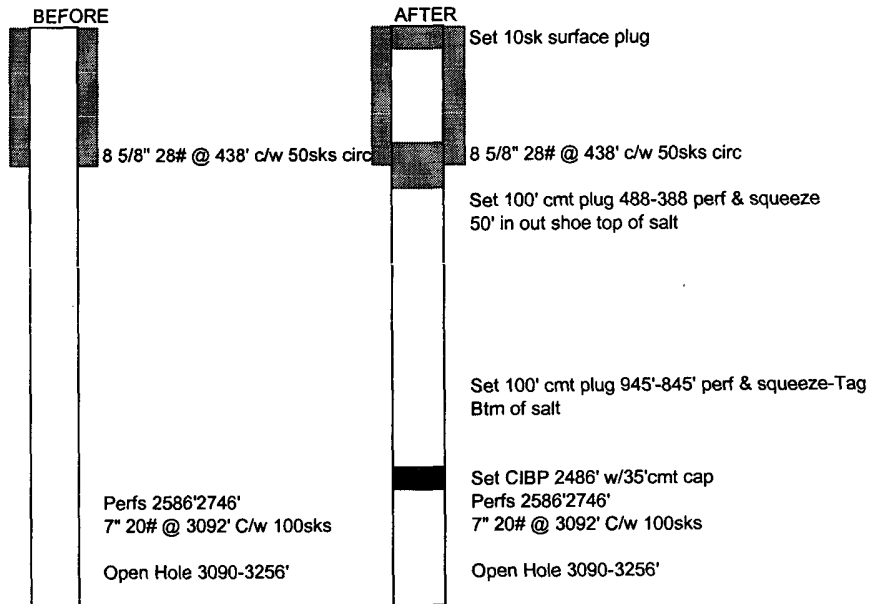

- 1 Notify OCD 24hrs of plugging
- 2 Set CIBP @ 2486' w/35'cmt cap circ hole w/mud
- 3 Set 100' cmt plug 945-845" perf, squeeze, tag
- 3 Set 100' cmt plug 488-388' Perf & squeeze
- 4 Set 10sk surface plug
- 5 Install dry hole marker