


О Р У

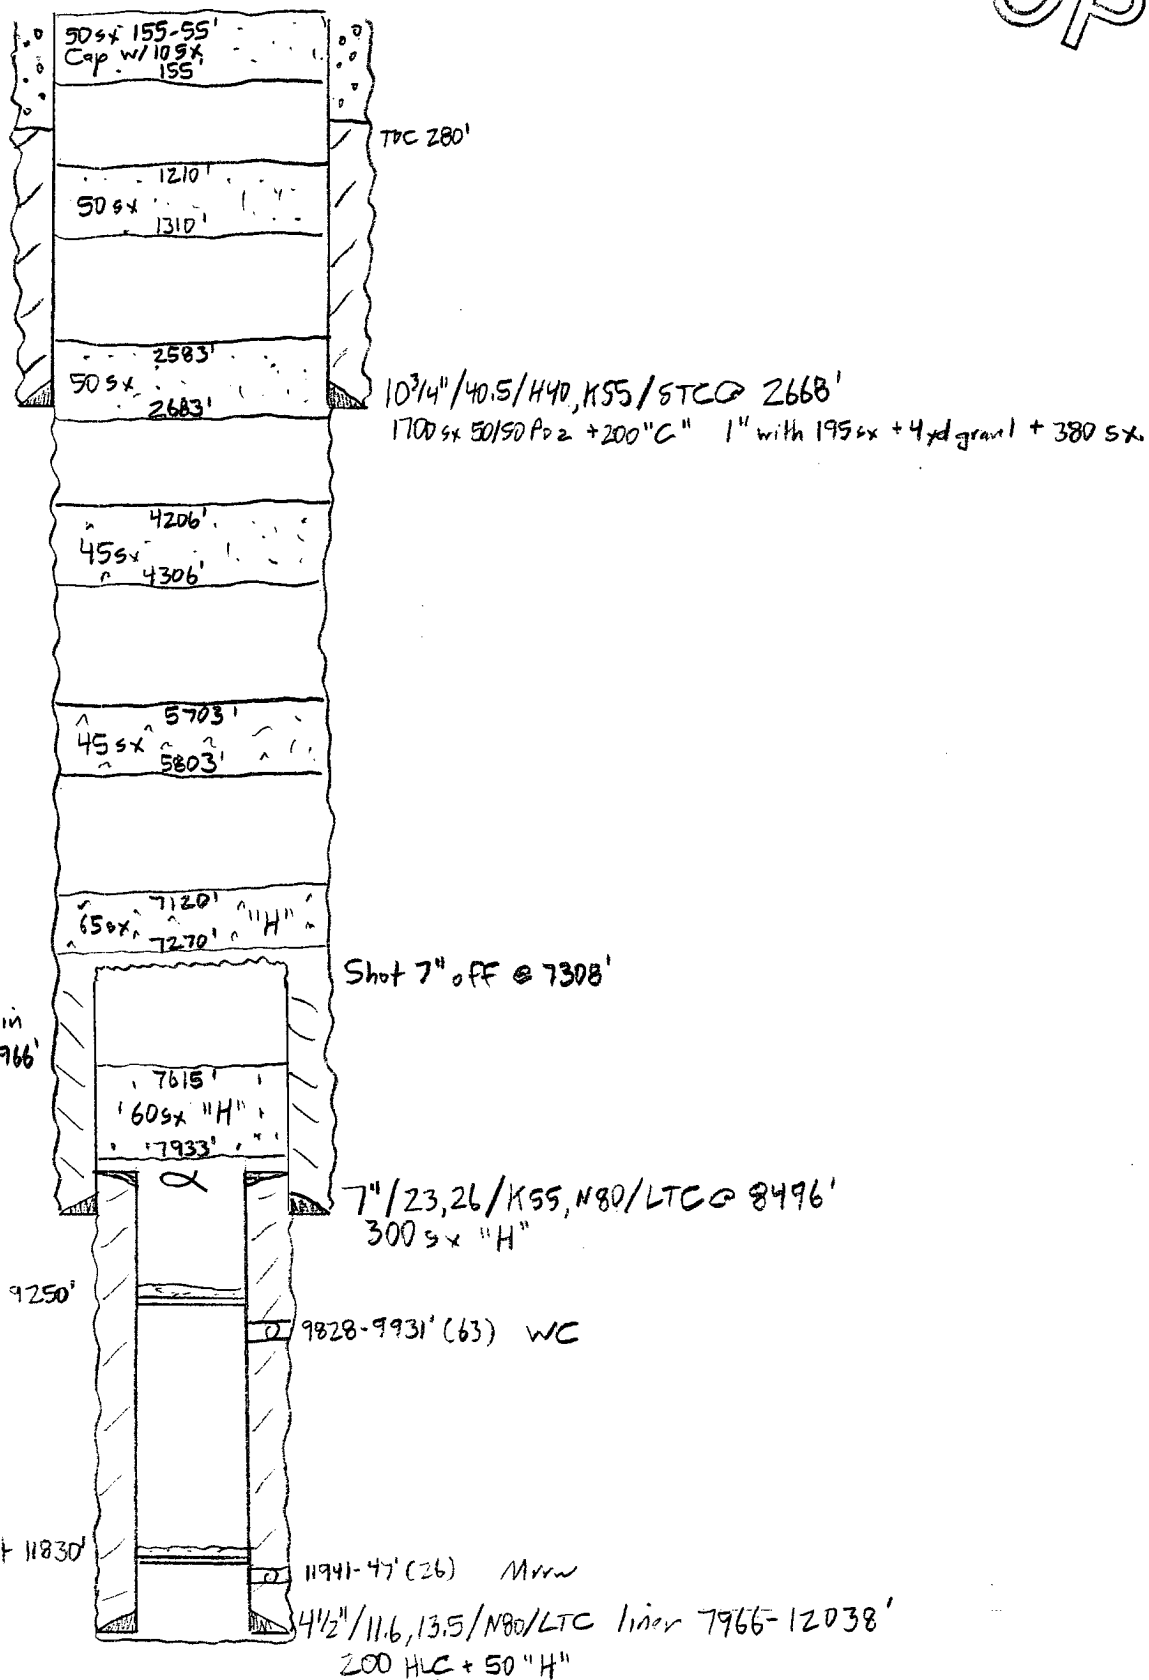

α = Barber stuck in
hinter hanger 7966'

CIBP + 25' ant 9250'
Kicked @ 9933'
6' 1/8"

C10P + 50' and 11830'

7"/23,26/K55,N80/LTC @ 8496'
300 s x "H"

9828-9931' (63) WC

11941-47' (26) Mrs

84 1/2" / 11.6, 13.5 / N80 / LTC liner 7966-12038'
200 HLC + 50 "H"

Well History

DST 11884-11952' 6TS 17" @ 1669-2451 MCFD ISI= 4390 PSI= 4302 psi

Morrow 11943-47' (4) : 890 mCFD
Acidz 3000g. 10% MorFlo Acid + 1000 SCF/B N₂ well dead
Jet with 3/4" CT

11/74 Sgd 11941-47' w/ 100gx "H" Clean out to 11970'.

Water with 129 MCFD gas

4/75 CIBP 11830' + 50' cement

Wolfcamp 9864-80', 9900-08' (48)
Auz 2000g. 28% HCl Gas < 100 mcrd

Wolfcamp 9828', 38, 49, 66, 69, 77, 91, 93, 97, 9901, 04, 22, 24, 9929-31' (15)
Acid 3000 g. 15% HCl Est 250 mcpd

6175 CIBP 9250' + 25' cont. Bailer left in hole stuck in liner
hanger 7966'.

60 sx "H" 7933-7615', Shot & pull 7308' 7" casing
65 sx "H" 7270-7120', 45 sx 5803-5703', 45 sx 4306-4206',
50 sx 2683-2583', 50 sx 1310-1210', 50 sx 155-55', Cap w/10 sx

10/94 DL Cook submitted APD to reenter & test Delaware (never done)

THE National[®] Brand