

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised June 10, 2003

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-015-32799
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Tesque 2 State
8. Well Number 1
9. OGRID Number 6137
10. Pool name or Wildcat Brushy Draw Delaware North

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH
PROPOSALS.)

1. Type of Well:
Oil Well ☒ Gas Well ☐ Other

2. Name of Operator
Devon Energy Production Company, LP

3. Address of Operator
20 North Broadway, Suite 1500, Oklahoma City, Oklahoma 73102

4. Well Location

Unit Letter C : 660' feet from the North line and 1980' feet from the West line

Section 2 Township 26S Range 29E Eddy County

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
2997' GR

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER:

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 11-03 for Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Plugging of the well bore
Liability under bond is retained
until after remediation and
environmental completion
final inspection is completed

01/25/07 - 02/15/07:

MIRU. Set CIBP at 5231'. Dump bail 4 Sx (39') cement on top. Circulated casing with 9.5 ppg mud. Spot 25 Sx cement at 2950'. Tagged TOC at 2701'. Spot 25 Sx cement at 631'. Tagged TOC at 380'. (Covers 8-5/8" casing shoe at 581'). Circulated 10 Sx cement from 60' to surface. Cut off wellhead and set dry hole marker. Well plugged and abandoned on 2/15/07.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Ronnie Slack TITLE: Engineering Technician DATE 2/15/07

Type or print name Ronnie Slack E-mail address: Ronnie.Slack@dvn.com Telephone No. 405-552-4615
(This space for State use)

APPROVED BY _____ TITLE _____ DATE _____
Conditions of approval, if any:

Accepted for record
NMOCD

DEVON ENERGY PRODUCTION COMPANY LP

Well Name: TESUQUE 2 STATE #1		Field: BRUSHY DRAW DELAWARE NORTH	
Location: 660' FNL & 1980' FWL; SEC 2-T26S-R29E		County: EDDY	State: NM.
Elevation: 2997' GR		Spud Date: 5/30/03	Compl Date: 7/16/03
API#: 30-015-32799	Prepared by: Ronnie Slack	Date: 2/15/07	Rev:


PLUGGED & ABANDONED
2/15/07

12-1/4" Hole
8-5/8", 24#, J55, ST&C, @ 581'
Cmt'd w/650 sx. Cement to surface

SAND TOPS
Rustler: 524'
Salado: 591'
Base Salt: 2941'
Lamar: 3132'
Delaware: 3172'

Delaware perfed 6-27-03
5256' - 5272' } acidized w/ 1000 gals
fraced w/51K# 16/30
5340' - 5343' }
5585' - 5590' } acidized w/ 1000 gals
Sqzd w/ 320 sx cement
5595' - 5606' }
5915' - 5930' } acidized w/ 1000 gals
fraced w/28K# 16/30

7-7/8" Hole
5-1/2", 15.5#, J55, @ 6010'
Cmt'd w/ 1800 sx. Cement to surface.

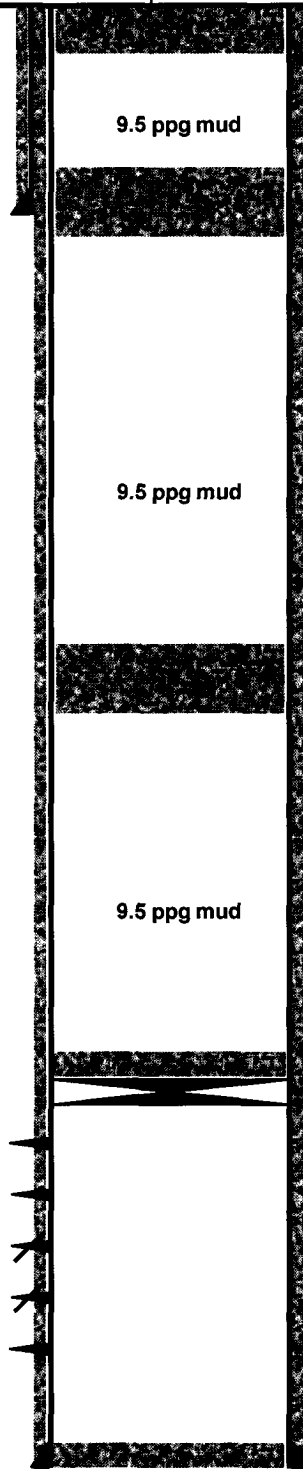

1. Circulated 10 Sx cement for 60' surface plug

1. Spot 25 Sx cement at 631'. Tagged TOC at 380'.

1. Spot 25 Sx at 2950'. Tagged TOC at 2701'

1. Set CIBP at 5231'.
2. Dumped 4 Sx cement (39') on top.

PBTD @ 5982'

TD @ 6010'