Form 3160-5 (August-2007)

# UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

APR 23 2009

**OCD** Artesia

FORM APPROVED OMB NO. 1004-0135 Expires: July 31, 2010

5	PM
_	

SUNDRY	NOTICES AND REPOR	TS ON WELLS	5. Lease Serial No. NMLC068430			
Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.			6. If Indian, Allottee	6. If Indian, Allottee or Tribe Name		
SUBMIT IN TRI	PLICATE - Other instructi	ons on reverse side.	7 If Unit or CA/Agre	eement, Name and/or No.		
1. Type of Well ☐ Gas Well ☐ Otl	hor		8. Well Name and No PLU PIERCE CA	). ANYON 33 FEDERAL 1		
2. Name of Operator		INDA GOOD	9. API Well No.			
CHESAPEAKE OPERATING,	, INC. E-Mail: linda.good@	chk.com	30-015-36636-			
3a. Address		<ol> <li>Phone No. (include area code</li> <li>Ph: 405.935.4275</li> </ol>	e) 10: Field and Pool, o WILDCAT	or Exploratory		
OKLAHOMA CITY, OK 7315	l l					
4. Location of Well (Footage, Sec., 7			11. County or Parish			
Sec 33 T24S R30E SESE 356	0FSL 350FEL		EDDY COUNT	Y, NM		
12. CHECK APP	ROPRIATE BOX(ES) TO	INDICATE NATURE OF	NOTICE, REPORT, OR OTHE	ER DATA		
TYPE OF SUBMISSION		ТҮРЕ О	F ACTION			
	Acidize	Deepen Deepen	Production (Start/Resume)	☐ Water Shut-Off		
Notice of Intent	Alter Casing	Fracture Treat	Reclamation	Well Integrity		
☐ Subsequent Report	Casing Repair	☐ New Construction	Recomplete	Other		
☐ Final Abandonment Notice	Change Plans	Plug and Abandon	Temporarily Abandon	Change to Original PD		
	Convert to Injection	□ Plug Back	□ Water Disposal			
following completion of the involve	d operations If the operation restrained in the operation is the file of the final inspection in the control of	ults in a multiple completion or red only after all requirements, incl	ES	3160-4 shall be filed once		
			OF APPROVAL			
14. Thereby certify that the foregoing in the control of the contr	Electronic Submission #6 For CHESAPEAKI nmitted to AFMSS for proces		the Carlsbad 04/03/2009 (09CMR0291SE)	DEC.		
Name(Trinled/Typed) LINDA GC	JOU	Title SR. RE	EGULATORY COMPLIANCE SI	PEU		
Signature (Electronic	Submission)	Date 04/03/2	2009			
	THIS SPACE FOR	R FEDERAL OR STATE	OFFICE USE			
Approved By (BLM Approver Not	Specified)	Title		2009 Date 04/19/2		
Conditions of approval, if any, are attach certify that the applicant holds legal or ec which would entitle the applicant to conduct the conductive that the applicant to conduct the applicant the	quitable title to those rights in the		ad .			

ONSHORE ORDER NO. 1 Chesapeake Operating, Inc. PLU Pierce Canyon 33 Federal 1H SL: 350' FSL & 350' FEL BL: 350' FNL & 350' FEL Section 33-24S-30E Eddy County, New Mexico

CONFIDENTIAL – TIGHT HOLE Lease Contract No. NMLC068430

#### **REVISED DRILLING PROGRAM**

Page 1

# ONSHORE OIL & GAS ORDER NO. 1 Approval of Operations on Onshore Federal and Indian Oil and Gas Leases

All lease and/or unit operations are to be conducted in such a manner that full compliance is made with the applicable laws, regulations (CFR 43, Part 3160) and the approved Application for Permit to Drill. The operator is considered fully responsible for the actions of his subcontractors. A copy of the approved APD must be on location during construction, drilling and completion operations.

Approval of this application does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease, which would entitle the applicant to conduct operations thereon.

# 1. FORMATION TOPS

The estimated tops of important geologic markers are as follows:

Formation	Subsea KBTVD	GCE (G) KBTVD
BASE OF SALT	(-498')	3,813'
BELL CANYON	-541'	3,859'
CHERRY CANYON MARKER	-1,625'	4,943'
BRUSHY CANYON	-2,767'	6,085'
LOWER BRUSHY CANYON	-4,055'	7,373'
BONE SPRING	-4,309'	7,627'
1 <sup>ST</sup> BONE SPRING SAND	-5,265'	8,583'
2 <sup>ND</sup> BONE SPRING CARBONATE	-5,709'	9,027'
2 <sup>ND</sup> BONE SPRING SAND	-6,019'	9,337'
3 <sup>RD</sup> BONE SPRING CARBONATE	-6,435'	9,753'
3 <sup>RU</sup> BONE SPRING SAND	-7,189'	10,507'
WOLFCAMP.	-7,580'	10,898'
PILOT HOLE	TD	11,000'

# 2. <u>ESTIMATED DEPTH OF WATER, OIL, GAS & OTHER MINERAL BEARING</u> <u>FORMATIONS</u>

The estimated depths at which the top and bottom of the anticipated water, oil, gas or other mineral bearing formations are expected to be encountered are as follows:

Substance	<u>Formation</u>	<u>Depth</u>
Oil/Gas	Bell Canyon	3859
Oil/Gas	Cherry Canyon	4943'
Oil/Gas	Bone Spring	7627'

ONSHORE ORDER NO. 1 Chesapeake Operating, Inc. PLU Pierce Canyon 33 Federal 1H SL: 350' FSL & 350' FEL BL: 350' FNL & 350' FEL Section 33-24S-30E Eddy County, New Mexico CONFIDENTIAL - TIGHT HOLE Lease Contract No. NMLC068430

#### **REVISED DRILLING PROGRAM**

Page 2

# 3. BOP EQUIPMENT:

Will have a 2000 psi simplified rental stack (see proposed schematic) for drill out below surface casing; this system will be tested to 2000 psi working pressure.

Will have a 5000 psi rig stack (see proposed schematic) for drill out below intermediate casing; this system will be tested to 3000 psi working pressure.

Chesapeake Operating, Inc.'s minimum specifications for pressure control equipment are as follows:

# I. BOP, Annular, Choke Manifold, Pressure Test - See Exhibit F-1 and F-3.

#### A. Equipment

- 1. The equipment to be tested includes all of the following that is installed on the well
  - (a) Ram-type and annular preventers,
  - (b) Choke manifolds and valves,
  - (c) Kill lines and valves, and
  - (d) Upper and lower kelly cock valves, inside BOP's and safety valves.

# B. Test Frequency

- 1. All tests should be performed with clear water,
  - (a) when installed.
  - (b) before drilling out each casing string,
  - (c) at any time that there is a repair requiring a pressure seal to be broken in the assembly, and
  - (d) at least once every 30 days while drilling.

#### C. Test Pressure

- 1. In some drilling operations, the pressures to be used for low and high-pressure testing of preventers and casing may be different from those given below due to governmental regulations, or approved local practices.
- 2. If an individual component does not test at the low pressure, **do not**, test to the high pressure and then drop back down to the low pressure.
- 3. All valves located downstream of a valve being tested must be placed in the open position.
- 4. All equipment will be tested with an initial "low pressure" test at 250 psi.
- 5. The subsequent "high pressure" test will be conducted at the rated working pressure of the equipment for all equipment except the annular preventer.
- 6. The "high pressure" test for the annular preventer will be conducted at 70% of
- 7. the rated working pressure.
- 8. A record of all pressures will be made on a pressure-recording chart.

300 P

ONSHORE ORDER NO. 1 Chesapeake Operating, Inc. PLU Pierce Canyon 33 Federal 1H SL: 350' FSL & 350' FEL BL: 350' FNL & 350' FEL CONFIDENTIAL – TIGHT HOLE Lease Contract No. NMLC068430

#### **REVISED DRILLING PROGRAM**

Section 33-24S-30E Eddy County, New Mexico

Page 3

1. In each case, the individual components should be monitored for leaks for <u>10</u> minutes, with no observable pressure decline, once the test pressure as been applied.

# II. Accumulator Performance Test

#### A. Scope

3.

1. The purpose of this test is to check the capabilities of the BOP control systems, and to detect deficiencies in the hydraulic oil volume and recharge time.

# B. Test Frequency

1. The accumulator is to be tested each time the BOP's are tested, or any time a major repair is performed.

# C. Minimum Requirements

- 1. The accumulator should be of sufficient volume to supply 1.5 times the volume to close and hold all BOP equipment in sequence, <u>without recharging</u> and the <u>pump turned off</u>, and have remaining pressures of <u>200 PSI above the precharge pressure</u>.
- Minimum precharge pressures for the various accumulator systems per manufacturers recommended specifications are as follows:

System Operating Pressures	Precharge Pressure
1500 PSI	750 PSI
2000 PSI	1,000 PSI
3000 PSI	1,000 PSI

- Closing times for the Hydril should be less than <u>20 seconds</u>, and for the ramtype preventers less than <u>10 seconds</u>.
- 4. System Recharge time should not exceed **10 minutes**.

#### D. Test Procedure

- 1. Shut accumulator pumps off and record accumulator pressure.
- In sequence, close the annular and one set of properly sized pipe rams, and open the HCR valve.
- 3. Record time to close or open each element and the remaining accumulator pressure after each operation.

Created by Neevia Document Converter trial version http://www.neevia.com

ONSHORE ORDER NO. 1
Chesapeake Operating, Inc.
PLU Pierce Canyon 33 Federal 1H
SL: 350' FSL & 350' FEL

SL: 350' FSL & 350' FEL BL: 350' FNL & 350' FEL Section 33-24S-30E CONFIDENTIAL - TIGHT HOLE Lease Contract No. NMLC068430

#### **REVISED DRILLING PROGRAM**

Section 33-24S-30E Eddy County, New Mexico

Page 4

4. Record the remaining accumulator pressure at the end of the test sequence. Per the previous requirement, this pressure **should not be less** than the following pressures:

System Pressure	Remain	ning Pressure At C	onclu	sion	of
	, .	<u>Test</u>	-	٠,	
1,500 PSI		950 PSI	*	-	
2,000 PSI		1,200 PSI			
3,000 PSI	,	1,200 PSI			

- 5. Turn the accumulator pumps on and record the recharge time. This time should not exceed **10 minutes**.
- 6. Open annular and ram-type preventers. Close HCR valve.
- 7. Place all 4-way control valves in <u>full open</u> or <u>full closed</u> position. <u>Do not leave in neutral position</u>.

# 4. CASING PROGRAM

a. The proposed casing program will be as follows:

Purpose	<u>Interval</u>	Hole Size	<u>Casing</u> <u>Size</u>	Weight	<u>Grade</u>	Thread	Condition
Surface	Surface – 400'	17-1/2"	13-3/8"	48.0#	H-40	STC	New
Intermediate	Surface – 3,800'	12-1/4"	9-5/8"	40.0#	J-55	LTC	New
Production	Surface – 12425' 124-29	8-3/4" (3800' 8249')/ 8-1/2" (8249'- TD	5-1/2"	17.0#	P-110	LTC	New

- b. Casing design subject to revision based on geologic conditions encountered.
- c. Casing Safety Factors:

13-3/8" Surface Casing: SFb = 1.6, SFc = 3.9 and SFt = 6 9-5/8" Intermediate Casing: SFb = 2.3, SFc = 3.4 and SFt = 3.1

5-1/2" Production Casing: SFb = 1.8, SFc = 2.0 and SFt = 3.4

- d. The cementing program will be as follows:
- 5. Cementing Program

ONSHORE ORDER NO. 1 Chesapeake Operating, Inc. PLU Pierce Canyon 33 Federal 1H

SL: 350' FSL & 350' FEL BL: 350' FNL & 350' FEL Section 33-24S-30E

CONFIDENTIAL - TIGHT HOLE Lease Contract No. NMLC068430

#### REVISED DRILLING PROGRAM

Eddy County,	, New Mexico		1 - Br	Page	5
Interval	Type	<u>Amount</u>	<u>Yield</u>	Top Of Cement	<u>Excess</u>
Surface	Tail: Class C 1% CaCl2 (Accelerator)	450 sks	1.34	Surface	100%
Intermediate	Lead: 35/65 Poz/Class C	900 sks	2.0	Surface	100%
See					
COA	Tail: Class C	325 sks	1.34		100%
Production	Class H	1900 sks	1.60	3,300'	40%
	0.5% Halad344 (Fluid Loss Control)		*		
	0.4% CFR-3 (Dispersant) 1 lbm/sk Salt				
	0.3% HR-7 (Retarder) 0.25 lbm D-AIR 3000				
	(Defoamer)		`		

Final cement volumes will be determined by caliper.

Pilot Hole Plugging Plan:

The pilot hole will be plugged back using a plug of at least 210' from ±10,750' to 10,960' (125 sx Class H 14.8 ppg 1.35 yld + KCL + Retarder) covering the top of Wolfcamp and base of Bone Spring. A second 600' plug will be placed from +7,295' to 7,895' (325 sx, 40% Excess, Class H 17.5 ppg 0.96yld + 0.75% CFR-3 + 3% KCL + 0.2% HR-800).

#### MUD PROGRAM

The proposed circulating mediums to be used in drilling are as follows:



Interval	Mud Type	Mud Weight	Viscosity	Fluid Loss
0' - 400	FW/Gel	8.4 - 9.0	28-32	NC
400' - 3,800'	Native/Brine	9.9 – 10.1	28-30	NC
3,800' - TD	FW/LSND	8.8 – 9.5	34-45	20-10

A closed system will be utilized consisting of above ground steel tanks. All wastes accumulated during drilling operations will be contained in a portable trash cage and removed from location and deposited in an approved sanitary landfill.

A mud test shall be performed every 24 hours after mudding up to determine, as applicable: density, viscosity, gel strength, filtration, and pH.

ONSHORE ORDER NO. 1 Chesapeake Operating, Inc. PLU Pierce Canyon 33 Federal 1H SL: 350' FSL & 350' FEL BL: 350' FNL & 350' FEL Section 33-24S-30E

**Eddy County, New Mexico** 

CONFIDENTIAL – TIGHT HOLE Lease Contract No. NMLC068430

**REVISED DRILLING PROGRAM** 

Page 6

# 6. TESTING, LOGGING AND CORING

The anticipated type and amount of testing, logging and coring are as follows:

- a. Drill stem tests are not planned.
- b. The logging program will consist of Natural GR, Density-Neutron, PE & Dual Laterolog from TD to surface casing; Neutron-GR surface casing to surface.
- c. Cores samples are not planned.

# 7. ABNORMAL PRESSURES AND HYDROGEN SULFIDE

- The estimated bottom hole pressure is 4750 psi. No abnormal pressures or temperatures are anticipated.
- b. Hydrogen sulfide gas is not anticipated.

# CHESAPEAKE OPERATING INC

Proposed Well Schematic (drilling)


WELL : PLU PIERCE CANYON 33 FEDERAL 1H
SHL : Section 33 - 24S - 30E, 350' FSL & 350' FEL
BHL : Section 33 - 24S - 30E, 350' FNL & 350' FEL

COUNTY : Eddy

STATE : New Mexico

FIELD : Delaware Basin North

ELEVATION: GL - 3,301' RKB - 3,313' Est.

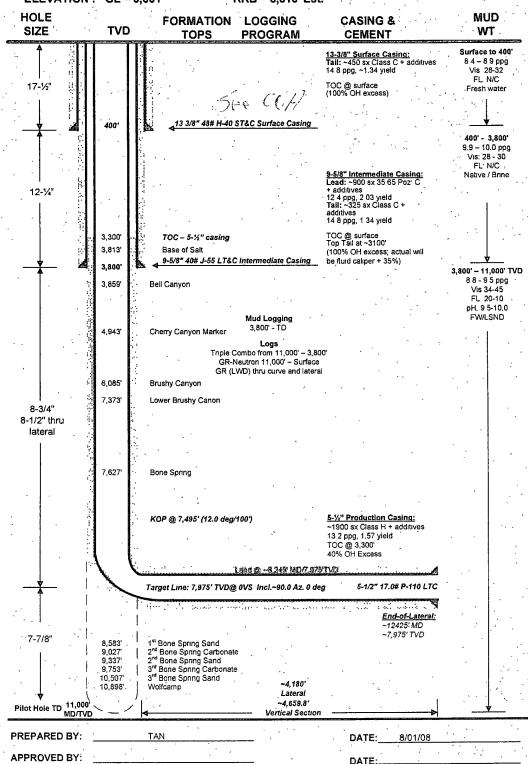

# PECOS DISTRICT CONDITIONS OF APPROVAL

OPERATOR'S NAME: | Chesapeake Operating, Inc.

LEASE NO.: | LC068430

WELL NAME & NO.: | PLU Pierce Canyon 33 Fed # 1H

SURFACE HOLE FOOTAGE: 350' FSL & 350' FEL BOTTOM HOLE FOOTAGE 350' FNL & 350' FEL

LOCATION: Section 33, T. 24 S., R 30 E., NMPM

COUNTY: | Eddy County, New Mexico

#### I. DRILLING

# A. DRILLING OPERATIONS REQUIREMENTS

The BLM is to be notified a minimum of 4 hours in advance for a representative to witness:

- a. Spudding well
- b. Setting and/or Cementing of all casing strings
- c. BOPE tests

# **Eddy County**

Call the Carlsbad Field Office, 620 East Greene St., Carlsbad, NM 88220, (575) 361-2822

- 1. Although Hydrogen Sulfide has not been reported in this section, it is always a potential hazard. If Hydrogen Sulfide is encountered, please report measured amounts and formations to the BLM.
- 2. Unless the production casing has been run and cemented or the well has been properly plugged, the drilling rig shall not be removed from over the hole without prior approval.
- 3. Floor controls are required for 3M or Greater systems. These controls will be on the rig floor, unobstructed, readily accessible to the driller and will be operational at all times during drilling and/or completion activities. Rig floor is defined as the area immediately around the rotary table; the area immediately above the substructure on which the draw works are located, this does not include the dog house or stairway area.

#### B. CASING

Changes to the approved APD casing and cement program require submitting a sundry and receiving approval prior to work. Failure to obtain approval prior to work will result in an Incident of Non-Compliance being issued.

Centralizers required on surface casing per Onshore Order 2.III.B.1.f.

Wait on cement (WOC) time for a primary cement job will be a minimum 18 hours for a water basin, 24 hours in the potash area, or 500 pounds compressive strength, whichever is greater for all casing strings. Provide compressive strengths including hours to reach required 500 pounds compressive strength prior to cementing each casing string. See individual casing strings for details regarding lead cement slurry requirements.

No pea gravel permitted for remedial or fall back remedial without prior authorization from the BLM engineer.

Medium cave/karst.

Possible lost circulation in the Delaware and Bone Spring formations.

Possible high pressure gas burst in the Wolfcamp formation – applies to pilot hole.

- 1. The 13-3/8 inch surface casing shall be set at approximately 680 feet (a minimum of 25 feet into the Rustler Anhydrite and above the salt) and cemented to the surface. Fresh water mud to be used to setting depth. Due to additional length, additional cement will be required.
  - a. If cement does not circulate to the surface, the appropriate BLM office shall be notified and a temperature survey utilizing an electronic type temperature survey with a surface log readout will be used or a cement bond log shall be run to verify the top of the cement.
  - b. Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry.
  - c. Wait on cement (WOC) time for a remedial job will be a minimum of 4 hours after bringing cement to surface or 500 pounds compressive strength, whichever is greater.
  - d. If cement falls back, remedial cementing will be done prior to drilling out that string.

- 2. The minimum required fill of cement behind the 9-5/8 inch intermediate casing is:
  - □ Cement to surface. If cement does not circulate see B.1.a, c-d above.
     □ Casing to be set in the Lamar Limestone. Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to cave/karst concerns.

If 75% or greater lost circulation occurs while drilling the intermediate casing hole, the cement on the production casing must come to surface.

Pilot hole plug to be set from bottom of hole, not 10960'. Plug to be 210' in length as per APD and must be tagged. Tag depth to be recorded and reported on subsequent sundry with casing information. Second plug is required due to maximum spacing in open hole of 2000' between plugs and is to be a minimum of 190 feet in length and must be tagged. Other plugs can be lengthened to eliminate a tag. Kick-off plug can be set as noted in APD.

Centralizers required on horizontal leg, must be type for horizontal service and minimum of one every other joint.

- 3. The minimum required fill of cement behind the 5-1/2 inch production casing is:
  - Cement should tie-back at least 200 feet into previous casing string. Operator shall provide method of verification.
- 4. If hardband drill pipe is rotated inside casing, returns will be monitored for metal. If metal is found in samples, drill pipe will be pulled and rubber protectors which have a larger diameter than the tool joints of the drill pipe will be installed prior to continuing drilling operations.

# C. PRESSURE CONTROL

- 1. All blowout preventer (BOP) and related equipment (BOPE) shall comply with well control requirements as described in Onshore Oil and Gas Order No. 2 and API RP 53 Sec. 17.
- 2. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be **2000 (2M)** psi.
- 3. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the 9-5/8" intermediate casing shoe shall be 5000 (5M) psi. 5M system will be tested as 3M.

- 4. The appropriate BLM office shall be notified a minimum of 4 hours in advance for a representative to witness the tests.
  - a. The tests shall be done by an independent service company.
  - b. The results of the test shall be reported to the appropriate BLM office.
  - c. All tests are required to be recorded on a calibrated test chart. A copy of the BOP/BOPE test chart and a copy of independent service company test will be submitted to the appropriate BLM office.
  - d. The BOP/BOPE test shall include a low pressure test from 250 to 300 psi. The test will be held for a minimum of 10 minutes if test is done with a test plug and 30 minutes without a test plug.
  - e. BOP/BOPE must be tested by an independent service company within 500 feet of the top of the **Wolfcamp** formation if the time between the setting of the intermediate casing and reaching this depth exceeds 20 days. This test does not exclude the test prior to drilling out the casing shoe as per Onshore Order No. 2. **Statement applies to pilot hole.**

#### D. DRILLING MUD

Mud system monitoring equipment, with derrick floor indicators and visual and audio alarms, shall be operating before drilling into the **Wolfcamp** formation, and shall be used until production casing is run and cemented. **Applies to pilot hole until Wolfcamp plug is set.** 

#### E. DRILL STEM TEST

If drill stem tests are performed, Onshore Order 2.III.D shall be followed.

WWI 041909