

Submit 1 Copy To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
October 13, 2009

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-015-37720
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Huckleberry Draw 29 Fee Com
8. Well Number 1Y
9. OGRID Number 14744
10. Pool name or Wildcat Happy Valley; Morrow (Gas) 78060

11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3316' GL
--


SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☐ Gas Well ☒ Other ☐

2. Name of Operator
Mewbourne Oil Company

3. Address of Operator
PO Box 5270, Hobbs, NM 88241

4. Well Location
Unit Letter A : 987' feet from the North line and 803' feet from the East line
Section 29 Township 22S Range 26E NMPM Eddy County

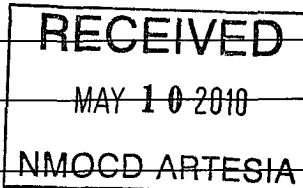

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☒
CASING/CEMENT JOB ☒

OTHER: ☐

OTHER:

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Please see attachment for details.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Jackie Lathan TITLE Hobbs Regulatory DATE 04/28/10
Type or print name Jackie Lathan E-mail address: jlathan@mewbourne.com PHONE: 575-393-5905

For State Use Only

APPROVED BY: David Gray TITLE Field Supervisor DATE 5-11-2010
Conditions of Approval (if any):

Huckleberry Draw 20 Fee com #1Y
987' FNL & 803' FEL
Sec 29, T22S, R26E
Eddy Co., NM
30-015-37720

- 04/05/10...** MI & spud 26" hole. Ran 301' 20" 94# K55 BT&C Csg. Cemented with 180 sks Class "H" w/additives. Mixed @ 14.6 /g w/1.52 yd. Followed w/200 sks BJ Lite Class "C" (35:65:6) w/additives. Mixed @ 12.5 /g w/2.04 yd Tail w/400 sks Class "C" w/2% CaCl₂. Mixed @ 14.8 /g w/1.34 yd. Plug down @ 4:15 pm 04/06/10. Did not circ cmt. RIH w/1" pipe & tag at 181'. Cmt to surface in 5 stages with 180 sks Thixad Class H w/additives. Mixed @ 14.6 #/g w/1.52 yd. And 173 sks Class "C" w/additives. Mixed @ 14.8#/g w/1.34 yd. Circ 5 sks cmt to pit. WOC 18 hrs.
- 04/07/10** Drlg w/12 1/4" bit. Lost returns @ 425'. Drlg w/no returns to 1428'. TOO H & PU 17 1/2" bit. Ream out 12 1/4" hole to 1170' w/no returns. Became stuck while drlg. Worked free & work up hole to 1023' and became stuck again. Free point & back off 988'. TOO H. PU fishing tools & TIH. Tag fill @ 860'. Wash out fill, but could not get below 901'.
- 04/13/10** Ran 805' 13 3/8" 48/54.5# J55 ST&C csg. Cemented with 180 sks Thixad H with additives. Mixed @ 14.6 #/g w/ 1.52 yd. Followed with 700 sks BJ Lite Class C (35:65:6) with additives. Mixed @ 12.5# /g w/ 2.05 yd. Tail w/200 sks Class C with 2% CaCl₂. Mixed @ 14.8 #/g w/ 1.34 yd. Plug down @ 12:30 pm 04/13/10. Did not circ cmt. Ran Temp Survey. TOC at 575'. TIH with 1" pipe. Tag at 605' and cement in 9 stages with 180 sks Thixad Class H w/additives. Mixed @ 14.6 #/g w/1.52 yd. And 350 sks Class C w/additives. Mixed @ 14.8 #/g w/1.34 yd. Circ 10 sks cmt to pit. NU BOPE & test to 1250#. Held OK.
- 04/15/10** Drilled out plug & cmt w/12 1/4" bit. Lost circ @ 930' while washing to TOF @ 989'. Short trip to 782' with no fill. TOO H & PU 11 3/4" shoe & wash pipe. TIH. Wash over fish from 989' to 996'. TOO H & replaced washover shoe. Dropped drill string while TIH. Pick up overshot & TIH & engage fish. Worked free & work up hole to 829'. Became stuck w/shoe @ 829'. Jar free & TOO H. Left washover shoe & 7' washpipe pup in hole. Received approval to P&A well.
- 04/19/10** Plugged well to surface w/180 sks Thixad Class "H" w/additives. Mixed @ 14.6#/g w/1.54 yd. And 935 sks Class "C" w/CaCl₂. Mixed @ 14.8#/g w/1.34 yd.
- 04/20/10** P&A'd well @ 1:30 pm. Rig released to move @ 7:00 pm 04/20/10.

Spud Date: 04/05/10

Rig Release Date: 04/20/10