devon

Devon Energy Corporation 20 North Broadway Oklahoma City, Oklahoma 73102-8260

Hydrogen Sulfide (H₂S) Contingency Plan

For


Eagle 34L Federal # 45


2310' FNL & 1170' FWL, Sec-34, T-17S R-27E

Eddy County NM

Eagle 34L Federal # 45

This is an open drilling site. H₂S monitoring equipment and emergency response equipment will be used within 500' of zones known to contain H₂S, including warning signs, wind indicators and H₂S monitor.

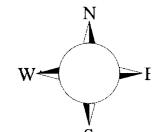

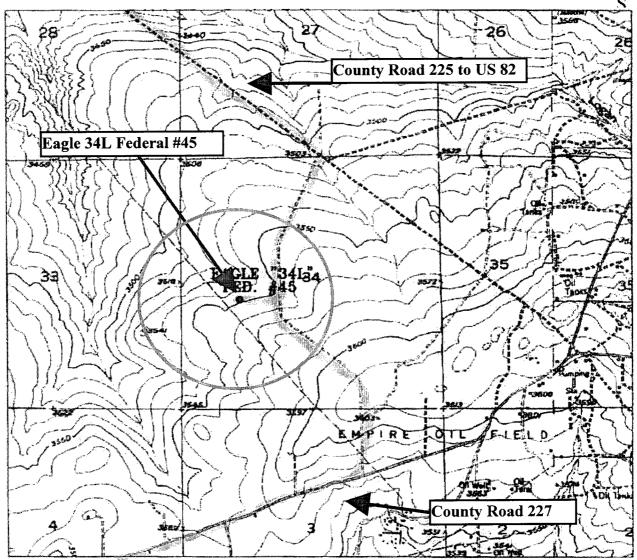

Assumed 100 ppm (2 3000? (12 1 20 1 1000 7) 100 ppm H2S concentration shall trigger activation of this plan.

Escape

Crews shall escape upwind of escaping gas in the event of an emergency release of gas. Escape can be facilitated east on lease road to primitive road (North or South). Drivers in both directions of primitive road (north and south) to county road 225 or county road 227 must be flagged and stopped so as to prevent traversing into a hazardous area. There are no homes or buildings in or near the ROE.

Emergency Procedures

In the case of a release of gas containing H₂S, the first responder(s) must isolate the area and prevent entry by other persons into the 100 ppm ROE. Additionally the first responder(s) must evacuate any public places encompassed by the 100 ppm ROE. First responder(s) must take care not to injure themselves during this operation. Company and/or local officials must be contacted to aid in this operation. Evacuation of the public should be beyond the 100 ppm ROE.

All responders must have training in the detection of H₂S, measures for protection against the gas, equipment used for protection and emergency response. Additionally, responders must be equipped with H₂S monitors and air packs in order to control the release. Use the "buddy system" to ensure no injuries during the response.

Ignition of Gas Source

Should control of the well be considered lost and ignition considered, take care to protect against exposure to Sulfur Dioxide (SO₂). Intentional ignition must be coordinated with the NMOCD and local officials. Additionally the NM State Police may become involved. NM State Police shall be the Incident Command on scene of any major release. Take care to protect downwind whenever there is an ignition of the gas

Characteristics of H₂S and SO₂

Common Name	Chemical Formula	Specific Gravity	Threshold Limit	Hazardous Limit	Lethal Concentr- ation
Hydrogen Sulfide	H ₂ S	1.189 Air = 1	10 ppm	100 ppm/hr	600 ppm
Sulfur Dioxide	SO ₂	2.21 Air = 1	2 ppm	N/A	1000 ppm

Contacting Authorities

Devon Energy Corp. personnel must liaison with local and state agencies to ensure a proper response to a major release. Additionally, the OCD must be notified of the release as soon as possible but no later than 4 hours. Agencies will ask for information such as type and volume of release, wind direction, location of release, etc. Be prepared with all information available. The following call list of essential and potential responders has been prepared for use during a release. Devon Energy Corp. Company response must be in coordination with the State of New Mexico's 'Hazardous Materials Emergency Response Plan' (HMER)

Devon Energy Corp. Company Call List

Artesia (505)	Cellular	Office	Home				
Foreman – BJ Cathey Asst. Foreman – Bobby Jones Cecil Thurmond David Purdy Engineer – Tom Pepper	748-7447 748-7180 (432)631-2969	748-0176 748-0171 (432)495-7279	746-3194 887-1479 (432)683-0735				
Agency Call List							
Eddy County (505)							
Artesia State Police	ning Committee)		746-2703 746-9888 911 746-2701 746-2122				
Carlsbad State Police	anning Committee	on (Santa Fe)	885-2111 887-7551 911 885-2111 887-3798				
National Emergency Respon	se Center (Washi	ngton, DC) .	(800) 424-8802				
Other							
Boots & Coots IWC	5) 699-0139 or (915 (05) 746-2757						

Prepared in conjunction with Wade Rohloff of;

