

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

N. M. C. Cons. Division

811 S. 1ST ST.  
ARTESIA, NM 88210-2834

FORM APPROVED  
Budget Bureau No. 1004-0135  
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Stevens Operating Company

3. Address and Telephone No.

P. O. Box 2266, Albuquerque, NM 87103

The Bankrupt Estate of Mary Irene Stevens - USBN #79210633

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

Sec. 20, T-7-S, R-27-E, 1980' FNL & 1980' FEL, Unit G

5. Lease Designation and Serial No.

NM 11956

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

RUA Fed #1

9. API Well No.

30-005-60734

10. Field and Pool, or Exploratory Area

11. County or Parish, State

Chaves, NM

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

☐ Notice of Intent

☒ Subsequent Report

☐ Final Abandonment Notice

TYPE OF ACTION

☒ Abandonment

☐ Recompletion

☐ Plugging Back

☐ Casing Repair

☐ Altering Casing

☐ Other

☐ Change of Plans

☐ New Construction

☐ Non-Routine Fracturing

☐ Water Shut-Off

☐ Conversion to Injection


☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

- 1) Capped CIBP @ 6305' W/35' cement
- 2) Set 4 1/2 CIBP @ 5000' cap W/35' cement
- 3) Load hole with mud.
- 4) Cut 4 1/2 casing @ 2493', Pull out of hole
- 5) Spot 30 sacks cement, plug @ 4 1/2 stub 2620', W.O.C., tag cement top @ 2476'
- 6) Spot 45 sacks cement, plug @ 1459' 8-5/8 shoe, W.O.C., did not tag cement  
Respot 45 sacks cement @ 1459'. W.O.C., tag cement top @ 1328'
- 7) Spot 35 sacks cement, plug from 60' to surface, set PA marker
- 8) Job completed 04-18-97

Post ID-2  
6-12-98  
PFA

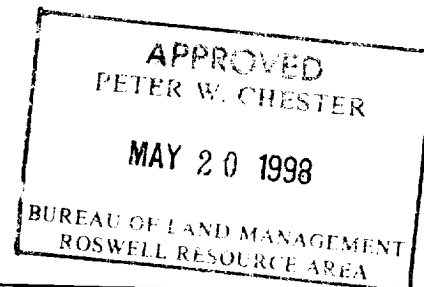

14. I hereby certify that the foregoing is true and correct

Signed

*Ramona Maldonado*

Title

*Supervisor mgr.*

Date

*4-23-97*

(This space for Federal or State office use)

Approved by

Conditions of approval, if any:

Title

Date