

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 South First, Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
2040 South Pacheco
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999

WELL API NO.
30005-60768

5. Indicate Type of Lease
STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name:
Twin Lakes San Andres Unit

7. Well No.
41

8. Pool name or Wildcat
Twin Lakes; San Andres (Assoc)

10. Elevation (Show whether DR, RKB, RT, GR, etc.)
3999.9 GR

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH
PROPOSALS.)

1. Type of Well:
Oil Well ☒ Gas Well ☐ Other ☐ Injection ☐

2. Name of Operator
Concho Oil & Gas Corp.

3. Address of Operator
110 W. Louisiana Ste 410; Midland, Tx 79701

4. Well Location

Unit Letter J : 1650 Feet from the South line and 2310 feet from the East line

Section 31 Township 8S Range 29E NMPM Chaves County

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Concho Oil & Gas Corp. respectfully request approval to plug and abandon the above well according to the following procedure:

1. Notify NMOCD- Artesia.
2. Set 195' plug @ 2650-2845'. WOC & tag.
3. Circ hole with mud.
4. Set 100' cmt plug @ 2030-2130'. Perf csg @ 2080' - 100' plug inside outside csg
5. Perf csg @ 1680' & set 100' plug @ 1630-1730'. inside outside of csg.
6. Perf csg @ 955' & set 100' plug @ 905-1005'. 855-955 inside outside csg.
7. Perf csg @ 130'. Circ cmt to surf.
8. Cut off wellhead & install dry hole marker.



I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Terri Stathern TITLE Production Analyst DATE 1-9-02

Type or print name Terri Stathern Telephone No. 505/633-7443

(This space for State use)
APPROVED BY John Doe TITLE John Doe DATE JAN 24 2002

Conditions of approval, if any:


TLSAU #41

Formerly - O'Brien J #2

Lease No.: 24988 Dist. No. : County: Chaves Field: Twin Lakes San Andres
 Section: 31 Twsp: 8S Range: 29E Unit Ltr: J Location: 1650' FSL & 2310' FEL

API No. 30-005-60768

Spud Date: 09/24/80
 TD Date: 09/30/80
 Comp Date: 10/09/80

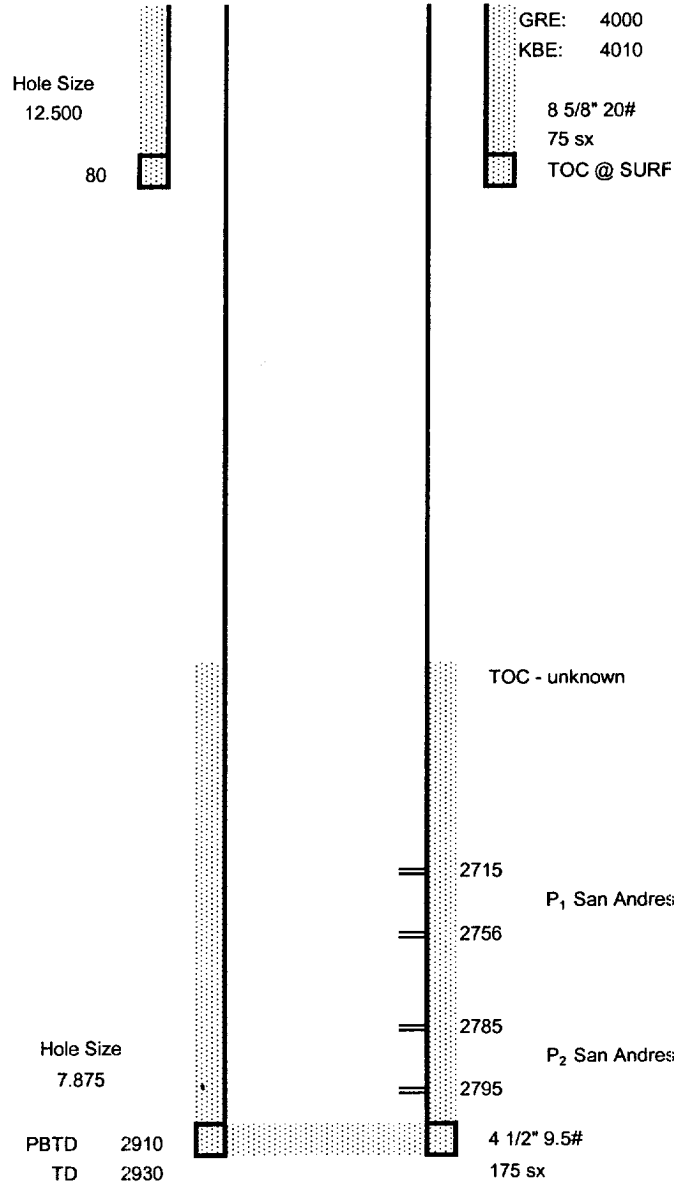

Formation Tops:
 Yates 955
 Base of Salt 1680
 San Andres 2080

Original Perf Details: P1: 2715, 18, 18.5, 20.5, 21, 21.5, 40.5, 41, 41.5, 44.5, 45, 45.5, 47, 47.5, 50.5, 51, 51.5, 55.5, 56
 6000 gals 28% acid

Jan-85 Added P2: 2785, 86, 87, 89, 90, 93, 94, 95
 1500 gals 20%