

Submit 3 Copies To Appropriate
District Office
DISTRICT I
1625 N. French Dr., Hobbs, NM 88240
DISTRICT II
1301 Grand Ave., Artesia NM 88210
DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
2040 S. Pacheco, Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources
OIL CONSERVATION DIVISION
2040 South Pacheco
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999

WELL API NO. 30-005-61893

5. Indicate Type of Lease
STATE ☒ FEE ☐

6. State Oil & Gas Lease No.
L-978

7. Lease Name or Unit Agreement Name:
ACME

8. Well No. 2

9. Pool name or Wildcat ACME

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
3976' GR

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS)

1. Type of Well:

Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator

JULIAN ARD PETROLEUM

3. Address of Operator

222 W. 4 th St., Ft. Worth, Texas 76102

4. Well Location

Unit letter C : 330 feet from the NORTH line and 1650 feet from the WEST line

Section 4 Township 8S Range 27E NMPM Chaves County

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

PLUGGING PROCEDURE

1. P.O.H. WITH TUBING, T.I.H. WITH CIBP AND SET AT 1900', CAP WITH 35' OF CEMENT.
2. CUT 4 1/2" CASING AT +/- 1500' AND PULL CASING, T.I.H. WITH TUBING AND CIRCULATE HOLE WITH 9 PPG MUD.
3. SPOT 100' PLUG, 35 SX., FROM 1550'-1450', ACROSS THE CASING STUB. 749
4. SPOT 100' PLUG, 35 SX., FROM 515'-615', ACROSS THE BASE OF THE SALT SECTION.
5. SPOT 100' PLUG, 35 SX., FROM 210-380', ACROSS 8 5/8" CASING SHOE. 741
6. SPOT A 60' PLUG, 20 SX., FROM 60' TO THE SURFACE.
7. CUT OFF WELLHEAD, ANCHORS AND CLEAN LOCATION. REMOVE ALL EQUIPMENT.
8. INSTALL DRY HOLE MARKER WITH WELL AND LOCATION INFORMATION.
9. RIP LOCATION AND ROAD AND RESEED.

Notify OCD 24 hrs. prior to any work done

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Bruce A. Stubbs TITLE ENGINEER DATE 12-20-01

Type or print name BRUCE A. STUBBS

Telephone No. 505-624-2800

(This space for State use)

APPROVED BY [Signature] TITLE Field Rep DATE JAN 14 20

Conditions of approval, if any:

EXISTING


T. RUSTLER 260'

T. SALT 310'

B. SALT 565'

T. YATES 985'

T. SAN ANDRES @ 1365'

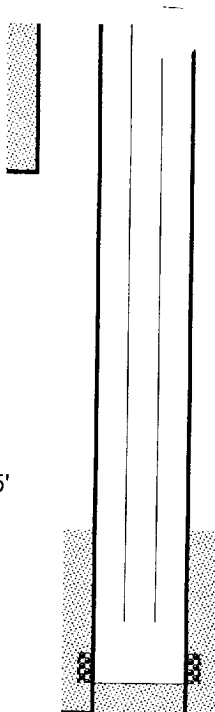

8 5/8" @ 330'
350 sx., CIRC.

TOC @ +/- 1600'

PERFS 1936-1970'

4 1/2" @ 2004'
100 SX.

JULIAN .RD

ACME #2

330' FNL & 1650' FWL

SECTION 4-T8S-R27E

CHAVES COUNTY, NEW MEXICO

LEASE No.: L-978


API NO.: 30-005-61893

SPUD DATE: 12/29/83

T. RUSTLER 260'
T. SALT 310'

T. YATES 985'

T. SAN ANDRES @ 1365'

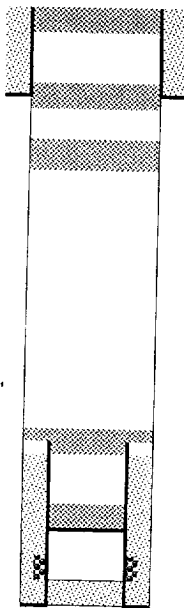

OT 60' SURFACE PLUG, 20 SX, 0-60'
8 5/8" @ 330'
350 sx., CIRC.

SPOT 100' PLUG, 35 SX., 280'-380'
SPOT 100' PLUG, 35 SX., 515'-615'

SPOT 100' PLUG, 35 SX., 1550'-1450'
CUT CASING @ +/- 1500'

TOC @ +/- 1600'

CIBP @ 1900' W/ 35' CEMENT

PERFS 1936-1970'

4 1/2" @ 2004'
100 SX.

SPUD DATE: 12/29/83