

Submit 3 Copies To Appropriate District Office
 District I
 1625 N. French Dr., Hobbs, NM 87240
 District II
 811 South First, Artesia, NM 87210
 District III
 1000 Rio Brazos Rd., Aztec, NM 87410
 District IV
 2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico
 Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION

2040 South Pacheco
 Santa Fe, NM 87505

Form C-103
 Revised March 25, 1999

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-005-60153
1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other WIW <input type="checkbox"/>		5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator Saga Petroleum LLC		6. State Oil & Gas Lease No. 6647
3. Address of Operator 415 W Wall, Suite 1900 Midland, TX 79701		7. Lease Name or Unit Agreement Name Double L Queen Unit Tract 19 Fed Agree 8910160560
4. Well Location Unit Letter <u>P</u> - 990 feet from the <u>S</u> line and 330 feet from the <u>E</u> line Section 1 Township 15S Range 29E NMPM County CHAVES		8. Well No. 3
10. Elevation (Show whether DR, RKB, RT, GR, etc.) 3884 GR		9. Pool name or Wildcat Double L Queen

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK <input type="checkbox"/> PLUG AND ABANDON <input checked="" type="checkbox"/> TEMPORARILY ABANDON <input type="checkbox"/> CHANGE PLANS <input type="checkbox"/> PULL OR ALTER CASING <input type="checkbox"/> MULTIPLE COMPLETION <input type="checkbox"/> OTHER: <input type="checkbox"/>		SUBSEQUENT REPORT OF: REMEDIAL WORK <input type="checkbox"/> ALTERING CASING <input type="checkbox"/> COMMENCE DRILLING OPNS. <input type="checkbox"/> PLUG AND ABANDONMENT <input type="checkbox"/> CASING TEST AND CEMENT JOBS <input type="checkbox"/> OTHER: <input type="checkbox"/>	
--	--	--	--

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting and proposed work). SEE RULE 1103. For Multiple Completions: Attach diagram of proposed completion or recompletion.

Intent to P&A this SI WIW

MIRU, POOH w/rods, NU BOP, POOH w/tbg (5-1/2" 14.5# csg @ 2043' w/300 sx)

Set CIBP @ 1950' w/35' cmt on top

RIH, circ well w/9.8# mud

POOH to 1300', spot 100' cmt plug, perf 5-1/2" csg @ 1300', squeeze 100' cmt plug inside & outside 5-1/2" csg, tag

POOH to 390', spot 100' cmt plug - perf & squeeze @ 392' - fill annulus w/cmt - tag plug


(8-5/8" 20# csg @ 330' w/175 sx)

Perf 5-1/2" csg @ 50', circ cmt to surface

Cut off WH, install dry hole marker

* Brine Gel between all cement plugs.

Notific N.M.O.C.O. to witness plugging operations.

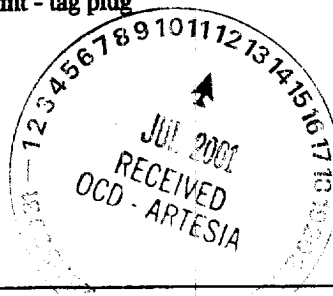

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Bonnie Husband TITLE Production Analyst DATE 03/23/2001

Type or print name Bonnie Husband

Telephone No. (915)684-4293

(This space for State use)

APPROVED BY Mike Sheppard TITLE Envir. Eng. Supv. I DATE 7/23/2001

Conditions of approval, if any: