


GP II, INC.

P & A WELLBORE DIAGRAM

WELL: STATE R #4
 FIELD: SQUARE LAKE
 INTERVAL: GB-SA

LOCATION:
 1980' FNL & 1980' FWL
 SEC 32, T-16-S, R-31-E
 EDDY COUNTY, NEW MEXICO

THIS WELL WAS RE-ENTERED IN 1959 AFTER ALREADY HAVING BEEN PLUGGED.
 TWO BAILER AND A STRING OF CABLE TOOLS WERE LOST IN THE HOLE AND THE WELL
 WAS REPLUGGED AS SHOWN. THE ORIGINAL PLUGGING REPORT IS UNAVAILABLE

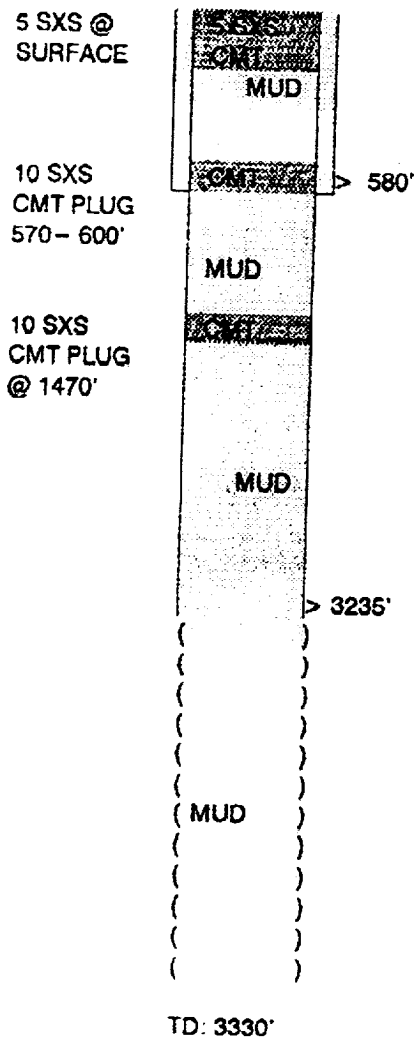

SURFACE CASING:
 RAN 8 5/8" CSG, SET @ 598'
 CMT. W/ 50 SXS., TOC @ 393' (CALC.)

PRODUCTION CASING:
 RAN 5 1/2" CSG, SET @ 3209'.
 CMT W/ 100 SXS, TOP OF CEMENT @ 2600' (CALC.)

OPEN HOLE
 3209' TO 3330'

PLUGS:
 PLUG #1 - 10 SXS @ 2500'
 PLUG #2 - 10 SXS @ 500'
 PLUG #3 - 5 SXS @ SURFACE