

UNITED STATES DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

NM OIL CONSV. COMMISSION  
ARTESIA, NM 88210

Form approved.  
Budget Bureau No. 42-R1424

6. LEASE DESIGNATION AND SERIAL NO.

LC 063368

7. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

SQ. LAKE FLOOD (EAST)

8. FARM OR LEASE NAME

TEXAS TRADING

9. WELL NO.

#5

10. FIELD AND POOL, OR WILDCAT

Square Lake (G.SA)

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Sec. 33-16S-31E

12. COUNTY OR PARISH

Eddy

13. STATE

New Mexico

SUNDY NOTICES AND REPORTS ON WELLS  
(Do not use this form for proposals to drill or to deepen or plug back to a well. Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☐ OTHER ☐

WIW - TA

MAR 22 1983

2. NAME OF OPERATOR

NEWMONT OIL COMPANY

O. C. D.

3. ADDRESS OF OPERATOR

ARTESIA, OFFICE

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.)

At surface

1980' FSL & 1980' FWL Sec. 33-16S-31E

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, CR, etc.)

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON\*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT\*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

The above well was plugged and abandon as follows:

8/17/82.....Spotted 50 sacks cement at 3324'.


8/18/82.....Tagged bottom plug at 2215'. Tested csg 700#. Perf base of salt at 1660'. Squeezed w/40 sacks cement 1100# psi.

8/19/82.....Tag plug at base of salt at 1161'. Perf top of salt at 705'. Cement 42 sacks between 5 1/2" and 8 5/8" cemen 40 sacks between 3 1/2 and 5 1/2". Cement 30 sacks in 3 1/2". Circ. 14 sacks to pit.

8/20/82.....Hole in surface csg... Circ. w/21 sacks cement.

Set dry hole marker at surface

Location ready for inspection.

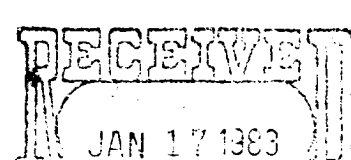

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

Area Manager

DATE

1/11/83

(This space for Federal or State Approval)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

MAR 18 1983

FOR

JAMES A. GILLHAM

DISTRICT SUPERVISOR

\*See Instructions on Reverse Side

posted 22 2  
19 83  
+ p 211