

457  
8p


Submit 3 Copies To Appropriate District Office  
District I  
 1625 N. French Dr., Hobbs, NM 88240  
District II  
 1301 W. Grand Ave., Artesia, NM 88210  
District III  
 1000 Rio Brazos Rd., Aztec, NM 87410  
District IV  
 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
 Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION  
 1220 South St. Francis Dr.  
 Santa Fe, NM 87505

Form C-103  
 Revised March 25, 1999

<b>SUNDRY NOTICES AND REPORTS ON WELLS</b> (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-015-23658
1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator Beach Exploration, Inc.		6. State Oil & Gas Lease No.
3. Address of Operator 800 North Marienfeld, Ste. 200		7. Lease Name or Unit Agreement Name: Red Lake Unit
4. Well Location Unit Letter <u>G</u> : 1986 feet from the North line and 1983 feet from the East line Section 36 Township 16S Range 29E NMPM County Eddy		8. Well No. 24
10. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. Pool name or Wildcat Red Lake, East

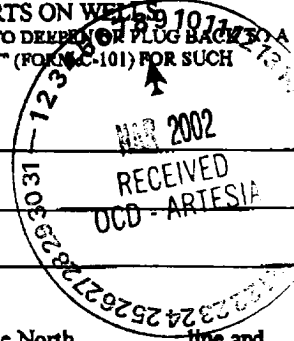

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input checked="" type="checkbox"/>	CHANGE PLANS <input checked="" type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPLETION <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.
- 25sx plug @ 1750' - 7A1
- 1 RU Well Pluggers
  - 2 RIH to CIBP, load hole w/10ppg mud, POOH
  - 3 RIH, perforate 4 1/2" csg at 750', POOH
  - 4 RIH to 750', pump 55sx plug (cover 635' - 750') (Yates & B Salt plug)
  - 5 Tag Yates/B Salt plug at 635'. POOH
  - 6 RIH, perforate 4 1/2" csg at 368', POOH
  - 7 RIH to 368', pump 45sx cmt plug (cover 240'-368') (Csg shoe & T Salt plug)
  - 8 Tag csg shoe/T Salt plug at 240'
  - 9 Cutoff wellhead 3' below surface
  - 10 Pump 16sx surface plug in 4 1/2" csg and 8 5/8" x 4 1/2" annulus from surf to 60'
  - 11 Install 4" dry hole marker w/4' above ground w/required info stenciled on pipe
- Notify OCD 24 hrs. prior to any work done

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Lizbeth Lodle TITLE Engineering Analyst

DATE March 8, 2002

Type or print name Lizbeth Lodle

Telephone No. 915-683-6226

(This space for State use)

APPROVED BY [Signature] TITLE Field Rep

DATE MAR 13 2002

Conditions of approval, if any: