

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPlicate
(Other instructions on reverse side)

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

45F

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		NM OIL CONS. COMMISSION	
2. NAME OF OPERATOR Yates Petroleum Corporation ✓		Drawer DD Artesia, NM 88210	
3. ADDRESS OF OPERATOR 207 South 4th St., Artesia, NM 88210		7. UNIT AGREEMENT NAME	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1650 FSL & 2310 FEL, Sec. 26-T16S-R31E		8. FARM OR LEASE NAME Hedgehog ABM Federal	
14. PERMIT NO.		9. WELL NO. 1	
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 4131.5' GR		10. FIELD AND POOL, OR WILDCAT Undes. Square Lake Grayburg SA	
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Unit J, Sec. 26-16S-31E	
		12. COUNTY OR PARISH Eddy	13. STATE NM

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

PULL OR ALTER CASING

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other) Perforate, Treat

REPAIRING WELL

ALTERING CASING

ABANDONMENT*


(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

3-22-85. TD 4720'. WIH and perforated 4366-77' w/11 .42" holes as follows: 4366, 67, 68, 69, 70, 71, 72, 73, 76, 77 and 78'. Pull packer above all perfs 4260-92' and acidize perforations 4260-92' and 4366-77' w/1500 gals 15% NEFE acid, 40 ball sealers.

3-25-85. Frac'd perforations 4260-92 and 4366-77' w/40000 gals gelled 2% KCL water, 80000# 20/40 sand, 2000 gals 15% NEFE acid.

3-26-85. Ran tubing, rods and hung well on pump. (Previously reported 3-29-85.)

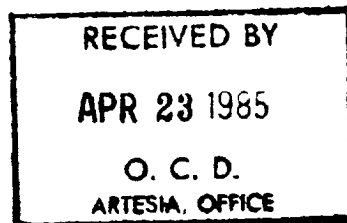

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE Production Supervisor

DATE 4-17-85

(This space for Federal or State office use)

APPROVED BY

ACCEPTED FOR RECORD

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

APR 17 1985

*See Instructions on Reverse Side