

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

Oil Cons.
N.M. Div-Dist. 2
1301 W. Grand Avenue
Artesia, NM 88210

FORM APPROVED
Budget Bureau No. 1004-0135
Expires March 31, 1993

C/S

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☐ Oil Well ☒ Gas Well ☐ Other _____

2. Name of Operator

DEVON SFS OPERATING, INC. /

3. Address and Telephone No.

20 NORTH BROADWAY, SUITE 1500, OKLAHOMA CITY, OKLAHOMA 73102 (405) 235-3611

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1310' FNL & 1730 FWL, Sect 20, T16S-R28E, Unit C

5. Lease Designation and Serial No.

NM-103872

6. If Indian, Allottee or Tribe Name

N/A

7. If Unit or CA, Agreement Designation

26861

8. Well Name and No.

Crow Flat 20 Fed Com #2

9. API Well No.

30-015-31921

10. Field and Pool, or Exploratory Area

Crow Flat (Morrow)

11. County or Parish, State

Eddy, NM

CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION


- ☐ Abandonment
☒ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other _____

- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Devon SFS Operating, Inc. plans to abandon Lower Morrow and Perforate Upper Morrow Stringers as follows: TOH w/ tub, pac & RBP. TIH w/CIBP, set CIBP @ $\pm 9460'$. TIH w/bailer, dumped 35' cement on CIBP @ 9460-9425'. Test CIBP to 1000 psi. Perforate Upper Morrow 9300' - 9305, 9171'-9175, 9118' - 9124 3 JSPF for a total of 54 holes (.46"EHD). TIH w/pac & tgb, SDON. Acidize Upper Morrow 9118' - 9305' w/1500 gal 7 1/2% morrow acid + 30% methanol. Swab and Hang well on production

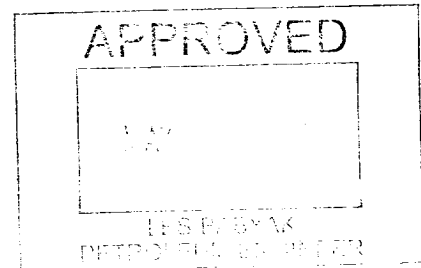

14. I hereby certify that the foregoing is true and correct

Signed *Karen A. Cottom*

Karen A. Cottom

Title Engineering Technician

Date May 1, 2002

(This space for Federal or State office use)

Approved by _____

Title _____

Date _____

Conditions of approval, if any: