

| | |
|------------------------|---|
| NO. OF COPIES RECEIVED | |
| DISTRIBUTION | |
| SANTA FE | 1 |
| FILE | 1 |
| U.S.G.S. | 1 |
| LAND OFFICE | 1 |
| OPERATOR | 1 |

NEW MEXICO OIL CONSERVATION COMMISSION

FEB 03 1981

O. C. D.

ARTESIA, OFFICE

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

| |
|---|
| 5a. Indicate Type of Lease State <input type="checkbox"/> Fed. <input type="checkbox"/> Fee <input type="checkbox"/> |
| 5. State Oil & Gas Lease No. LC 029028J |
| 7. Unit Agreement Name |
| 8. Farm or Lease Name Parke |
| 9. Well No. 1 2 |
| 10. Field and Pool, or Wildcat Sq Lake Gbg S.A. |
| 12. County Eddy |

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

| | |
|--|-----------------|
| 1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- Injection Well | JAN 16 1981 |
| 2. Name of Operator BOYD OPERATING COMPANY ✓ | O. C. D. |
| 3. Address of Operator P. O. Box 1756, Roswell, New Mexico 88201 | ARTESIA, OFFICE |
| 4. Location of Well UNIT LETTER B 660 FEET FROM THE North LINE AND 1980 FEET FROM THE East LINE, SECTION 3 TOWNSHIP 17S RANGE 30E NMPM. | |

15. Elevation (Show whether DF, RT, GR, etc.)
3742 G.L.

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:


| | |
|--|---|
| PERFORM REMEDIAL WORK <input type="checkbox"/> | PLUG AND ABANDON <input type="checkbox"/> |
| TEMPORARILY ABANDON <input type="checkbox"/> | CHANGE PLANS <input type="checkbox"/> |
| PULL OR ALTER CASING <input type="checkbox"/> | OTHER <input type="checkbox"/> |

SUBSEQUENT REPORT OF:

| | |
|---|---|
| REMEDIAL WORK <input checked="" type="checkbox"/> | ALTERING CASING <input type="checkbox"/> |
| COMMENCE DRILLING OPNS. <input type="checkbox"/> | PLUG AND ABANDONMENT <input type="checkbox"/> |
| CASING TEST AND CEMENT JOB <input type="checkbox"/> | OTHER <input type="checkbox"/> |

17. Describe Proposed or Completed Operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 11/3/80 Rig up Berry Well Service and Star Tool reverse rig to clean out well. Go in hole with drill bit. Casing full of iron sulfite. Bit plugged on 20th jt. Pulled out of hole. Cleaned bit. Shut down.
- 11/4/80 Drilled 428' hole. Pull 10 stands. Shut down.
- 11/5/80 Drilling out iron sulfite. Made 700' of hole this day.
- 11/6/80 Cleaned well to T.D. Circulated well 30 min. Shut down.
- 11/7/80 Ran tubing back to bottom. Started swabbing well. Swabbed well 7 1/2 hrs. Recovered 14 bbls of oil. 388 bbls of water, shut down.
- 11/10/80 Swabbed well 2 hrs. Came out of hole laying down work string.
- 11/11/80 Ran 90 jts of 2 3/8" J55 plastic lined tubing w/Baker Tension Packer. Displaced annular space w/packer fluid. Set packer @ 2742' with 10 pts. tension.

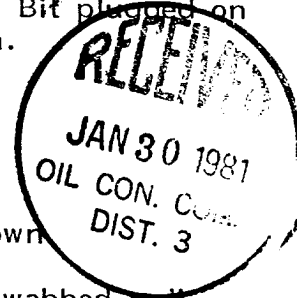

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED T. M. Boyd TITLE Operator

DATE 1/15/81

ACCEPTED FOR RECORD

JAN 26 1981

U.S. GEOLOGICAL SURVEY
ROSWELL, NEW MEXICO

APPROVED BY
CONDITIONS OF APPROVAL, IF ANY: