

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TR
(Other instructions
verse side)

CATE
OR

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☐ OTHER ☐	7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR Water Injection	8. FARM OR LEASE NAME Grayburg-Jackson Unit
3. ADDRESS OF OPERATOR Anadarko Production Company	9. WELL NO. Tract 7
4. LOCATION OF WELL (Report location, map, and in accordance with the State requirements. See also space 17 below.) At surface P.O. Box 260 Artesia, N.M. 88210 510' From South & 619 From East SE 1/4 SE 1/4 Sec. 27, T-17-S; R-30-E 22	10. FIELD AND POOL, OR WILDCAT Z-2
14. PERMIT NO. R-2323	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Grayburg-Jackson
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 364' Gr.	12. COUNTY OR PARISH Sec. 27, T-17-S; R-30-E
16. Eddy	13. STATE N.M.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF	☐	PULL OR ALTER CASING	☐
FRACTURE TREAT	☐	MULTIPLE COMPLETE	☐
SHOOT OR ACIDIZE	☐	ABANDON*	☐
REPAIR WELL	☐	CHANGE PLANS	☐
(Other)	☒		

SUBSEQUENT REPORT OF:

WATER SHUT-OFF	☐	REPAIRING WELL	☐
FRACTURE TREATMENT	☐	ALTERING CASING	☐
SHOOTING OR ACIDIZING	☐	ABANDONMENT*	☐
(Other)	☐		

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Intentions are to control water injection by installing liner.
5 1/2" 15# casing will be installed as liner, extending from 2920' to 3173' (253'). Liner will be squeezed with cement.
Perforations with Abrasi-Jet method from 3154 to 3162' (8')
A 5 1/2" Larkin Packer will be run on 2 3/8" EUE tubing and set in tension at 2950'.
7" casing shoe at 2956' and previously cemented with 100 sk.
Water injection will continue under Order NO. R-2323

RECEIVED

18. I hereby certify that the foregoing is true and correct

SIGNED *Lee Vickrey*

TITLE **Superintendent**


DATE **Jan 21, 1966**

(This space for Federal or State office use)

APPROVED BY *R. L. Beckman*
CONDITIONS OF APPROVAL, IF ANY

TITLE

DATE

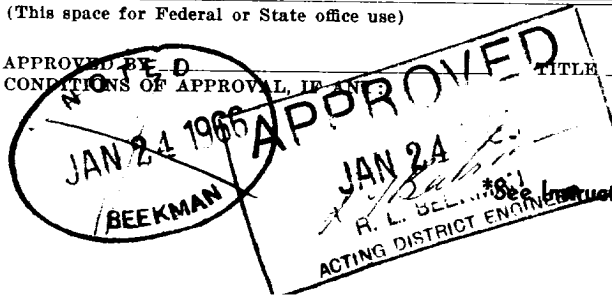

ACTING DISTRICT ENGINEER
Instructions on Reverse Side

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.