

Form 3160-5
(June 1990)

NM OIL CONS. COMMISSION
Drawer DD
Artesia, NM 88210

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

RECEIVED

AUG - 5 1993

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Anadarko Petroleum Corporation

3. Address and Telephone No.

P.O. Drawer 130, Artesia, NM 88211-0130 (505) 677-2411

4. Location of Well (Frontage, Sec., T., R., M., or Survey Description)

2310' FNL & 330' FWL
Section 31 - T17S - R30E

FORM APPROVED

Budget Bureau No. 1004 0119

Expires: March 31, 1993

5. Lease Designation and Serial No.

LC-028936d

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Federal L #3

9. API Well No.

30-015-04409

10. Field and Pool, or Exploratory Area

Loco Hills-Qn-GB-SA

11. County or Parish, State

Eddy, New Mexico

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

☒ Notice of Intent

☐ Subsequent Report

☐ Final Abandonment Notice

TYPE OF ACTION

☒ Abandonment

☐ Recompletion

☐ Plugging Back

☐ Casing Repair

☐ Altering Casing

☐ Other

☐ Change of Plans

☐ New Construction

☐ Non Routine Fracturing

☐ Water Shut Off

☐ Conversion to Injection

☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. RUPU. TOH with rods and tbq.
2. GIH and circulate hole full with 10# brine and salt gel mud.
3. Spot 50sx Class C cement with 2% CaCl from 2840' up to 2567'. This plug covers 7" casing shoe and Grayburg Formation top. Pull up and wait on cement. Tug top of plug.
4. Spot 25 sx Class C with 2%CaCl from 2305' up to 2160'. This plug covers Queen formation top. TOH. WOC.
5. GIH with perf gun and tag top of plug. Pull up and perf 4 squeeze holes at 1145' (100' below salt).
6. GIH with pker and cement squeeze with 30 sx Class C with 2% CaCl. Leaving 100' cement in and out of casing. This plug covers base of salt. WOC. Tag top of plug.
7. Run free point on 7" casing and cut off wherever it is free in the salt section. Pull 7" casing.
8. GIH and spot 100' plug (27sx), 50' in and out of casing stub. WOC. Tug top of plug. This plug covers 7" casing stub.
9. Spot 40 sx Class C with 2% CaCl from 615' up to 465'. WOC. Tag top of plug. This plug covers 8 5/8" casing shoe and top

14. I hereby certify that the foregoing is true and correct

Signed Mike Braswell

Title Field Foreman

Date 7/17/93

(This space for Federal or State office use)

(ORIG. SGD.) JOE G. LARA

Title _____

Date AUG 02 1993

Approved by
Conditions of approval, if any:

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

*See Instruction on Reverse Side

13. Cont..

of salt.

10. Run cement bond log to find cement top in 8 5/8" casing annulus. Perf squeeze holes at cement top. Circulate cement down 8 5/8" casing and out squeeze holes to surface. This plug covers 8 5/8" casing annulus and also serves as surface plug.
11. RDPU. Cut off all casing and anchors below ground level. Set P&A marker and clean location. Rip and reseed as per BLM orders.

FEDERAL "L" No. 3

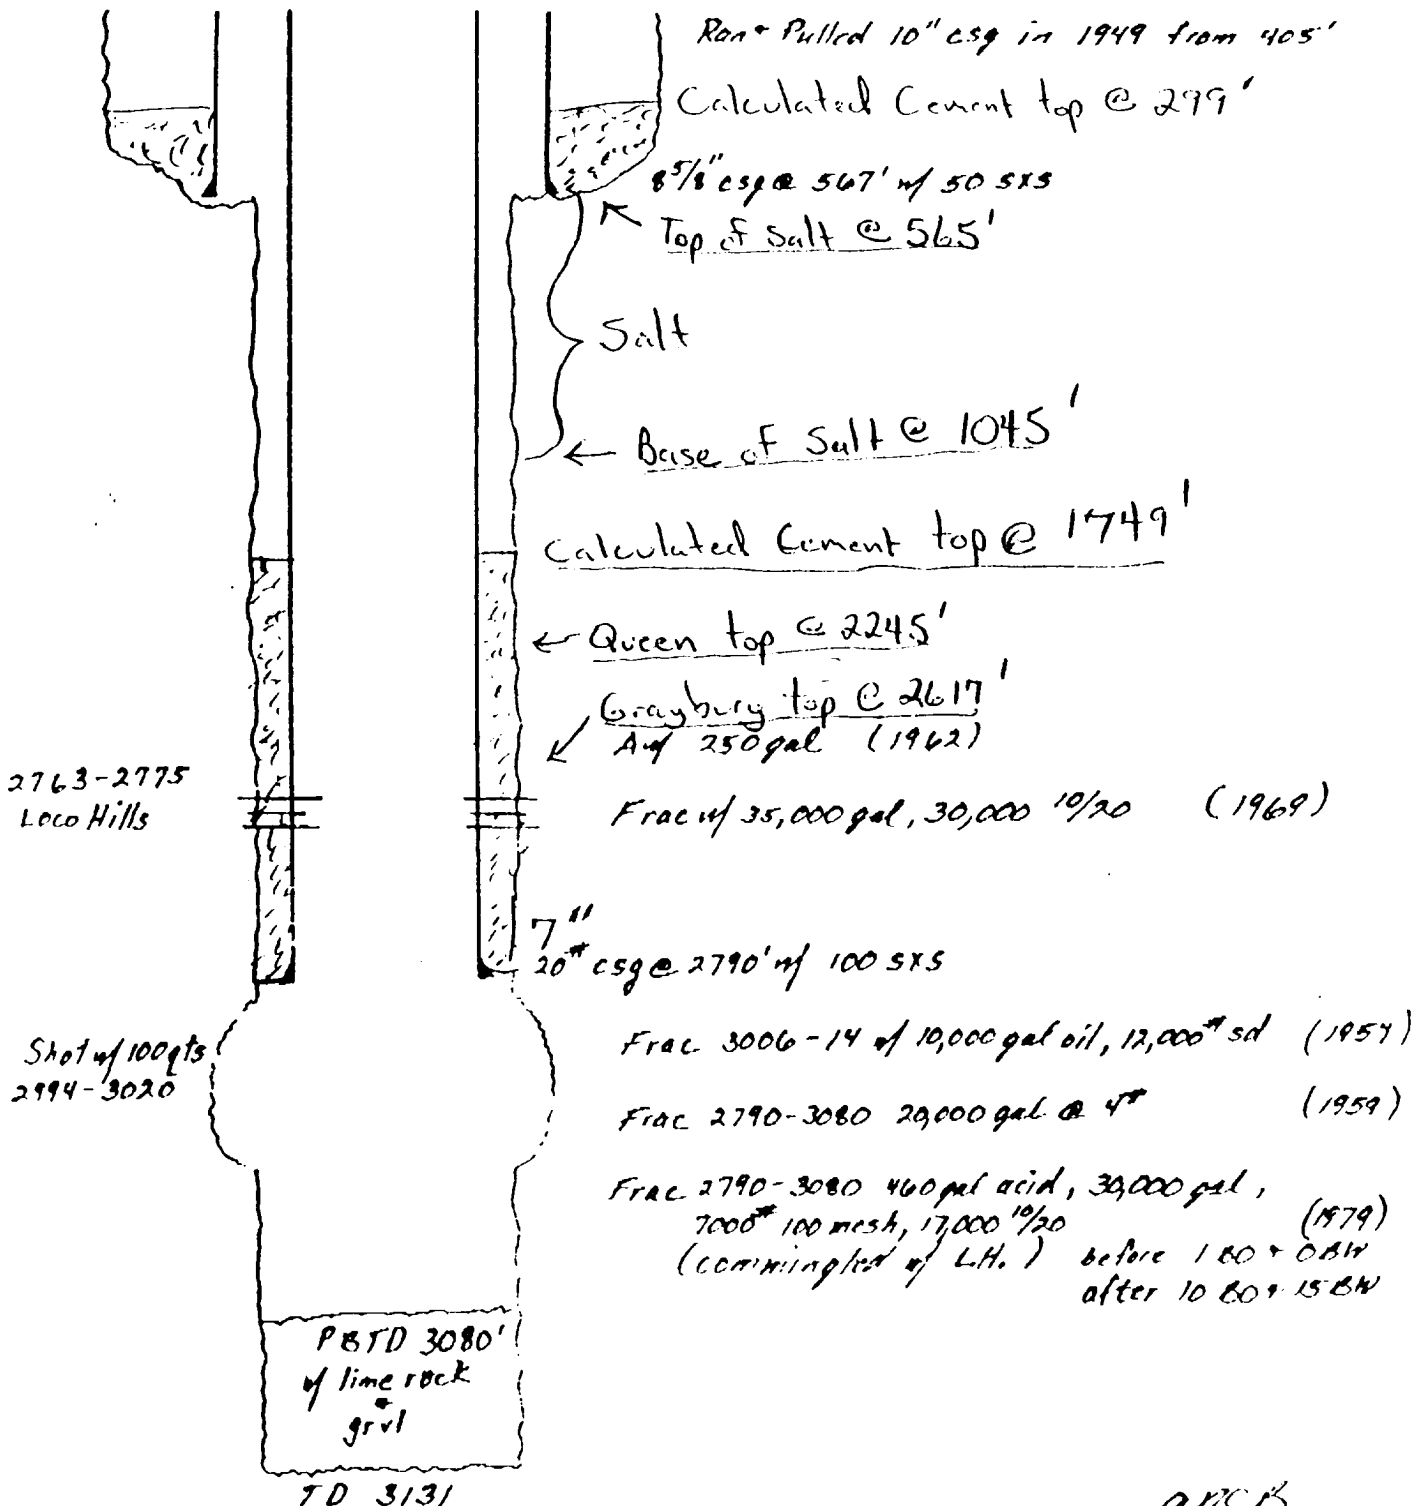
LH-Qn-Gb-SA FIELD

2310 FN + 330 W.L Sec 31-17S-30E

EDDY Co., N.M.

Before

Spudded June, 1949

P.R.S.B.
6/16/92

FEDERAL "L" No. 3

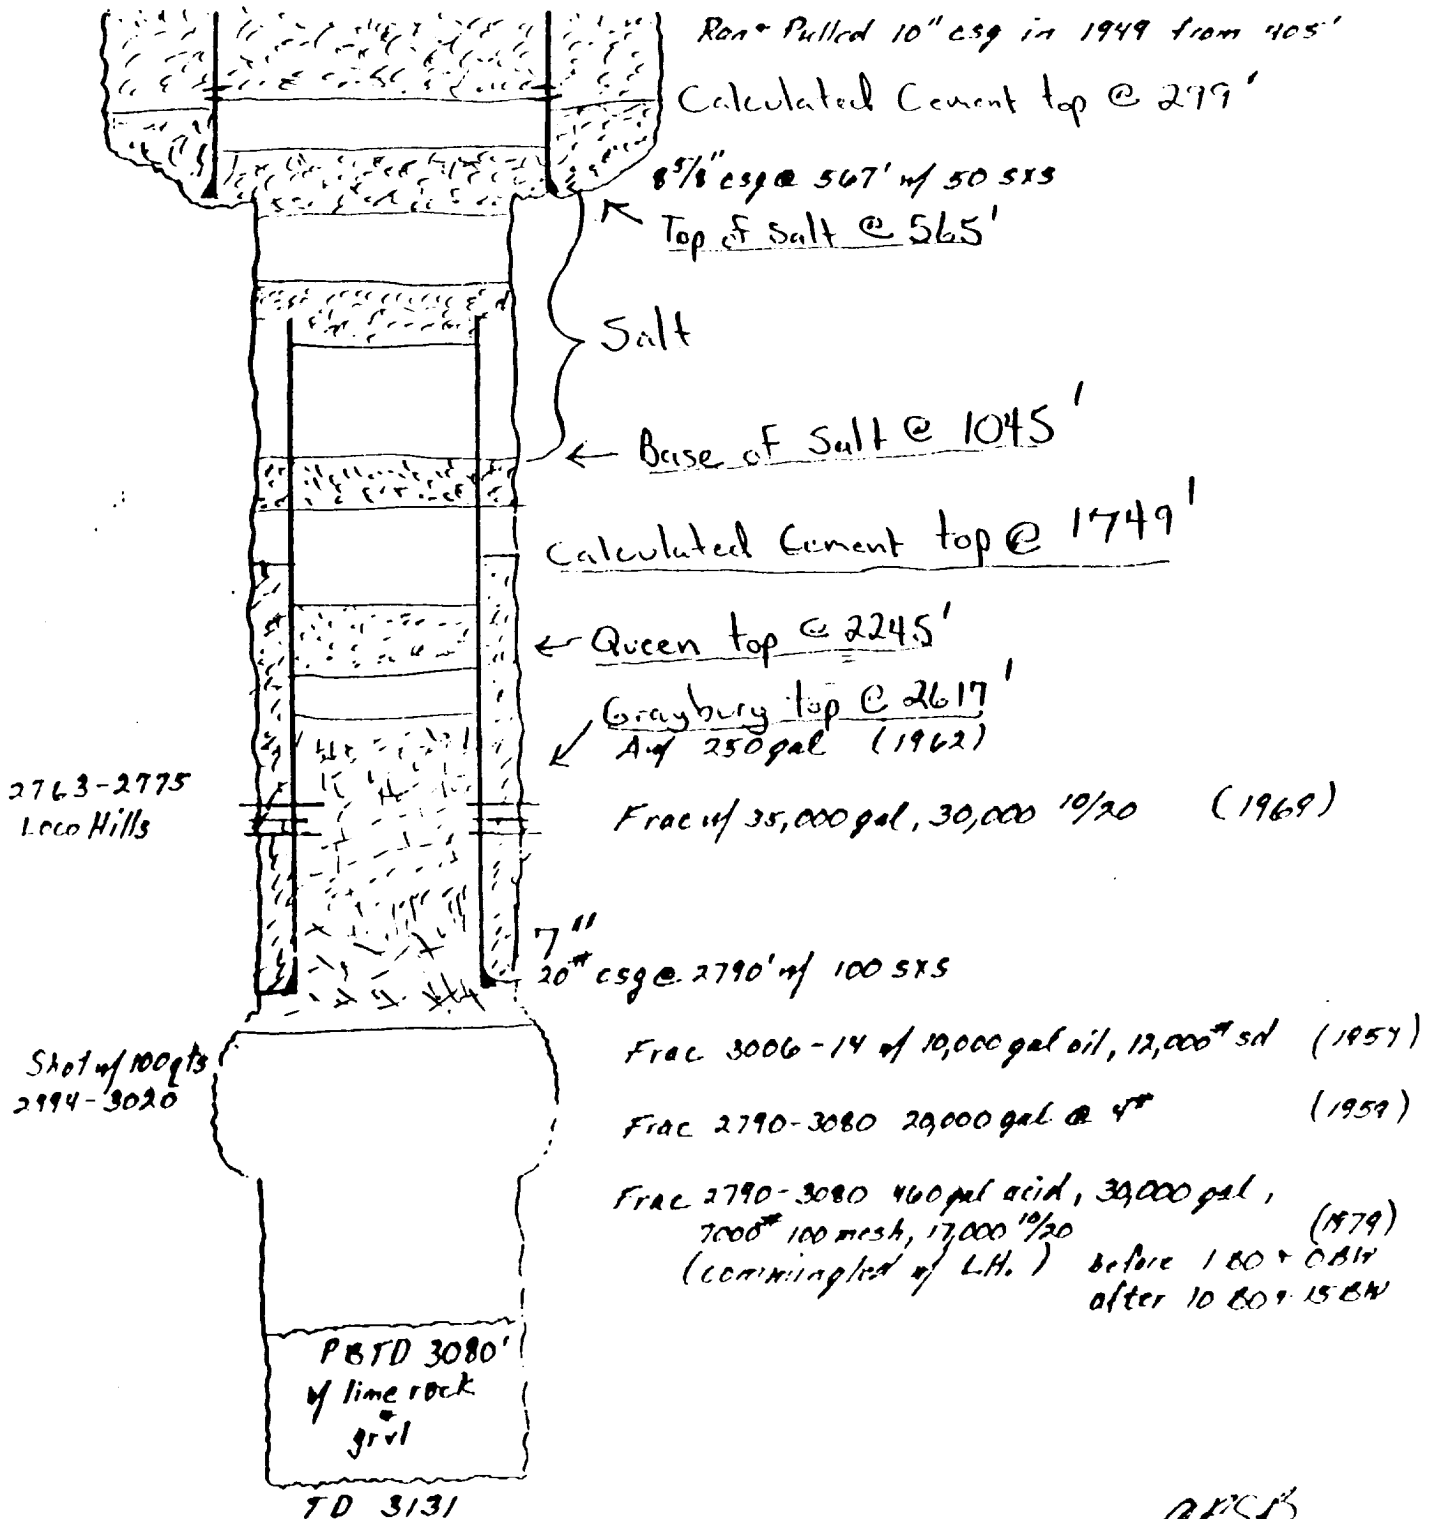
LH-Qn-Gb-SA FIELD

2310 FN + 330 W.L. Sec 31-17S-30E

EDDY Co., N.M.

After

Spudded June, 1949

PRSP
6/16/92