Form 3160-3 (December 1990)

# UNITED STATES DEPARTMENT OF THE INTERIOR

SUBMIT IN TRI CATE\*
(See other instructs. sn

Form approved.

approved.

CISF

	BUREAU OF LA			5.LEASE	DESIGNATION AND SERIAL	NO.	
APPLICATION FOR PERMIT TO DRILL OR DEEPEN					LC 029435-B 6.IF INDIAN, ALLOTTEE OR TRIBE NAME		
la TYPE OF WORK:	DRILL	DEEPEN 🔀		6.1F INDL	AN, ALLOTTEE OR TRIBE N	AME	
				7.UNIT A	GREEMENT NAME		
h TYPE OF WELL:	GAS WELL Other	SINOLE	MULTIPLE				
2 NAME OF OPERA		ZONE	ZONE	S.FARM C	OR LEASE NAME, WELL NO		
	DEVON ENERGY OPERA	ATING CORPORATION			el "B" #9		
3. ADDRESS AND T				9.API WE			
	20 N. BROADWAY, SUIT			30-015-0	AND POOL, OR WILDCAT	•	
	ELL (Report location clearly and in a 0' FNL & 660' FEL of Section 5	ccordance with any State require	ements)*		rg-Jackson Field		
711 30111100 1701	o 1712 de 600 TEE di Secului S				,R.,M.,OR BLOCK AND SUR	VEY OR AREA	
At top proposed proc	d. zone (SAME)			Section	Section 5 - T17S - R31E		
14.DISTANCE IN MILES A	ND DIRECTION FROM NEAREST TOWN O	R POST OFFICE*	-	12. COUN	TY OR PARISH	13. STATE	
4 miles NE of Loco H	ills, NM			Eddy C	Eddy County NM		
15.DISTANCE FROM PRO LOCATION TO NEAR		16.NO. OF ACRES IN LEASE			17.NO. OF ACRES ASS	GIGNED	
PROPERTY OR LEASE		1885			TO THIS WELL		
(Also to nearest drig, unit in 18.DISTANCE FROM PRO	line if any) POSED LOCATION®	19.PROPOSED DEPTH			40		
	DRILLING, COMPLETED,	20500			20.ROTARY OR CABL	E IOOLS.	
21.ELEVATIONS (Show wh		3   5,500	·	1 22 4	Rotary PPROX. DATE WORK WILL	STADT*	
GL 3905'				i	y 1, 1996	SIARI	
23.		PROPOSED CASING AND C	EMENTING PROCESS	,		<del> </del>	
SIZE OF HOLE	GRADE, SIZE OF CASING	WEIGHT PER FOOT	SETTING DE		QUANTITY OF	CEMENT	
12"	10 3/4" H-40	32.75#	659'		100 sxs		
8"	7" J-55	24#	3082'		200 sxs	<del></del>	
	)', Open Hole Completion 3082'- 395 erted to WIW	50°	RECE APR 09 OIL CON DIST	1996 1. DIV.		RESEIVED.	
is to arm or deepen un	ESCRIBE PROPOSED PROGRAM rectionally, give pertinent data on su	i: If proposal is to deepen, give bsurface locations and measur	data on present productive ed and true vertical depths	e zone and propo . Give blowout	osed new productive zor preventer program, if a	ie. If proposal ny.	
IN ABOVE SPACE Disto drill or deepen di 24.	ESCRIBE PROPOSED PROGRAM rectionally, give pertinent data on su	i: If proposal is to deepen, give hsurface locations and measur	data on present productived and true vertical depths	e zone and prope s. Give blowout	osed new productive zor preventer program, if a	ie. If proposal ny.	
24.	ESCRIBE PROPOSED PROGRAM rectionally, give pertinent data on su	Dands	ed and true vertical depths y Jackson	. Give blowout	preventer program, if a	ny.	
SIGNED <u>V</u>	recuonamy, give perunent data on su	Dands	ed and true vertical depths y Jackson	. Give blowout	osed new productive zor preventer program, if a ruary 23, 1996	ny.	
SIGNED VC	eral or State office use)	Randy	y Jackson ct Engineer	DATE Feb	preventer program, if a	ny.	
SIGNED VO	eral or State office use)	Randy TITLE Distric	y Jackson t Engineer APPROVAL DAT	DATE <u>Febr</u>	preventer program, if a	ny.	
SIGNED //C (This space for Federal NO	eral or State office use)	Randy TITLE Distric	y Jackson t Engineer APPROVAL DAT	DATE February	ruary 23, 1996	ny.	

## **DEVON ENERGY OPERATING CORPORATION**

# HYDROGEN SULFIDE DRILLING OPERATIONS PLAN

### A. Hydrogen Sulfide Training

All rig crews and company personnel will receive training from a qualified instructor in the following areas prior to penetrating any hydrogen sulfide bearing formations during drilling operations:

- 1. The hazards and characteristics of hydrogen sulfide (H2S).
- 2. The proper use and maintenance of the H2S safety equipment and of personal protective equipment to be utilized at the location such as H2S detection monitors, alarms and warning systems, and breathing equipment. Briefing areas and evacuation procedures will also be discussed and established.
- 3. Proper rescue techniques and procedures will be discussed and established.

In addition to the above, supervisory personnel will be trained in the prevention of oil and gas well blowouts in accordance with Minerals Management Service Standards Subpart - 0 - 250 - 212.

Prior to penetrating any known H2S bearing formation, all rig crews and company personnel will be required to have received appropriate H2S training course and have certification of such training. All contract personnel employed on an unscheduled basis will be required to have received appropriate H2S training.

This Hydrogen Sulfide Drilling And Operations Plan shall be available at the wellsite during drilling operations.

### **B. H2S Safety Equipment And Systems**

All H2S safety equipment and systems will be installed, tested, and operational when drilling operations reaches a depth approximately 500' above any known or probable H2S bearing formation. The safety systems to be utilized during drilling operations are as follows:

## 1. Well Control Equipment

- (a) Double ram BOP with a properly sized pipe rams to accommodate all pipe sizes in use.
- 2. H2S Detection And Monitoring Equipment
  - (a) Two (2) H2S detection monitors will be placed in service at the location. One monitor will be placed on the rig floor and, one will be at the working mud pits. This monitoring system will have warning lights and audible alarms that will alert personnel when H2S levels reach 20 ppm.
  - (b) One (1) Sensidyne Pump with the appropriate detection tubes will also be available to perform spot checks for H2S concentrations in any remote or isolated areas.
- 3. Protective Equipment For Essential Personnel

Protective equipment will consist of the following:

- (a) One (1) five minute escape pack will be available for the rig's derrick man.
- (b) Two (2) thirty minute rescue packs to be located at the designated briefing areas.
- 4. Visual Warning System

Visual warning system will consist of the following:

- (a) Two wind direction indicators.
- (b) One condition / warning sign which will be posted on the road providing direct access to the location. The sign will contain lettering of sufficient size to be readable at a reasonable distance from the immediate location. The sign will inform the public that a hydrogen sulfide gas environment could be encountered be at the location.

## 5. Mud Program

(a) The mud program has been designed to minimize the volume of H2S circulated to surface. Proper mud weight and safe drilling practices (for example, keeping the hole filled during trips) will minimize hazards when drilling in H2S bearing formations.

### 6. Metallurgy


(a) All drill strings, casings, tubing, wellhead, blowout preventers, drilling spools, kill lines, choke manifold and lines, and valves shall be suitable for H2S service.

#### 7. Communication

(a) Two way radio and cellular telephone communication will be available in company vehicles.


## C. Diagram Of Drilling Location

1. Attached is a diagram representing a typical location layout as well as the location of H2S monitors, briefing areas, and wind direction indicators.

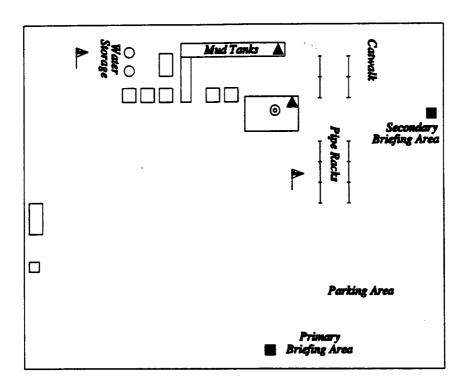

▲ H2S MONITORS WITH ALARMS AT THE RIG FLOOR, AND STEEL MUD PITS WIND DIRECTION INDICATORS

SAFE BRIEFING AREAS WITH CAUTION SIGNS AND PROTECTIVE BREATHING EQUIPMENT

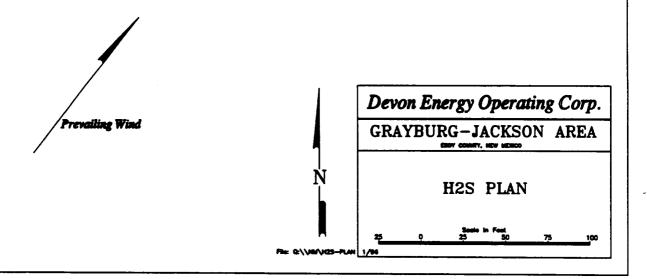

#### EXHIBIT 1

# MINIMUM BLOWOUT PREVENTER REQUIREMENTS 3000 pel Working Pressure

#### 3 MWP

#### STACK REQUIREMENTS

No.	Item		Min. L.D.	Min. Nominal
1	Stripping head			
2	Two single or one dual hydraulically operated rams			
3	Tubing head W/2-2" outlets			
4	2° min. kill line and 3° min. choke line outlets in ram. (alternate to 3 above)			
5	Valve	Gate  Plug	2	
6	Valve	Gate  Plug	2*	
7	Casing head	-		
8	Valve	Gate  Plug	1-13/16*	
9	Pressure gage with needle valve			

## OPTIONAL

10	Flanged valve	1-13/16*	

## **CONFIGURATION A STRIPPING HEAD BLIND RAMS** 2 **PIPE RAMS** O (6) TUBING **HEAD** (10)5 **CASING HEAD** (8) (7 8 **CASING**

#### MEC TO FURNISH

- 1. Bradenhead or casinghead and side valves.
- 2. Wear bushing, if required.

#### **GENERAL NOTES**

- 1. Deviations from this drawing may be made only with the express permission of MEC's Drilling menager,
- 2. All connections, valves, fittings, piping, etc., subject to well pump pressure must have minimum working pressure of preventers up through choice. Valves must be full opening and suitable for high pressure mud service.
- 3. Controls to be of standard design and each marked, showing opening and closing position.
- 4. All valves to be equipped with handwheels or handles ready for immediate use.
- 5. Choke lines must be suitably anchored.
- 6. Handwheels and extensions to be connected and ready for use.
- 7. All seamless steel control piping (3000 pei working pressure) to have flexible joints to avoid stress. Hoses will be permitted.
- 8. Casinghead connections shall not be used except in case of emergency.

#### H. E. WEST "A" & "B" WATERFLOOD EXPANSION

## **Deepening Wells Prior to Conversion**

Devon Energy Operating Corporation plans to deepen the subject wells utilizing a completion unit in conjunction with a reverse circulating unit. A standard 3000 psi working pressure double ram BOP with a stripping head will be utilized. Since all wells proposed for deepening have casing set and are cemented below 2500', a conventional choke manifold is not needed. The BOP and stripping head have the capability of controlling flow while drilling and / or shutting the well in:

All drilling fluids will be contained in steel pits. No reserve pit will be needed. All proposed work will be contained on the original pad with no disturbance to the surrounding area.

The drilling mud program will be a 9.0 ppg - 10.0 ppg brine water. This should be sufficient weight to allow circulation of drilling fluids to the surface while at the same time controlling the reservoir pressures customary for this area.