

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

N.M. Oil Conservation Division
811 S. 1st St., Apt
Artesia, NM 88210-2834

FORM APPROVED
OMB No. 1004-0135
Expires November 30, 2000

CISF

SUNDRY NOTICES AND REPORT ON WELLS
Do not use this form for proposals to drill or to re-enter an
abandoned well. Use Form 3160-3 (APD) for such proposals.

SUBMIT IN TRIPLICATE - Other instructions on reverse side

1. Type of Well
Oil Well ☐ Gas Well ☐ ☒ Other ☐ Injection well

2. Name of Operator
Pendragon Energy Partners, Inc.

3. Address of Operator
621 17th St., Suite 750, Denver CO 80293

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)
660' FSL-1980' FWL-Sec 22-T17S-R30-E

5. Lease No. LC-028992 (j)

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No.

Grayburg Jackson TR. 5

8. Well Name and No.

5-1 #1

9. API Well No.

10. Field and Pool, or Exploratory Area

11. County or Parish, State

Eddy

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

TYPE OF ACTION

☐ Notice of Intent

☒ Subsequent Report

☐ Final Abandonment Notice

☐ Acidize

☐ Alter Casing

☐ Casing Repair

☐ Change Plans

☐ Convert to Injection

☐ Deepen

☐ Fracture Treat

☐ New Construction

☒ Plug and Abandon

☐ Plug Back

☐ Production (Start/Resume)

☐ Reclamation

☐ Recomplete

☐ Temporarily Abandon

☐ Water Disposal

☐ Water Shut-Off

☐ Well Integrity

☐ Other

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomple horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection).

Abandonment History:

Feb 6, 2001: Pump 50 sxs cement thru packer @ 2376' @ 1500 psi.

Feb 7, 2001: Tag cement top @ 2538'.

: Set CIBP @ 2525' & spot 35' cement on top.


: Perforate casing @ 1400'. Squeeze 30 sxs cement
into perforations @ 950 psi.

Feb 8, 2001: Tag cement top @ 1262'. Perforate @ 546'.

: Pump 30 sxs cement thru packer @ 200'. Tag @ 411'.

: Perforate @ 50', pump 25 sxs cement to surface.

Note: All equipment & debris will be removed and the surface
restored to original conditions and reseeded per BLM.

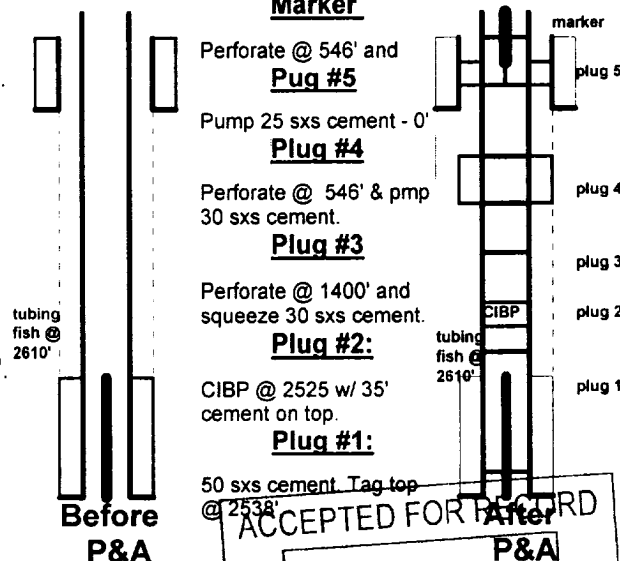

14. I hereby certify that the foregoing is true and correct
Name (Printed/Typed)

John Luchetta

Title

Agent

Signature

John Luchetta

Date

April 11, 2001

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by

Conditions of approval, if any, are attached. Approval of this notice does not warrant or
certify that the applicant holds legal or equitable title to those rights in the subject lease
which would entitle the applicant to conduct operations thereon.

Title

Date

Office

RECEIVED

2001 MAY -4 AM 9:15

BUREAU OF LAND MGMT.
ROSWELL OFFICE