

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

5. Lease Designation and Serial No.
LC-028793-C

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

NMNM88525X

8. Well Name and No.

BURCH KEELY UNIT #26

9. API Well No.

30-015-20571

10. Field and Pool, or Exploratory Area

GRBG JACKSON SR Q GRBG SA

11. County or Parish, State

EDDY CO., NM

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT-" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator


MARBOB ENERGY CORPORATION

3. Address and Telephone No.

PO BOX 227, ARTESIA, NM 88210 505-748-3303

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1980 FSL 660 FEL, SEC. 18-T17S-R30E, UNIT I

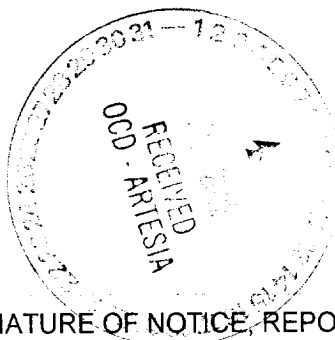

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

Notice of Intent

Subsequent Report

☒ Final Abandonment Notice

TYPE OF ACTION

☒ Abandonment
Recompletion
Plugging Back
Casing Repair
Altering Casing
Other

Change of Plans
New Construction
Non-Routine Fracturing
Water Shut-Off
Conversion to Injection
Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

PLUG AND ABANDON WELL AS FOLLOWS:

10/10/01 - RECEIVED VERBAL APPROVAL TO P & A WELL FROM MR. GLASS - BLM ROSWELL. RIH W/ TBG & RODS, SPOT 50 SX OF P+ @ 3561'. POOH W/ TBG, WAIT 2 HRS, RIH & PERF 2 SQUEEZE HOLES @ 542'. RIH & TAG @ 2600', SPOT 100 SX P+, POOH, WAIT 2 HRS, RIH & TAG @ 1600'.

10/11/01 - PICK UP CEMENT RETAINER. RIH W/ 7 STDS FROM DERRICK, PICK UP 1 JT, RU & PUMP THRU TOOL. SET TOOL @ 465'. EST INJ RATE 3 BPM @ 150 PSI. MIX & PUMP 125 SX P+ NEAT CMT, STING OUT OF RETAINER. PUMP 30 SX P+ NEAT FROM CEMENT RETAINER 465' TO SURFACE. TOP OUT CASING W/ CEMENT, PUMP 45 SX P+ NEAT DOWN 4 1/2" ANNULUS. RDMO WOU. WELL P & A @ 9:30 AM ON 10/11/01.

Post Post

14. I hereby certify that the foregoing is true and correct

Signed

Title PRODUCTION ANALYST

Date 01/08/02

(This space for Federal or State office use)

Approved by
Cor

Title

Date

Accepted for record

Title
state

Only 1-11-02

and willfully to make to any department or agency of the United States any false, fictitious or fraudulent

*See Instruction on Reverse Side